

HOME REPORT



DM HALL
CHARTERED SURVEYORS

Home Report

Property: **1/2
38 Niddrie Road
Glasgow
Lanarkshire
G42 8NR**

Prepared for: **Moya Black**

Prepared by: **Scott Baird, BSc MRICS**

Report reference: **1041941-1-2**

Date of Report: **14/09/2020**

ENERGY PERFORMANCE CERTIFICATE



DM HALL
CHARTERED SURVEYORS

Energy Performance Certificate (EPC)

Scotland

Dwellings

FLAT 1/2 , 38 NIDDRIE ROAD, GLASGOW, G42 8NR

Dwelling type: Mid-floor flat
Date of assessment: 14 September 2020
Date of certificate: 14 September 2020
Total floor area: 32 m²
Primary Energy Indicator: 385 kWh/m²/year

Reference number: 9741-1000-2201-1790-0204
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: No system present: electric heaters assumed

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,103	See your recommendations report for more information
Over 3 years you could save*	£1,191	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs



Not energy efficient - higher running costs

Current	Potential
62	83

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (62)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions



Not environmentally friendly - higher CO₂ emissions

Current	Potential
64	75

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (64)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£651.00
2 Low energy lighting	£20	£57.00
3 High heat retention storage heaters	£800 - £1,200	£480.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	(another dwelling above)	—	—
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★★★☆☆	★★★★☆☆
Main heating	No system present: electric heaters assumed	★☆☆☆☆	★★☆☆☆
Main heating controls	None	★☆☆☆☆	★☆☆☆☆
Secondary heating	None	—	—
Hot water	Electric immersion, off-peak	★★★★☆☆	★★☆☆☆
Lighting	No low energy lighting	★☆☆☆☆	★☆☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 65 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 2.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.


Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£1,449 over 3 years	£357 over 3 years	
Hot water	£456 over 3 years	£456 over 3 years	
Lighting	£198 over 3 years	£99 over 3 years	
Totals	£2,103	£912	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

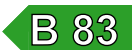Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£217		
2 Low energy lighting for all fixed outlets	£20	£19		
3 High heat retention storage heaters	£800 - £1,200	£160		

Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

2 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

3 High heat retention storage heaters

Modern storage heaters are less expensive to run than the direct acting, on-peak heating system in the property. A dual-rate electricity supply is required to provide the off-peak electricity that these heaters use; this is easily obtained by contacting the energy supplier. Ask for a quotation for high heat retention with automatic charge and output controls. Installations should be in accordance with the national wiring standards. Building regulations generally apply to this work and a building warrant may be required, so it is best to obtain advice from your local authority building standards department and from a qualified electrical heating engineer. Ask the heating engineer to explain the options, which might also include switching to other forms of electric heating.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	2,185	N/A	N/A	(983)
Water heating (kWh per year)	1,491			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Scott Baird
Assessor membership number:	EES/009369
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	45 Bank Street Irvine KA12 0LL
Phone number:	01294 311070
Email address:	enquiries@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property


There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](https://www.greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY

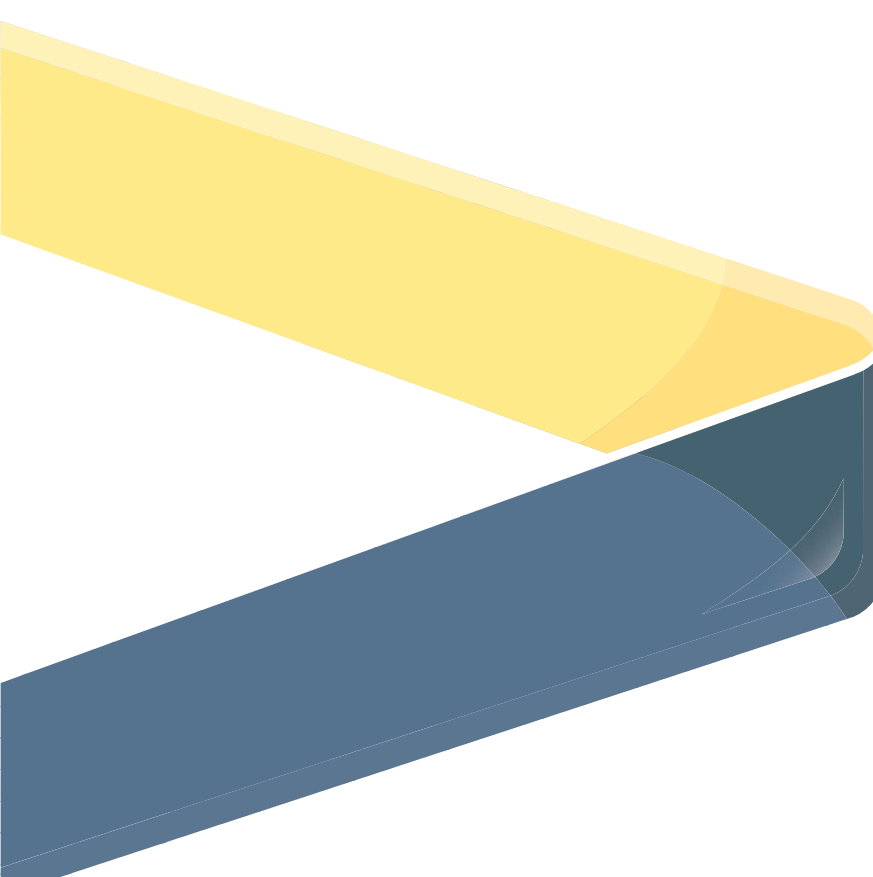

DM HALL
CHARTERED SURVEYORS

Schedule 1

Survey Report

1/2

38 Niddrie Road

Glasgow

Lanarkshire

G42 8NR

Customer

Moya Black

Date of Inspection

14/09/2020

Prepared by

Scott Baird, BSc MRICS

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a PURPOSE FIRST FLOOR FLAT contained within a four storey flatted block containing twelve flats in total.
Accommodation	ON ONE FLOOR : Entrance Hall, Lounge open plan to Kitchen, Bedroom, Bathroom.
Gross internal floor area (m^2)	35 sqm or thereby.
Neighbourhood and location	The property is situated within a mixed residential/commercial location where surrounding properties are of a similar age and character. Local amenities are available within reasonable distance.
Age	In excess of 100 years.
Weather	Dull and overcast. Weather conditions over recent weeks have been mixed.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. the chimney stacks of masonry construction and adjacent flashings are formed in lead.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. ROOF : The roof is pitched and covered with concrete tiles. There appears to be a section of flat roofing to the bay window projection ROOF SPACE : I was unable to inspect this area.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate.

	Rainwater units are a mixture of cast iron and PVC material.
Main walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The outer walls are of solid stone construction with a pointed finish.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of UPVC double glazed type. The entrance door is of a composite design.
External decorations	Visually inspected. Exterior finishes are painted where appropriate.
Conservatories/Porches	None.
Communal areas	Circulation areas visually inspected. There is a shared entrance and stairwell providing access to the various flats within the building.
Garages and permanent outbuildings	There is no garage or garage space.
Outside areas and boundaries	Visually inspected. There is an area of garden ground to the rear of the building which I have assumed to be communal. This area is generally paved.
Ceilings	Visually inspected from floor level. Ceilings appear a mixture of lath and plaster and plasterboard material with a decorated finish.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Internal walls are a mixture of masonry construction and timber and plaster construction with a decorated finish. Some walls are part timber lined, some are lined in

	decorative boarding and some are tiled.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Flooring is of suspended timber construction.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. There are timber skirtings and door facings. Internal doors are mostly of timber although some doors incorporate glazed panels. The kitchen contains a range of floor mounted storage units and worktops.
Chimney breasts and fireplaces	None.
Internal decorations	Visually inspected. Decorative finishes are generally papered or painted.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply. The electrical switch gear is located within the hallway. Visible cabling is of PVC material and power is supplied to 13amp sockets.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply.
Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

	No tests whatsoever were carried out to the system or appliances. Mains water supply. Visible pipework is of copper and PVC materials. Sanitary fittings comprise white suite of wc, wash hand basin and shower cubicle. There is a sink unit in the kitchen.
Heating and hot water	There is no central heating system presently installed. Hot water appears to be from an electric immersion heater. No tests whatsoever were carried out to the system or appliances.
Drainage	Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested. Drainage is to the main sewerage system.
Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. There are smoke alarms fitted within the property.
Any additional limits to inspection	Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect. I have not carried out an inspection for Japanese Knotweed

and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was occupied, fully furnished and all floors were covered. Floor coverings restricted my inspection of flooring.

In accordance with Health and Safety guidelines I have not disturbed insulation, furniture or personal effects (particularly in cupboards). Floor coverings have not been moved.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.

As previously indicated I was unable to inspect the common roof space as the access hatch was padlocked.

My inspection of the roof covering was restricted from ground level and some parts were not visible. Site topography partially blocked sight lines. The flat roof coverings were not visible from ground level.

I was unable to see below the shower tray.

▷ Sectional diagram showing elements of a typical house:



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these terms.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories.

Category 3	Category 2	Category 1
Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement



Repair category:	1
Notes	The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing

Dampness, rot and infestation



Repair category:	1
Notes	No obvious evidence of significant dampness, rot or wood boring insect infestation.

Chimney stacks



Repair category:	2
Notes	The masonry finish of the various stacks is weathered/eroded and pointing is loose in places. Staining is evident which may be indicative of concealed defects. An appropriate contractor can advise on any necessary repairs.

Roofing including roof space



Repair category:	2
Notes	The roof covering is of older origin and there is evidence of weathering to the roof tiling. Concrete tiles are typically guaranteed for 30 years but have a reasonable life expectation around 50/60 years according to the BRE. Life expectancy will often depend on weathering and damage from the prevailing weather. A reputable roofing contractor can advise on life expectancy and repair/replacement costs. The flat roof of the bay window projection has a limited life expectancy and can fail without warning. A reputable roofing contractor will be able to provide further advice.

Rainwater fittings



Repair category:	2
Notes	Metal rainwater fittings are corroded in places. These should be treated and redecorated. Metal rainwater fittings require regular maintenance. There are wall head gutters. These can be problematic, especially within older buildings, and maintenance should be undertaken regularly.

Main walls



Repair category:	2
Notes	The pointing to outer walls is loose/eroded in places and should be repaired or replaced by a contractor. The stonework is eroded and a competent local builder can investigate and repair/replace as required. Staining and vegetation growth were noted which may be indicative of concealed defects.

Windows, external doors and joinery



Repair category:	2
Notes	The window units are of an older type. The seals to older double glazed units often fail resulting in condensation between the panes of glass. This can occur without warning and may only be seen in certain weather conditions.

External decorations



Repair category:	2
Notes	Outside paintwork has deteriorated and redecoration is now required. Regular re-painting of external joinery will prolong its life span.

Conservatories/porches



Repair category:	-
Notes	None.

Communal areas



Repair category:	2
Notes	Decorative finishes are marked and damaged. Some plaster finishes are damaged or cracked. Common stair windows are in need of general repair/replacement.

Garages and permanent outbuildings



Repair category:	-
Notes	None.

Outside areas and boundaries



Repair category:	2
Notes	Garden walls have deteriorated and require general repair.

Ceilings



Repair category:	2
Notes	There is plaster cracking and damage to some ceiling surfaces. When plaster starts to pull loose from the laths the cracking often becomes widespread. Small cracks in this type of ceiling can develop into a larger repair. Vibration and noise can often cause lath and plaster ceiling failure as can the installation of central heating.

	The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above. There is timber cladding to some ceiling surfaces. This may represent a fire hazard.
--	---

Internal walls



Repair category:	2
Notes	There is timber cladding to some wall surfaces. This may represent a fire hazard.

Floors including sub-floors



Repair category:	2
Notes	Floorboards are loose/uneven in places and slop off level in places which may be indicative of past settlement. It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings



Repair category:	2
Notes	Kitchen base and wall units are dated and reaching the end of their useful life. Glazed inserts to interior doors may not be of appropriate toughened glass or meet the recognised Building Standards.

Chimney breasts and fireplaces



Repair category:	-
Notes	None,

Internal decorations



Repair category:	1
Notes	No significant defects evident although decisions on redecoration will be a matter of personal taste.

Cellars



Repair category:	-
Notes	None.

Electricity



Repair category:	2
Notes	The electrical installation is dated with the fuse box being of older origin. Further advice will be available from a NICEIC/SELECT registered electrician.

Gas



Repair category:	1
Notes	Trade bodies governing gas installations currently advise that gas

	appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.
--	---

Water, plumbing and bathroom fittings



Repair category:	1
Notes	No significant defects evident.

Heating and hot water



Repair category:	-
Notes	None.

Drainage



Repair category:	1
Notes	No significant defects evident.

Summary:

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Category 3	Structural Movement	1
Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Dampness, rot and infestation	1
	Chimney stacks	2
	Roofing including roof space	2
	Rainwater fittings	2
	Main walls	2
Category 2	Windows, external doors and joinery	2
Repairs or replacement requiring future attention, but estimates are still advised.	External decorations	2
	Conservatories/porches	-
Category 1	Communal areas	2
No immediate action or repair is needed.	Garages and permanent outbuildings	-
	Outside areas and boundaries	2
	Ceilings	2
	Internal walls	2
	Floors including sub floors	2
	Internal joinery and kitchen fittings	2
	Chimney breasts and fireplaces	-
	Internal decorations	1
	Cellars	-
	Electricity	2
	Gas	1
	Water, plumbing and bathroom fittings	1
	Heating and hot water	-
	Drainage	1

Remember:

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance notes on Accessibility Information:

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes; parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1	Which floor(s) is the living accommodation on?	FIRST
2	Are there three steps or fewer to a main entrance door of the property?	No
3	Is there a lift to the main entrance door of the property?	No
4	Are all door openings greater than 750mm?	No
5	Is there a toilet on the same level as the living room and kitchen?	Yes
6	Is there a toilet on the same level as a bedroom?	Yes
7	Are all rooms on the same level with no-internal steps or stairs?	Yes
8	Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes

Matters for a solicitor or licensed conveyancer:

I am unaware of any recent extensions or alterations which may have taken place.

The Building factor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

The subjects form part of a tenement block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

It is understood there are factoring arrangements in place in respect of the maintenance and upkeep of communal areas. This should be verified by the completing conveyancer.

Estimated re-instatement cost for insurance purposes:

£110,000 (ONE HUNDRED AND TEN THOUSAND POUNDS).

Valuation and market comments:

£55,000 (FIFTY FIVE THOUSAND POUNDS).

Property market activity has been impacted due to the current response to Covid-19. This has resulted in an unprecedented setoff circumstances on which to make a valuation judgment. The advise is therefore reported on the basis of material valuation uncertainty as per the RICS Red Book Global definition. Consequently, less certainty can be attached to the valuation than would otherwise be the case. It is recommended that the valuation of this property is kept under frequent review as more market evidence becomes available.

Signed: Electronically by Scott Baird, BSc MRICS

Report author: Scott Baird, BSc MRICS

Company name: DM Hall - Glasgow

Address: 151 Kilmarnock Road, Glasgow, G41 3JF

Date of report: 15/09/2020

Mortgage Valuation Report

1/2

38 Niddrie Road

Glasgow

Lanarkshire

G42 8NR

Seller's Name:

Moya Black

Date of Inspection:

14/09/2020

Prepared by:

Scott Baird, BSc MRICS

1. Property Details

Property type:	Purpose built flat
Floor(s) on which located (<i>Flat or maisonettes only</i>):	FIRST
Number of floors in block (<i>Flat or maisonettes only</i>):	4
Number of units in block (<i>Flat or maisonettes only</i>):	12
Is there a lift provided? (<i>Flat or maisonettes only</i>):	No
Property style:	Low rise block
Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?	No
Approximate year of construction:	1900

2. Tenure

Tenure:	Absolute Ownership
Ground rent:	
Unexpired years:	

3. Accommodation

Number of living rooms:	1
Number of bedrooms:	1
Number of kitchens:	1
Number of Bathrooms	1
Number of water closets:	0
Other Rooms:	0
Internal gross floor area (excluding garages and outbuildings):	35m ²
External gross floor area (excluding garages and outbuildings):	44m ²
Does the property have a residential element greater than 40%?	Yes

4. Garage / Parking / Outbuildings

Parking type:	No garage / garage space / parking space
Available on site?	
Permanent Outbuildings:	None noted.

5. Construction

Main wall type:	Stone
Other (please specify):	
Roof type:	Tile
Other (please specify):	

6. Special Risks

Has the property suffered structural movement?	Yes
Is this recent or progressive?	No
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the	No

immediate vicinity?

If yes, please specify any of the above:

7. Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in the 'brief description of central heating' section below

Drainage:	Mains
Electricity:	Mains
Central Heating:	No
Water:	Mains
Gas:	Mains
Brief description of central heating:	No central heating system present.

8. Site

Apparent legal issues to be verified by the conveyancer

Legal Issue	Verification	Description
Rights of way:		
Shared drives / access:	Yes	
Garage or other amenities on separate site:		
Shared service connections:		
Ill-defined boundaries:		
Agricultural land included with property:		
Other:		

9. Location

Location type:	Mixed residential/commercial
Other (if not specified):	

10. Planning Issues

Has the property been extended / converted / altered?	No
Details (if extended, converted, or altered):	

11. Roads

Roads that relate to the property:	Made up road
---	--------------

12. General Remarks

General remarks on the property:	Generally the subjects were found to be in a condition commensurate with age and style of construction. There is wear and tear to some items requiring routine maintenance repair or upgrading. No obvious serious defects which would have an adverse impact upon value were identified.
---	---

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

I am unaware of any recent extensions or alterations which may have taken place.

The Building factor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

The subjects form part of a tenement block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

It is understood there are factoring arrangements in place in respect of the maintenance and upkeep of communal areas. This should be verified by the completing conveyancer.

13. Essential Repairs

Information relating to essential repairs for the property:

Estimated cost of essential repairs:

Retention recommendation?

Amount:

14. Comment on Mortgageability

Information relating to mortgageability of the property:

The subjects form suitable mortgage security at the valuation figure stated in this report subject to individual lenders criteria.

Property market activity has been impacted due to the current response to Covid-19. This has resulted in an unprecedented set of circumstances on which to make a valuation judgement. The advice is therefore reported on the basis of "material valuation uncertainty" as per the RICS Red Book Global definition. Consequently, less certainty can be attached to the valuation than would otherwise be the case. It is recommended that the valuation of this property is kept under frequent review as more market evidence becomes available.

15. Valuations

Market value in present condition:

£55,000.00

Market value on completion of essential repairs:

Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)


£110,000.00

Is re-inspection necessary?

No

Signed:	Electronically by Scott Baird, BSc MRICS
Report author:	Scott Baird, BSc MRICS
Company name:	DM Hall - Glasgow
Address:	151 Kilmarnock Road, Glasgow, G41 3JF
Date of report:	15/09/2020

PROPERTY QUESTIONNAIRE

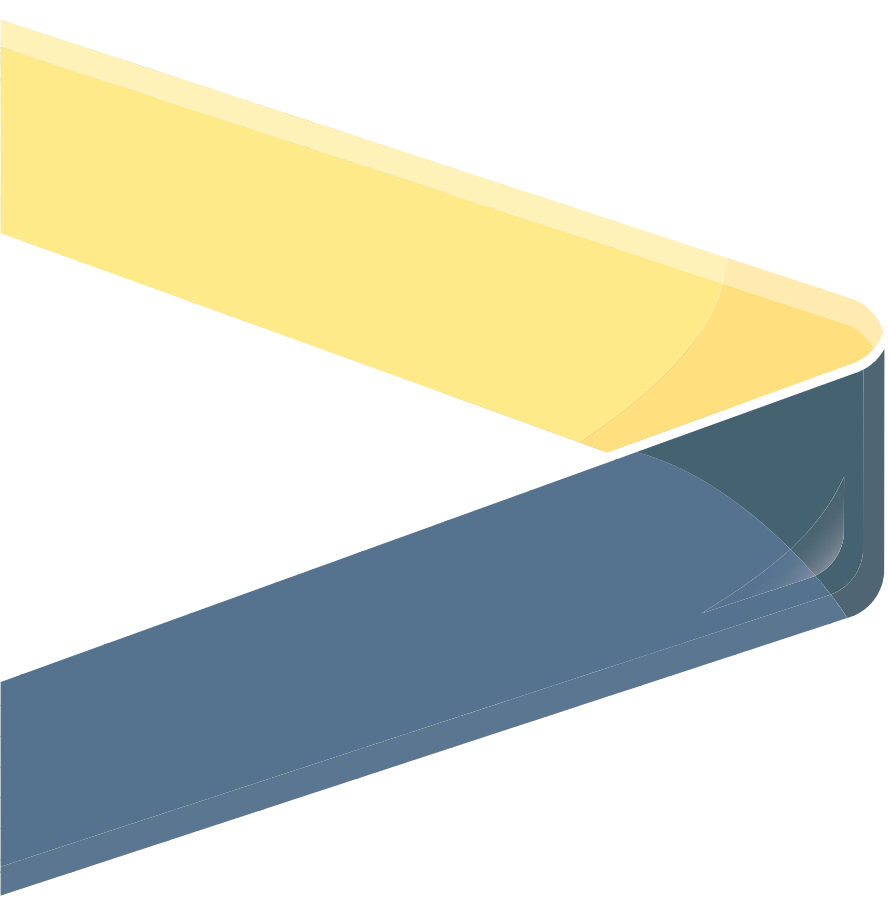

DM HALL
CHARTERED SURVEYORS

Property Questionnaire

1/2

38 Niddrie Road

Glasgow

Lanarkshire

G42 8NR

Property Address:

1/2
38 Niddrie Road
Glasgow
Lanarkshire
G42 8NR

Seller(s):

Moya Black

Completion date of Property Questionnaire:

12/09/2020

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1. Length of ownership

How long have you owned the property?	30 years
---------------------------------------	----------

2. Council Tax

Which Council Tax band is your property in?	B
---	---

3. Parking

What are the arrangements for parking at your property?	On street
---	-----------

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	No
---	----

5. Listed Buildings

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	No
---	----

6. Alterations/additions/extensions

a. (i). During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	No
---	----

<i>If you have answered yes, please describe the changes which you have made:</i>	
---	--

(ii). Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	
--	--

<i>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</i> <i>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.</i>	
b. Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	Yes
(i). Were the replacements the same shape and type as the ones you replaced?	Yes
(ii). Did this work involve any changes to the window or door openings?	No
(iii). Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed?) Please give any guarantees which you received for this work to your solicitor or estate agent.	New pvc door
7. Central Heating	
a. Is there a central heating system in your property? Note: A partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom). <i>If you answered yes/partial:</i> What kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas, warm air). <i>If you answered yes, please answer the following three questions:</i>	No
(i). When was your central heating system or partial central heating system installed?	
(ii). Do you have a maintenance contract for the central heating system? <i>If you have answered yes, please give details of the company with which you have a maintenance agreement:</i>	
(iii). When was your maintenance agreement last renewed? (Please provide the month and year).	

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

No

Note: The surveyor will provide this within their inspection.

9. Issues that may have affected your property

a.

Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b.

Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10. Services

a.

Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	Yes	
Water mains/private water supply	Yes	
Electricity	Yes	
Mains drainage		
Telephone	Yes	
Cable TV/Satellite		
Broadband		

b.

Is there a septic tank system in the property?

No

If you have answered yes, please answer the two questions below:

(i). Do you have appropriate consents for the discharge from your septic tank?

(ii). Do you have maintenance contract for your septic tank?

If you have answered yes, please give details of the company with which you have a maintenance contract:

11. Responsibilities for Shared or Common Areas

a.

Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

No

If you have answered yes, please give details:

b.

Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

Yes

If you have answered yes, please give details:

It's a flat so if repairs need done in the close or roof then all in the close have to share the cost

c.

Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

No

d.

Do you have the right to walk over any of your neighbours' property - for example, to put out your rubbish bin or to maintain your boundaries?

No

If you have answered yes, please give details:

e.

As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

No

If you have answered yes, please give details:

f.

As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned).

No

If you have answered yes, please give details:

12. Charges associated with your property

a.

Is there a factor or property manager for your property?

Yes

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

McPhee & co 5 Cathrinview road
G42, 9ea £100 deposit held and
roughly every quarter the amount
varies for the maintenance of the
building with the factor / twice per
year my building insurance is
£133.75 with the factor

b.

Is there a common buildings insurance policy?

Yes

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

Yes

c.

Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Resident's Association, or maintenance or stair fund.

13. Specialist Works

a.

As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

No

If you have answered yes, please say what the repairs were for, whether they carried out the repairs (and when), or if they were done before you bought the property:

b.

As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

c.

If you have answered yes to 13 (a) or (b), do you have any guarantees relating to this work?

*If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, **please write below who has these documents** and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.*

Guarantees are held by:

14. Guarantees

a.

Are there any guarantees or warranties for any of the following?

(i). Electrical work

No

(ii). Roofing

No

(iii). Central Heating

No

(iv). NHBC

No

(v). Damp course

No

(vi). Any other work or installations? (For example, cavity wall insulation, underpinning, indemnity policy)

No

b.

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

c.

Are there any outstanding claims under any of the guarantees listed above?

If you have answered yes, please give details

No

15. Boundaries

a.

So far as you are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years, have you ever received a notice;

a.

advising that the owner of a neighbouring property has made a planning application?

No

b.

that affects your property in some other way?

No

c.

that requires you to do any maintenance, repairs or improvements to your property?

No

Notice:

If you have answered yes to any of **a.-c.** above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid.

Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

DM Hall Offices

Aberdeen

01224 594172

Galashiels

01896 752009

Livingston

01506 490404

Ayr

01292 286974

Glasgow (North)

0141 332 8615

Musselburgh

0131 665 6782

Cumbernauld

01236 618900

Glasgow (South)

0141 636 4141

Oban

01631 564225

Cupar

01334 844826

Hamilton

01698 284939

Paisley

0141 887 7700

Dumfries

01387 254318

Inverness

01463 241077

Perth

01738 562100

Dundee

01382 873100

Inverurie

01467 624393

Peterhead

01779 470220

Dunfermline

01383 621262

Irvine

01294 311070

Stirling

01786 475785

Edinburgh

0131 477 6000

Kirkcaldy

01592 598200

Elgin

01343 548501

Falkirk

01324 628321

DMHALL.CO.UK

