


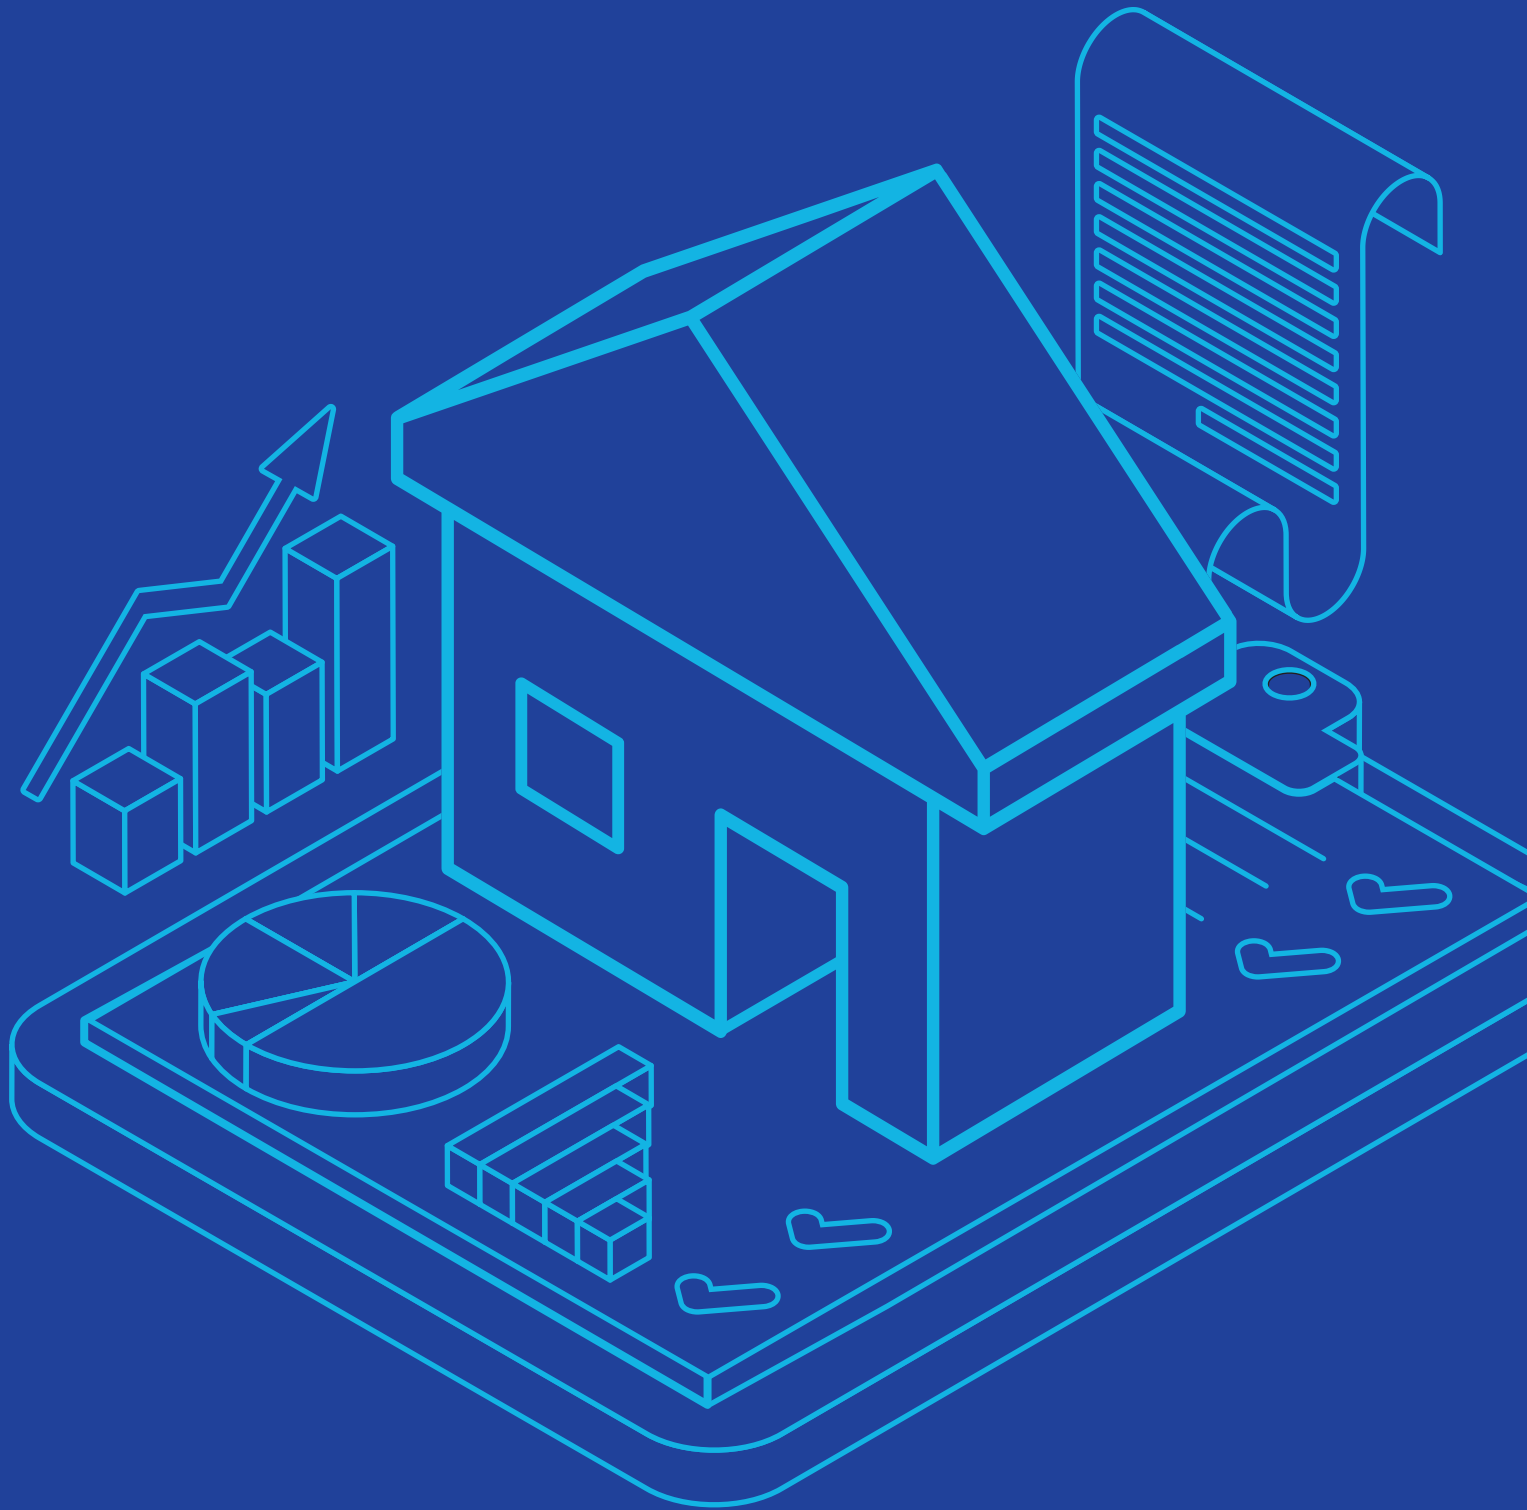

Home Report

One triangle, all angles covered

RESIDENTIAL / COMMERCIAL / PROPERTY & CONSTRUCTION

www.shepherd.co.uk



Home Report


Property: **128
Shawmoss Road
Glasgow
Lanarkshire
G41 4AJ**

Prepared for: **Gurdave singh**

Prepared by: **Kristofor Hall**

Report reference: **1488236-1-2**

Date of Report: **30/01/2023**

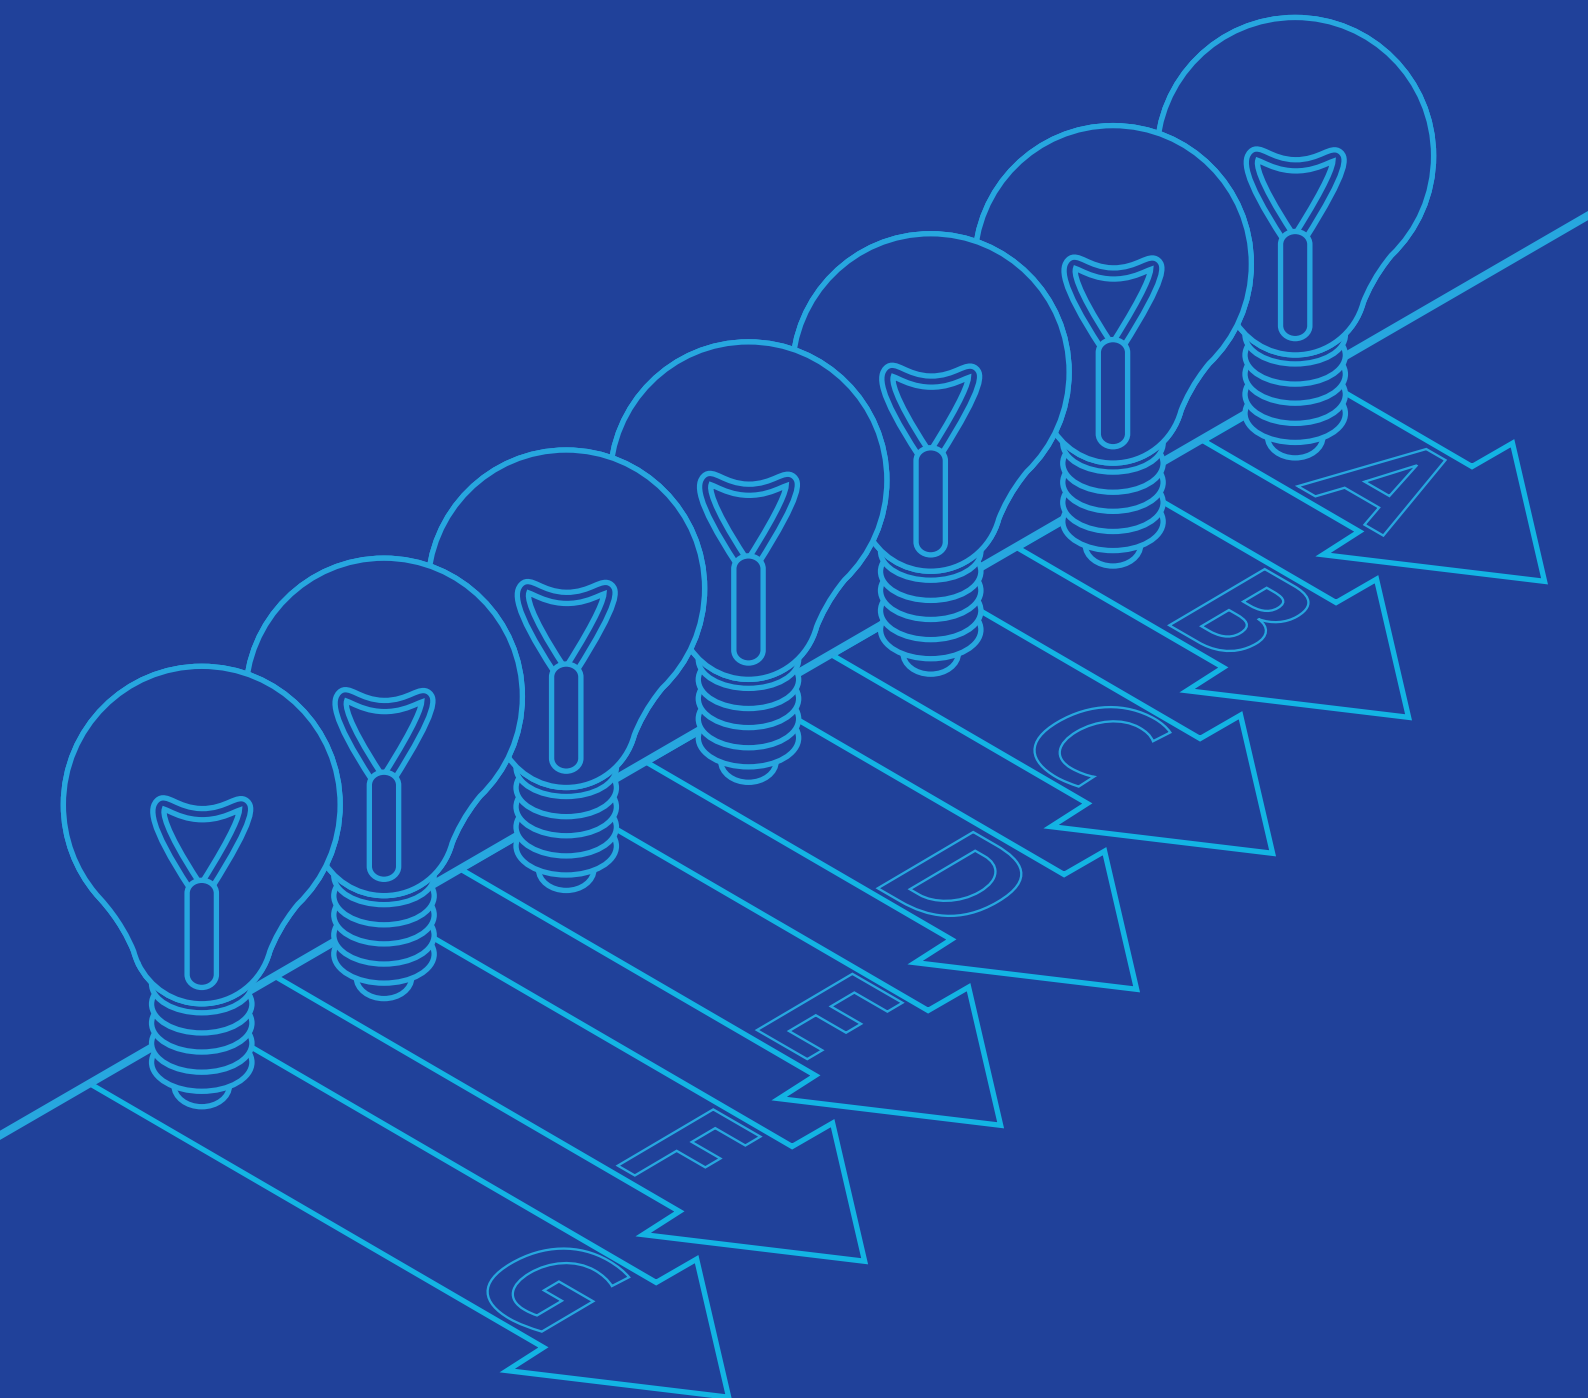

Energy Performance Certificate

Energy Performance Certificate (EPC)

Scotland

Dwellings

128 SHAWMOSS ROAD, GLASGOW, G41 4AJ

Dwelling type: Detached bungalow
Date of assessment: 30 January 2023
Date of certificate: 30 January 2023
Total floor area: 157 m²
Primary Energy Indicator: 197 kWh/m²/year

Reference number: 7307-1047-6239-6667-3224
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*

£3,774


See your recommendations report for more information

Over 3 years you could save*

£393

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

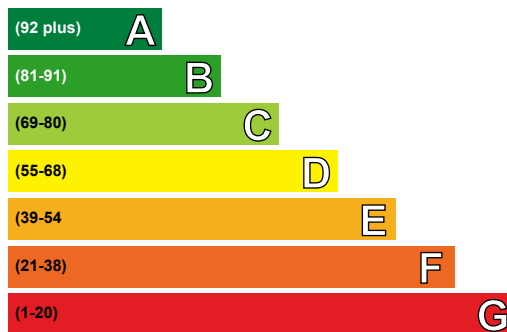

Current	Potential
70	80


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (70)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

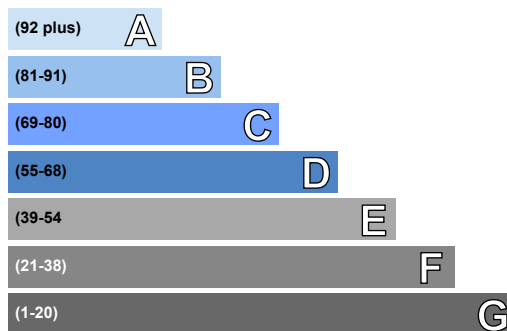

Current	Potential
64	74

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (64)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (suspended floor)	£800 - £1,200	£390.00
2 Solar photovoltaic (PV) panels	£3,500 - £5,500	£1104.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Cavity wall, filled cavity	★★★★☆☆	★★★★☆☆
Roof	Pitched, 200 mm loft insulation Roof room(s), insulated (assumed)	★★★★★☆☆ ★★★★★☆☆	★★★★★☆☆ ★★★★★☆☆
Floor	Suspended, no insulation (assumed) Suspended, insulated (assumed)	— —	— —
Windows	Fully double glazed	★★★★☆☆	★★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★★☆☆	★★★★★☆☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★★☆☆	★★★★★☆☆
Secondary heating	None	—	—
Hot water	From main system	★★★★★☆☆	★★★★★☆☆
Lighting	Low energy lighting in all fixed outlets	★★★★★★	★★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 35 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 5.5 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.6 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£3,069 over 3 years	£2,676 over 3 years	
Hot water	£345 over 3 years	£345 over 3 years	
Lighting	£360 over 3 years	£360 over 3 years	
Totals	£3,774	£3,381	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Floor insulation (suspended floor)	£800 - £1,200	£130		
2 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£368		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Floor insulation (suspended floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Suspended floors can often be insulated from below but must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work so it is best to check with your local authority building standards department.

2 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	18,774	N/A	N/A	N/A
Water heating (kWh per year)	2,323			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Kristofor Hall
Assessor membership number:	EES/012601
Company name/trading name:	J & E Shepherd
Address:	13 Albert Square Dundee DD1 1XA
Phone number:	01382 200454
Email address:	dundee@shepherd.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





Scottish Single Survey

Schedule 1

Survey Report

128

Shawmoss Road

Glasgow

Lanarkshire

G41 4AJ

Customer

Gurdave singh

Date of Inspection

30/01/2023

Prepared by

Kristofor Hall

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subject property comprises an extended detached bungalow with attic conversion.
Accommodation	Ground Floor: Entrance Porch leading to Entrance Hallway, Large Living Room, Kitchen with Dining Area with Sitting Room, Bedroom and Shower with WC. Attic Level: Landing, Two further Bedrooms and Bathroom with WC.
Gross internal floor area (m^2)	The gross internal floor area is 157 sq m or thereby.
Neighbourhood and location	The subjects are located within the Crossmyloof district of Glasgow where surrounding properties are of similar age and character. Adequate local shopping, educational and public transport facilities are available close by.
Age	Believed to be constructed circa 1935.
Weather	Dry.
Chimney stacks	All the chimney stacks have been removed in the past and we assume the correct strengthening works have been carried out at this time. A suitably qualified roofing contractor can provide further advice in this regard. Visually inspected with the aid of binoculars.
Roofing including roof space	The roof was seen to be of multi pitched design and overlaid with tile finish. The roof covering appeared to be of a flat section overlaid with felt material or similar. Due the attic accommodation we could not fully inspect the roof timbers and cannot fully comment upon their condition. A very limited access to the eaves was possible which

	revealed a traditional timber framed construction that has been insulated. Sloping roofs were visually inspected with the aid of binoculars. Flat roofs were visually inspected from vantage points within the property. Roof spaces were visually inspected and were entered where there was safe and reasonable access from a 3 metre ladder within the property.
Rainwater fittings	Rainwater goods serving the subjects were seen to be formed in combination of PVC and cast iron materials. Visually inspected with the aid of binoculars.
Main walls	The main walls appear to be cavity brick/block construction overlaid with a render finish. It would appear that cavity wall insulation has been added to the property in the past. Any documentation for this where available should be obtained. Visually inspected with the aid of binoculars. Foundations and concealed parts were not exposed or inspected.
Windows, external doors and joinery	Windows within the property were seen to be predominantly of a replacement UPVC construction containing double glazing. There is a single glazed stained glass window within the living room. There are velux windows within the roof structure. It is assumed that replacement windows and doors comply with relevant building and fire regulations. The subjects are accessed by UPVC doors to the front, side and rear. Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.
External decorations	External decorations are of paint finishes. Visually inspected.
Conservatories/Porches	There is a porch addition located to front of the property which incorporates UPVC double glazed doors and

	windows under a mono pitched and perspex roof covering. Visually inspected.
Communal areas	None.
Garages and permanent outbuildings	There is a permanent outbuilding located within the rear garden ground which was seen to be of concrete block construction under a flat felt roof covering. The building has solid concrete floor with an electricity supply and a water supply. The outbuilding is accessed by way of timber doors. Visually inspected.
Outside areas and boundaries	There are private garden grounds to front, side and rear of the property. Off street parking is provided from the garden grounds. Visually inspected.
Ceilings	The ceilings within the property were seen to be formed in a combination of timber lath and plasterboard materials. Visually inspected from floor level.
Internal walls	Internal walls within the property and overlaid in combination plaster and plasterboard finishes. Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
Floors including sub floors	Flooring within the property appeared to be timber construction. Fitted floor coverings were noted throughout which restricted the scope of our inspection. Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Whenever possible, access is taken to sub-floor areas having a minimum clearance of 1 metre between underside of floor joists and solum as determined from the access hatch. Otherwise, sub-floor areas were inspected only to the extent visible from a readily accessible hatch by way of an inverted head and shoulders inspection at the access point.
Internal joinery and kitchen fittings	Internal joinery incorporates timber skirtings and doorways. The kitchen facility incorporates fitted units.

	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances.
Chimney breasts and fireplaces	There is a fireplace within the large living room. All the original fireplaces within the property have been blocked over and are no longer in use. It is assumed that the chimneys are adequately vented with the chimneys capped. Ventilators should be fitted to prevent the build-up of dampness within the chimney flue. Visually inspected. No testing of the flues or fittings was carried out.
Internal decorations	Internal decorations incorporate paint, paper, tile and panel finishes. Visually inspected.
Cellars	None.
Electricity	The electrical switchgear is located in the entrance vestibule. Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
Gas	The gas is connected to the mains. Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.
Water, plumbing and bathroom fittings	Water is assumed to be connected to the mains. Water piping where visible was run in copper and PVC. We would highlight that it is possible in a property of this age to have lead pipework still in use but hidden from view. A suitably qualified contractor can give further advice in this regard. The shower room fittings at ground floor level incorporate a

	shower cubicle, WC and wash hand basin. The bathroom fittings at the attic level incorporate a bath, WC and wash hand basin. Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.
Heating and hot water	Domestic heating is provided by way of a gas fired boiler wall mounted within the kitchen which vents by way of a flue to the side wall of the property. Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.
Drainage	Drainage is assumed to be connected to main public sewer. Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.
Fire, smoke and burglar alarms	All Scottish homes require a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner, a carbon monoxide detector is also required. We have not assessed or tested any existing equipment and it is the purchasers responsibility to confirm that the property will comply with these standards following a change of ownership. No tests whatsoever were carried out to the system or appliances.
Any additional limits to inspection	Not all aspects of the roof covering can be seen from ground floor level and such we cannot fully comment upon their condition. Due to the attic accommodation we could not comment upon the condition. Due to the attic accommodation we could not fully inspect the roof timbers and cannot fully comment upon the condition.

Only access to the eaves from the bathroom at the attic level was possible and as such we cannot fully comment upon the condition of any other area. Aspects of this area was severely restricted due to contents and insulation found within.

Due to contents found within the outbuilding we could not fully inspect the surrounding areas and could not fully comment upon their condition.

Due to external finishes found over the surfaces of the property we cannot inspect the areas below and cannot fully comment upon their condition.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor.

The property was fully furnished and had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. Internal cupboards were generally filled with storage items. No access was available beneath sanitary or kitchen fittings.


Windows and external doors were not all fully opened or tested.

No access was available to any sub-floor areas.

No inspection of areas below sanitary ware was possible.

The cold water rising main was not fully inspectable.

▷ Sectional diagram showing elements of a typical house:

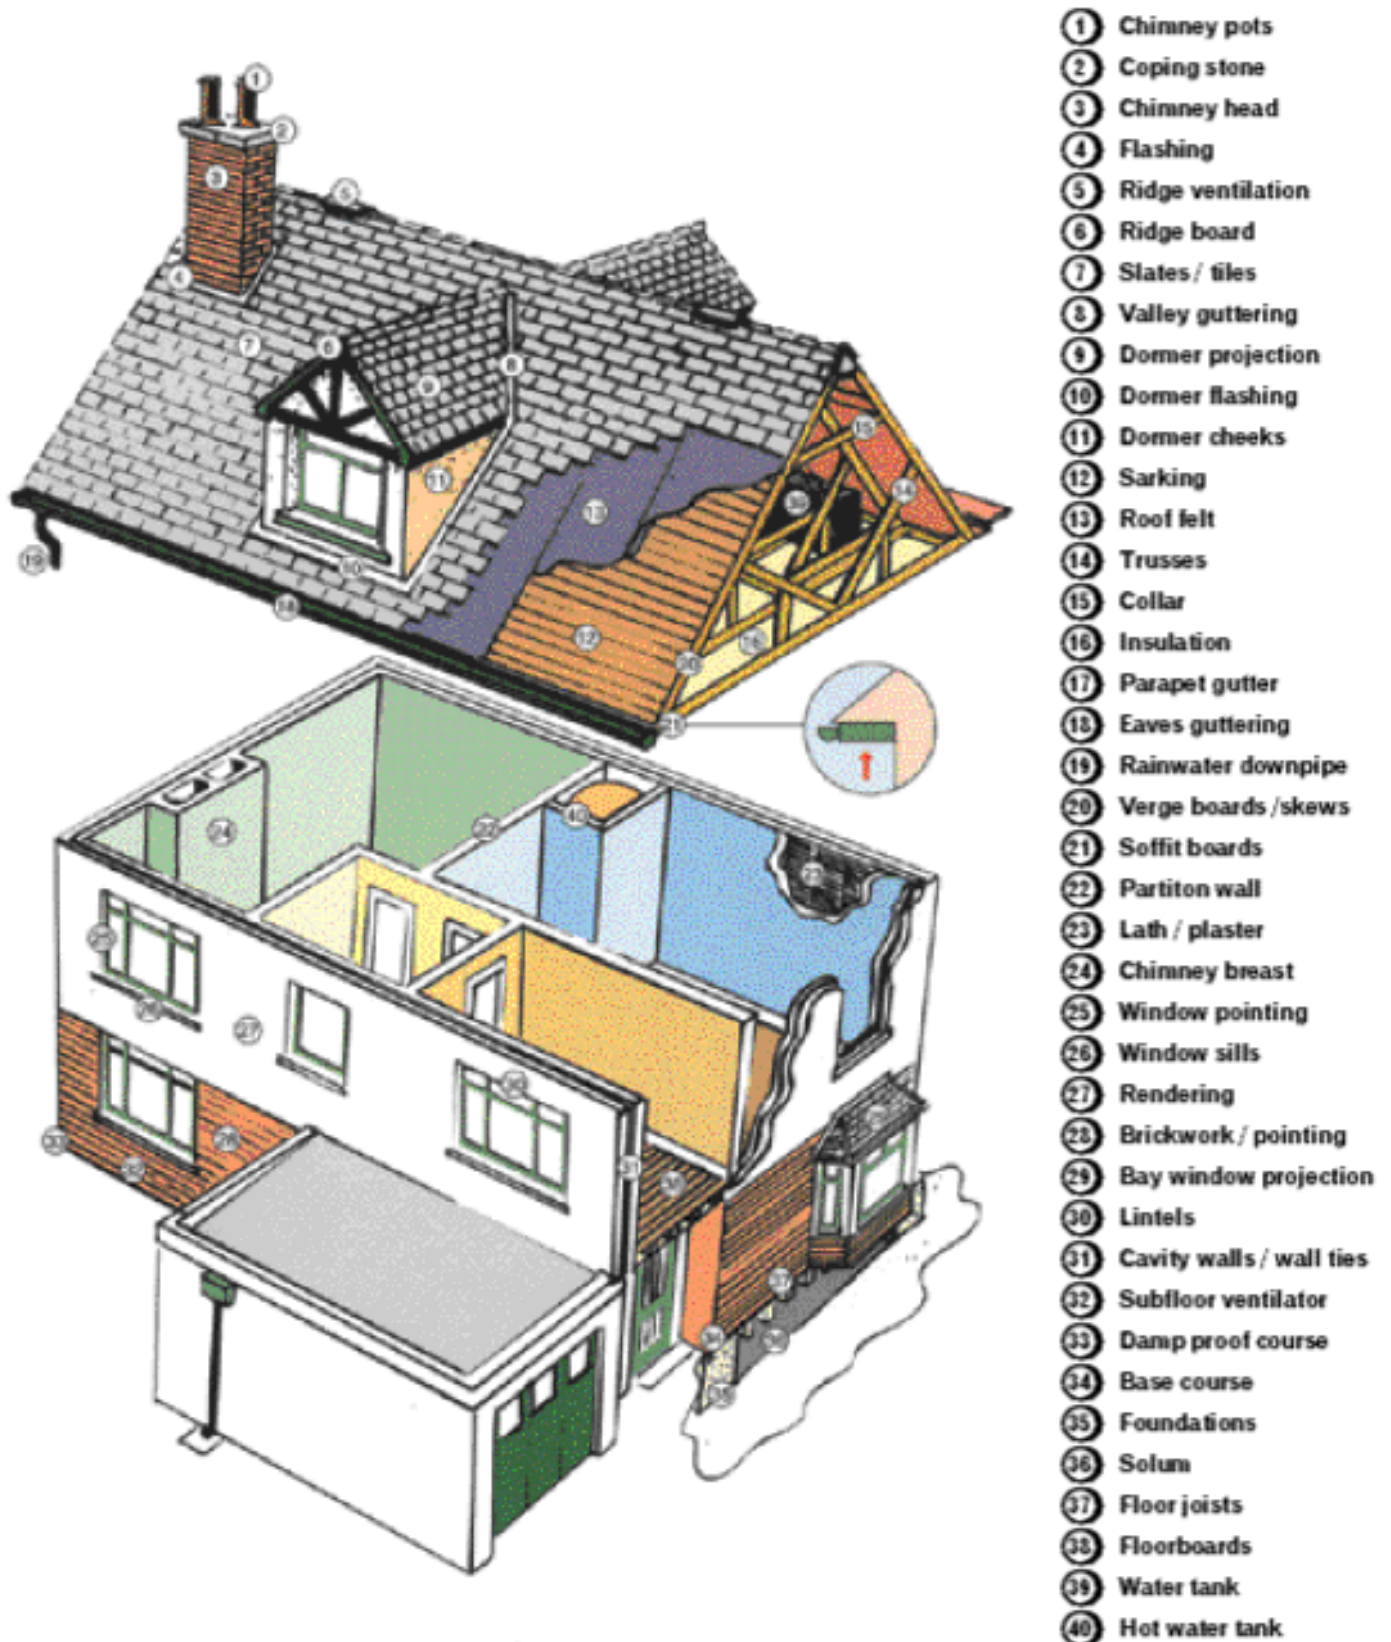

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these terms.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories.

Category 3	Category 2	Category 1
Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement

Repair category:	1
Notes	There was no evidence of significant structural movement within the limitations of our inspection.

Dampness, rot and infestation

Repair category:	2
Notes	Some mould and condensation staining was noted around the window of the front upper bedroom. Staining was noted to the ceiling within the bathroom at the attic level. These areas were dry when tested. The situation should be monitored to ensure no repairs are required.

Chimney stacks

Repair category:	-
Notes	Not applicable.

Roofing including roof space

Repair category:	2
Notes	Moss growth was noted to roof covering requiring removal. There is a flat roof at the top of the roof structure. It should be appreciated that this type of covering can have a limited life span and will require a higher than normal degree of ongoing maintenance and eventual replacement. It may be prudent to confirm the service history of the roof covering.

Rainwater fittings

Repair category:	2
Notes	An element of repair/maintenance was required to the gutter to the side of the extension. Rainwater goods are of an older style and have suffered corrosion. Maintenance is required and gutters/downpipes checked during heavy rainfall. We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.

Main walls



Repair category:	2
Notes	Worn and weathered render was noted requiring an element of repair/maintenance.

Windows, external doors and joinery



Repair category:	2
Notes	Some double glazed units are misted and failed at the rear attic bedroom and the front door to the property. Repairs, including the replacement of defective units, will be required. Windows are of an age and style where a degree of ongoing maintenance should be anticipated to sealed units and opening mechanisms.

External decorations



Repair category:	1
Notes	Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories/porches



Repair category:	1
Notes	Ongoing maintenance is required.

Communal areas



Repair category:	-
Notes	Not applicable.

Garages and permanent outbuildings



Repair category:	1
Notes	Some worn masonry was noted consistent with the age of the outbuilding requiring repair/maintenance. Staining was noted to the ceiling within the outbuilding. The situation should be monitored and general repairs are required.

Outside areas and boundaries



Repair category:	1
Notes	The subjects have an area of timber decking. Timber decked structures will have a limited lifespan and require regular maintenance and this liability should be considered. It should be appreciated that the concealed structural components have not been inspected nor have we moved items on the deck surface (patio furniture, potted plants etc) and we would highlight that defects may only become evident once such items are removed or the decking boards lifted.

Ceilings



Repair category:	1
Notes	Within the limitations of our inspection no significant defects were noted. Some blemishes were noted consistent with the property requiring an

	element of repair/maintenance prior to redecoration taking place.
--	---

Internal walls



Repair category:	1
Notes	Within the limitations of our inspection no significant defects were noted.

Floors including sub-floors



Repair category:	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition. Some uneven flooring was noted underfoot consistent with the age of the property.

Internal joinery and kitchen fittings



Repair category:	1
Notes	Within the limitations of our inspection no significant defects were noted.

Chimney breasts and fireplaces



Repair category:	1
Notes	All flue linings should be checked, repaired if necessary and swept prior to fires/appliances being reused.

Internal decorations



Repair category:	1
Notes	No immediate action or repair needed.

Cellars



Repair category:	-
Notes	Not applicable.

Electricity



Repair category:	2
Notes	The Institution of Engineering Technology recommends that inspections and testings are undertaken at least every five years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with IET regulations.

Gas



Repair category:	1
Notes	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.

Water, plumbing and bathroom fittings



Repair category:	1
Notes	No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted. No inspection has been possible to enclosed timbers beneath wet appliances and no comment has

	been made on the condition of unseen areas. Watertight seals will require to be regularly checked and replaced, to prevent water damage to adjoining areas.
--	---

Heating and hot water



Repair category:	1
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements. Service records should be obtained and checked. In the absence of service documentation further advice should be obtained from a qualified heating engineer to ascertain the condition, efficiency, and life expectancy of the system. We were informed that the heating system is under a service contract and any documentation for this where available should be obtained.

Drainage



Repair category:	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Summary:

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Category 3	Structural Movement	1
Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Dampness, rot and infestation	2
	Chimney stacks	-
	Roofing including roof space	2
	Rainwater fittings	2
	Main walls	2
Category 2	Windows, external doors and joinery	2
Repairs or replacement requiring future attention, but estimates are still advised.	External decorations	1
	Conservatories/porches	1
Category 1	Communal areas	-
No immediate action or repair is needed.	Garages and permanent outbuildings	1
	Outside areas and boundaries	1
	Ceilings	1
	Internal walls	1
	Floors including sub floors	1
	Internal joinery and kitchen fittings	1
	Chimney breasts and fireplaces	1
	Internal decorations	1
	Cellars	-
	Electricity	2
	Gas	1
	Water, plumbing and bathroom fittings	1
	Heating and hot water	1
	Drainage	1

Remember:

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance notes on Accessibility Information:

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes; parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1	Which floor(s) is the living accommodation on?	Ground and Attic
2	Are there three steps or fewer to a main entrance door of the property?	Yes
3	Is there a lift to the main entrance door of the property?	No
4	Are all door openings greater than 750mm?	No
5	Is there a toilet on the same level as the living room and kitchen?	Yes
6	Is there a toilet on the same level as a bedroom?	Yes
7	Are all rooms on the same level with no-internal steps or stairs?	No
8	Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes

Matters for a solicitor or licensed conveyancer:

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.

It is assumed that all alterations, additions and/or extensions to the property have received all necessary Town Planning (Planning Permission) and Building Authority (Building Warrants and Completion Certificate) approvals and that documentation for such is available. Paying particular attention to the extension to the property, the attic level and the internal layout of the property.

Estimated re-instatement cost for insurance purposes:

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £425,000 (FOUR HUNDRED AND TWENTY FIVE THOUSAND POUNDS STERLING).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Valuation and market comments:

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £480,000 (FOUR HUNDRED AND EIGHTY THOUSAND POUNDS STERLING).

Signed:	Electronically by Kristofor Hall
Report author:	Kristofor Hall
Company name	Shepherd Chartered Surveyors (Glasgow South)
Address:	269 Kilmarnock Road, Glasgow, G43 1TX
Date of report:	31/01/2023

Mortgage Valuation Report

128

Shawmoss Road

Glasgow

Lanarkshire

G41 4AJ

Seller's Name:

Gurdave singh

Date of Inspection:

30/01/2023

Prepared by:

Kristofor Hall

1. Property Details

Property type:	Bungalow
Floor(s) on which located (<i>Flat or maisonettes only</i>):	
Number of floors in block (<i>Flat or maisonettes only</i>):	
Number of units in block (<i>Flat or maisonettes only</i>):	
Is there a lift provided? (<i>Flat or maisonettes only</i>):	
Property style:	Detached
Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?	No
Approximate year of construction:	1935

2. Tenure

Tenure:	Absolute Ownership
Ground rent:	
Unexpired years:	

3. Accommodation

Number of living rooms:	2
Number of bedrooms:	3
Number of kitchens:	1
Number of Bathrooms	2
Number of water closets:	0
Other Rooms:	0
Internal gross floor area (excluding garages and outbuildings):	157m ²
External gross floor area (excluding garages and outbuildings):	177m ²
Does the property have a residential element greater than 40%?	Yes

4. Garage / Parking / Outbuildings

Parking type:	Parking Space
Available on site?	Yes
Permanent Outbuildings:	There is a permanent outbuilding located in the rear garden ground. This was seen to be of concrete block construction under a flat felt roof covering.

5. Construction

Main wall type:	Brick
Other (please specify):	
Roof type:	Tile
Other (please specify):	

6. Special Risks

Has the property suffered structural movement?	No
Is this recent or progressive?	

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?	No
If yes, please specify any of the above:	

7. Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in the 'brief description of central heating' section below

Drainage:	Mains
Electricity:	Mains
Central Heating:	Yes
Water:	Mains
Gas:	Mains
Brief description of central heating:	Gas fired boiler to radiators.

8. Site

Apparent legal issues to be verified by the conveyancer

Legal Issue	Verification	Description
Rights of way:		
Shared drives / access:		
Garage or other amenities on separate site:		
Shared service connections:		
Ill-defined boundaries:		
Agricultural land included with property:		
Other:		

9. Location

Location type:	Residential suburb
Other (if not specified):	

10. Planning Issues

Has the property been extended / converted / altered?	Yes
Details (if extended, converted, or altered):	It is assumed that all alterations, additions and/or extensions to the property have received all necessary Town Planning (Planning Permission) and Building Authority (Building Warrants and Completion Certificate) approvals and that documentation for such is available paying particular attention the extensions, the attic and the internal layout.

11. Roads

Roads that relate to the property:	Made up road
------------------------------------	--------------

12. General Remarks

General remarks on the property:

The property comprises an extended detached bungalow located within the Crossmyloof district of Glasgow where surrounding properties are of similar age and character.

Adequate local shopping, educational and public transport facilities are available close by.

At the time of inspection the property was found to be well maintained having regard to its age and character. As with properties of this age it should be anticipated that ongoing maintenance and repairs are required to ensure no defects occur.

13. Essential Repairs

Information relating to essential repairs for the property:

Estimated cost of essential repairs:

Retention recommendation?

Amount:

14. Comment on Mortgageability

Information relating to mortgageability of the property:

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.

15. Valuations

Market value in present condition:

£480,000.00

Market value on completion of essential repairs:


Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

£425,000.00

Is re-inspection necessary?

No

Signed:	Electronically by Kristofor Hall
Report author:	Kristofor Hall
Company name:	Shepherd Chartered Surveyors (Glasgow South)
Address:	269 Kilmarnock Road, Glasgow, G43 1TX
Date of report:	31/01/2023

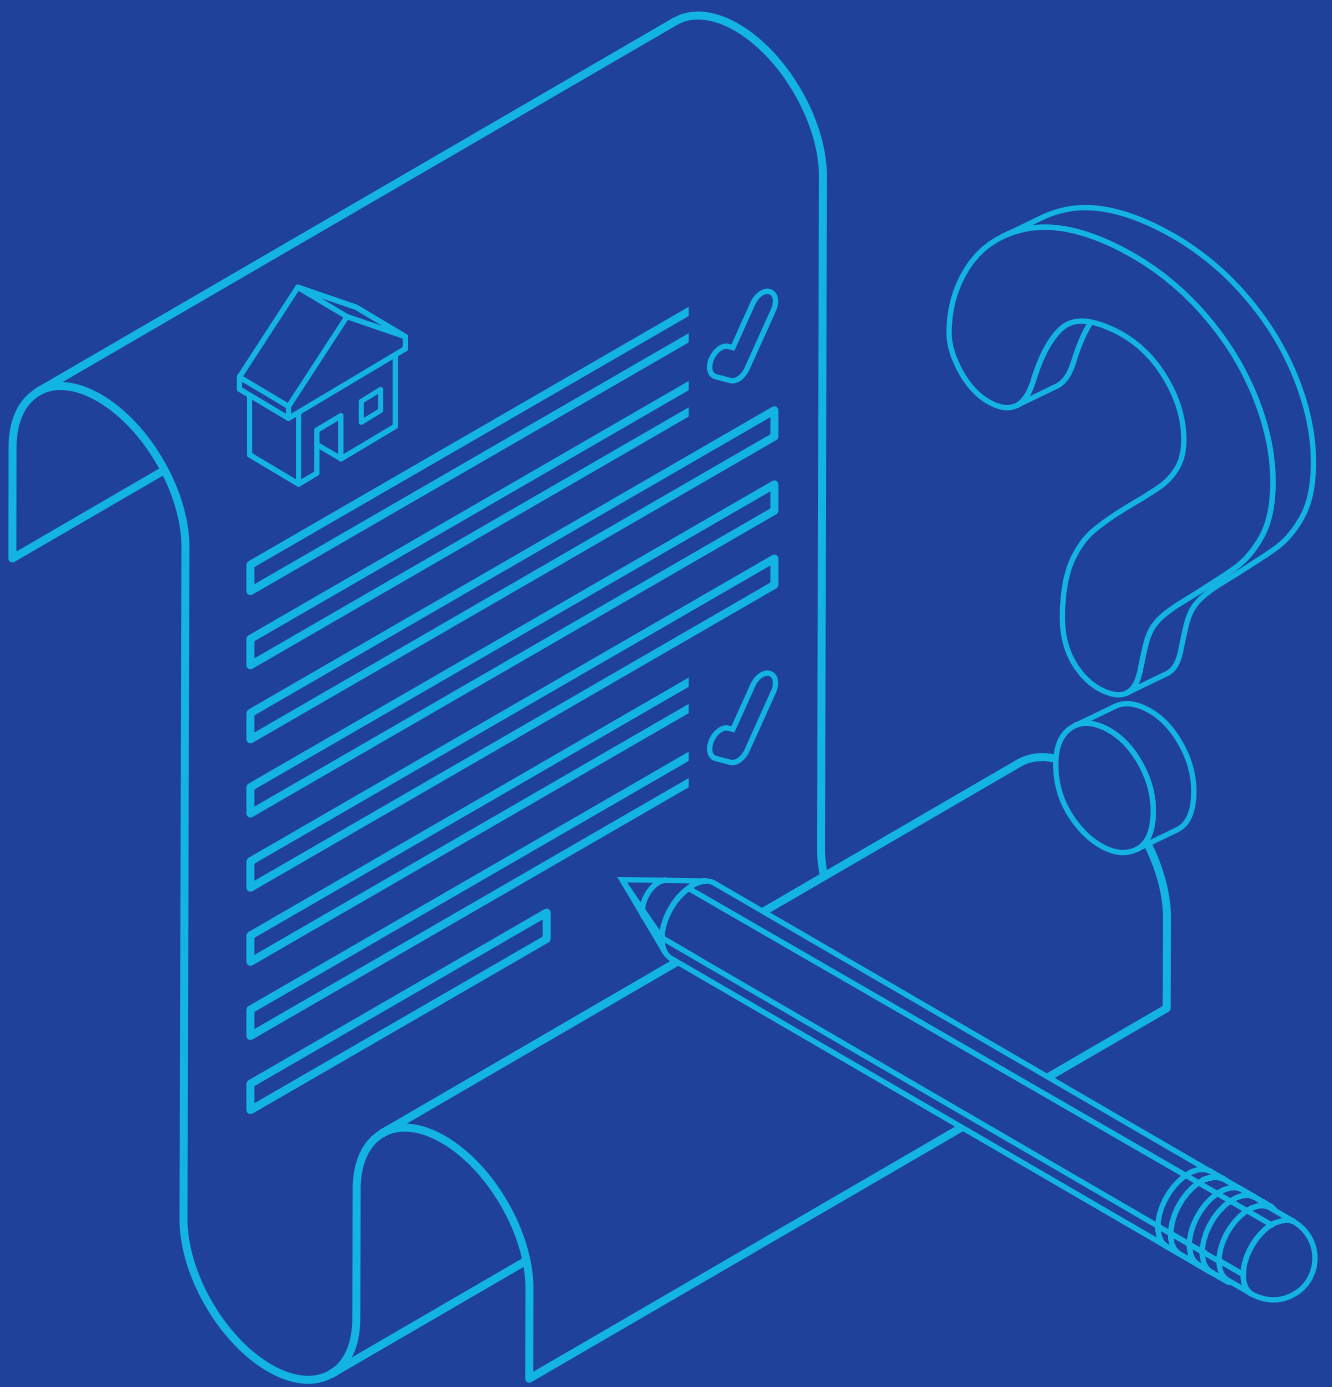

Property Questionnaire

Property Questionnaire

128

Shawmoss Road

Glasgow

Lanarkshire

G41 4AJ

Property Address:

128
Shawmoss Road
Glasgow
Lanarkshire
G41 4AJ

Seller(s):

Gurdave singh

Completion date of Property Questionnaire:

06/02/2023

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1. Length of ownership

How long have you owned the property?	19 years
---------------------------------------	----------

2. Council Tax

Which Council Tax band is your property in?	G
---	---

3. Parking

What are the arrangements for parking at your property?	Driveway
---	----------

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	No
---	----

5. Listed Buildings

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	No
---	----

6. Alterations/additions/extensions

a.	Yes
-----------	-----

(i). During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	
--	--

<i>If you have answered yes, please describe the changes which you have made:</i>	-
---	---

(ii). Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	No
--	----

<i>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</i> <i>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.</i>	
b. Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	No
(i). Were the replacements the same shape and type as the ones you replaced?	
(ii). Did this work involve any changes to the window or door openings?	
(iii). Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed?) <i>Please give any guarantees which you received for this work to your solicitor or estate agent.</i>	
7. Central Heating	
a. Is there a central heating system in your property? <i>Note: A partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).</i>	Yes
<i>If you answered yes/partial:</i> What kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas, warm air). <i>If you answered yes, please answer the following three questions:</i>	Gas
(i). When was your central heating system or partial central heating system installed?	-
(ii). Do you have a maintenance contract for the central heating system? <i>If you have answered yes, please give details of the company with which you have a maintenance agreement:</i>	No
(iii). When was your maintenance agreement last renewed? (Please provide the month and year).	

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

No

Note: The surveyor will provide this within their inspection.

9. Issues that may have affected your property

a.

Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b.

Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10. Services

a.

Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	Yes	
Water mains/private water supply	Yes	
Electricity	Yes	
Mains drainage	Yes	
Telephone	Yes	
Cable TV/Satellite	Yes	
Broadband	Yes	

b.

Is there a septic tank system in the property?

No

If you have answered yes, please answer the two questions below:

(i). Do you have appropriate consents for the discharge from your septic tank?

(ii). Do you have maintenance contract for your septic tank?

If you have answered yes, please give details of the company with which you have a maintenance contract:

11. Responsibilities for Shared or Common Areas

a.

Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

No

If you have answered yes, please give details:

b.

Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

No

If you have answered yes, please give details:

c.

Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

No

d.

Do you have the right to walk over any of your neighbours' property - for example, to put out your rubbish bin or to maintain your boundaries?

No

If you have answered yes, please give details:

e.

As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

No

If you have answered yes, please give details:

f.

As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned).

No

If you have answered yes, please give details:

12. Charges associated with your property

a.

Is there a factor or property manager for your property?

No

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

b.

Is there a common buildings insurance policy?

No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

c.

Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Resident's Association, or maintenance or stair fund.

13. Specialist Works

a.

As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

No

If you have answered yes, please say what the repairs were for, whether they carried out the repairs (and when), or if they were done before you bought the property:

b.

As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

c.

If you have answered yes to 13 (a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be

shown in the original estimate.

Guarantees are held by:

14. Guarantees

a.

Are there any guarantees or warranties for any of the following?

(i). Electrical work

No

(ii). Roofing

No

(iii). Central Heating

No

(iv). NHBC

No

(v). Damp course

No

(vi). Any other work or installations? (For example, cavity wall insulation, underpinning, indemnity policy)

No

b.

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

c.

Are there any outstanding claims under any of the guarantees listed above?

If you have answered yes, please give details

No

15. Boundaries

a.

So far as you are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years, have you ever received a notice;

a.

advising that the owner of a neighbouring property has made a planning application?

No

b.

that affects your property in some other way?

No

c.

that requires you to do any maintenance, repairs or improvements to your property?

No

Notice:

If you have answered yes to any of **a.-c.** above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.



Engagement for Single Survey -TERMS & CONDITIONS

Name: *G SINGH*

Address: *128 Shawmoss Road G41 4AJ*

We refer to your instructions received requiring us to carry out and to prepare and deliver a report on the above property owned by you or which you have authority to sell. This is to be a mandatory Single Survey Report and an optional generic Mortgage Valuation Report. We accept the instructions only on the basis that the scope, purpose and conditions of the report are as set out in this letter and the Terms and Conditions for the Single Survey Report and the generic Mortgage Valuation Report. The Terms and Conditions are attached to and form part of this letter and we will attach the same Terms and Conditions to the front of the report before we deliver it. A replacement Home Report (RHR) may also be required, (see S1.10 attached), and these Terms and Conditions, when signed and returned to J & E Shepherd also relate and are applicable to any RHR where instructed.

The generic Mortgage Valuation Report is not mandatory. If you have instructed us to prepare a generic Mortgage Valuation Report, you and your professional advisors must ensure that it is issued to all potential purchasers along with the Single Survey Report. A record must be kept, by the parties responsible for distributing the Report, of the names, addresses and contact telephone numbers of all who view or receive copies of the Report. Such record must be made available to J & E Shepherd for reference purposes if requested.

The Single Survey requires disclosure of any previous business relationship we may have with you, your property, or your selling agent. If appropriate, disclosure has been made in Part 1 of the Terms and Conditions. The scope and extent of the inspection is detailed in Part 2 of the Terms and conditions. We are required by the Royal Institution of Chartered Surveyors to seek formal confirmation from you that you are satisfied that the Single Survey Terms and Conditions meets your requirements.

You may cancel the instructions by notifying us at our address at any time before the date of the inspection of the property for the purpose of preparing the report. If you do, we will refund any money paid to us in relation to the survey except for expenses reasonably incurred. We will be entitled to cancel our obligations if, after arriving at the property, our Surveyor concludes that this is a type of property or construction of which the Surveyor has insufficient specialist knowledge to be able to prepare the report satisfactorily, provided we inform you at the earliest opportunity. Additionally, J & E Shepherd may also cancel our obligations if the property is found to be an exempt property as defined in the Single Survey Regulations, or there is a threat to the health or personal safety of the Surveyor. If we do cancel we will refund any money paid in relation to the survey and we will explain the reasons for the cancellation. If you decide to cancel, for whatever reason, after the inspection has taken place but before a written report is issued, we will be entitled to a fee equating to 80% of the agreed fee. Additional fees will be charged for subsequent inspections, including replacing the report if older than 90 days, and revisits following repair and improvement works whether before or after the draft report has been prepared. We attach a note of our professional fee for the initial Single Survey and Energy Report.

Please read this letter and the Terms and Conditions carefully and confirm acceptance of engagement on the basis of them by signing the acceptance at the foot of this letter and returning it to us with your payment in settlement of our fee, unless other payment options, as noted above, have been agreed, following which the report will be released to you.

Yours faithfully,

J&E Shepherd
Chartered Surveyors

I have read and understood this letter and the accompanying Terms and Conditions. By signing and returning this letter I accept that this is the entire basis upon which you are instructed to carry out a survey of the above property.

Signed.....

Print.....

Date:.....

Our Terms & Conditions of Engagement are available for download from our company website www.shepherd.co.uk, at the foot of the home page click on "Conditions of Engagement"
SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The seller has engaged J & E Shepherd to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The seller has also engaged J & E Shepherd to provide an Energy Report in the format prescribed by the accredited Energy Company.

J & E Shepherd are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific forms where requested. For this service a fee may be charged to the prospective purchaser. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. J & E Shepherd will decline any transcript request which requires the provision of information additional to the information in the report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase, made in writing.

Once the Seller has conditionally accepted an offer to purchase, made in writing, the Purchaser's lender or conveyancer may request that J & E Shepherd provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to J & E Shepherd, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing, however at a minimum fee of £50+vat.

If information is provided to J & E Shepherd during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, J & E Shepherd reserves the right to reconsider the valuation. Where J & E Shepherd requires to amend the valuation in consequence of such information, we will



RICS

the mark of
property
professionalism
worldwide

issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property.

If J & E Shepherd have had a previous business relationship within the past two years with the Seller or Sellers agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



J & E Shepherd have a written Complaints Handling Procedure (CHP). This CHP document is available from the offices of J & E Shepherd.

1.2 THE REPORT

J & E Shepherd will not provide an amended Report on the Property, except to correct factual inaccuracies.

The report will identify the nature and source of information relied upon in its preparation.

J & E Shepherd shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyor rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the report may be published in any way, reproduced or distributed by any party other than the seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of J & E Shepherd.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors. This shall be in accordance with the current RICS Valuation-Professional Standards (the Red Book) and RICS Codes of Conduct.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

J & E Shepherd acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. J & E Shepherd accept no responsibility or liability whatsoever in relation to the Report to persons other than the seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, J & E Shepherd accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

J & E Shepherd undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

J & E Shepherd undertake that on being asked to do so by a prospective purchaser, and at an optional minimum charge of £50+vat, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between J & E Shepherd and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. ²

²Which shall be in accordance with the current RICS Valuation-Professional Standards (the Red Book) and RICS Rules of Conduct.

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of J & E Shepherd and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

J & E Shepherd are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the relevant J & E Shepherd office at any time before the day of the inspection.

J & E Shepherd will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. J & E Shepherd will also be entitled not to proceed if after arriving at the property, the inspecting surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the surveyor's discretion.

In the case of cancellation or the inspection not proceeding, J & E Shepherd will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, J & E Shepherd will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by J & E Shepherd from information in the Report but in the Surveyor's own format;
- Replacement Home Report (RHR): this relates to reinspection of the property to prepare a new full Single Survey in order to replace the previous out of date Home Report, normally required after the original Home Report dates 91 days old or more.
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in Part 1 of Schedule 1 of The Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the report on the Property; and
- the "Surveyors/ J&E Shepherd" are the firm or company of whom the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the report.
- The "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, J & E Shepherd has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

Sloping roofs are visually inspected with the aid of binoculars where appropriate. Roof spaces are visually inspected and entered where there is safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the surveyor deems it safe and reasonable to do so.

Surfaces of exposed floors are visually inspected. No carpets or floor coverings are lifted. Sub-floor areas are inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations.

In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

It is assumed that the subject property site and neighbouring areas are free from Japanese Knotweed. Japanese knotweed is an invasive plant that can damage footpaths, driveways, patios and in the worst cases, it can get into the home itself. It is very difficult to get rid of this plant, and removal of this plant can take a number of years, be costly and may affect future saleability and mortgagability of an affected home. Japanese Knotweed is a seasonal growth plant and is almost invisible during the winter months and during its non-growth phase.

2.3 THE REPORT

The Report will be prepared by the surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

Where defects or repairs have been identified within the report it is essential that, prior to entering into any legally binding sale or purchase contract, further specialists or contractors advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

2.4 SERVICES

Our surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. J & E Shepherd cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains J & E Shepherd's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which an asset or liability should exchange on the valuation date between a willing buyer and a willing seller in an arm's-length transaction, after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

Our Terms & Conditions of Engagement are available for download from our company website www.shepherd.co.uk, at the foot of our home page click on "Conditions of Engagement"



▲ ▲ Aberdeen 01224 202800	▲ Dumbarton 01389 731682	▲ ▲ Edinburgh 0131 225 1234	▲ ▲ Glasgow Commercial 0141 331 2807	▲ ▲ Inverness 01463 712239	▲ Motherwell 01698 252229	▲ Peterhead 01779 470766
▲ Ayr 01292 267987	▲ ▲ Dumfries 01387 264333	▲ Elgin 01343 553939	▲ Glasgow South 0141 649 8020	▲ Kilmarnock 01563 520318	▲ Musselburgh 0131 653 3456	▲ ▲ St Andrews 01334 477773
▲ Coatbridge 01236 436561	▲ ▲ Dundee 01382 200454	▲ Falkirk 01324 635 999	▲ Glasgow West End 0141 353 2080	▲ Kirkcaldy 01592 205442	▲ Oban 01631 707 800	▲ Saltcoats 01294 464228
▲ Cumbernauld 01236 780000	▲ ▲ Dunfermline 01383 722337	▲ Fraserburgh 01346 517456	▲ Greenock 01475 730717	▲ Livingston 01506 416777	▲ Paisley 0141 889 8334	▲ Stirling 01786 450438
▲ Dalkeith 0131 663 2780	▲ East Kilbride 01355 248535	▲ Galashiels 01896 750150	▲ Hamilton 01698 897548	▲ Montrose 01674 676768	▲ ▲ Perth 01738 638188	