

HOME REPORT



DM HALL
CHARTERED SURVEYORS

Home Report

Property: **3g
Dundonald Road
Troon
Ayrshire
KA10 6NP**


Prepared for: **Catherine Livingston**

Prepared by: **Mark Rutherford MA (Hons) MRICS**

Report reference: **1582104-1-2**

Date of Report: **25/10/2023**

ENERGY PERFORMANCE CERTIFICATE

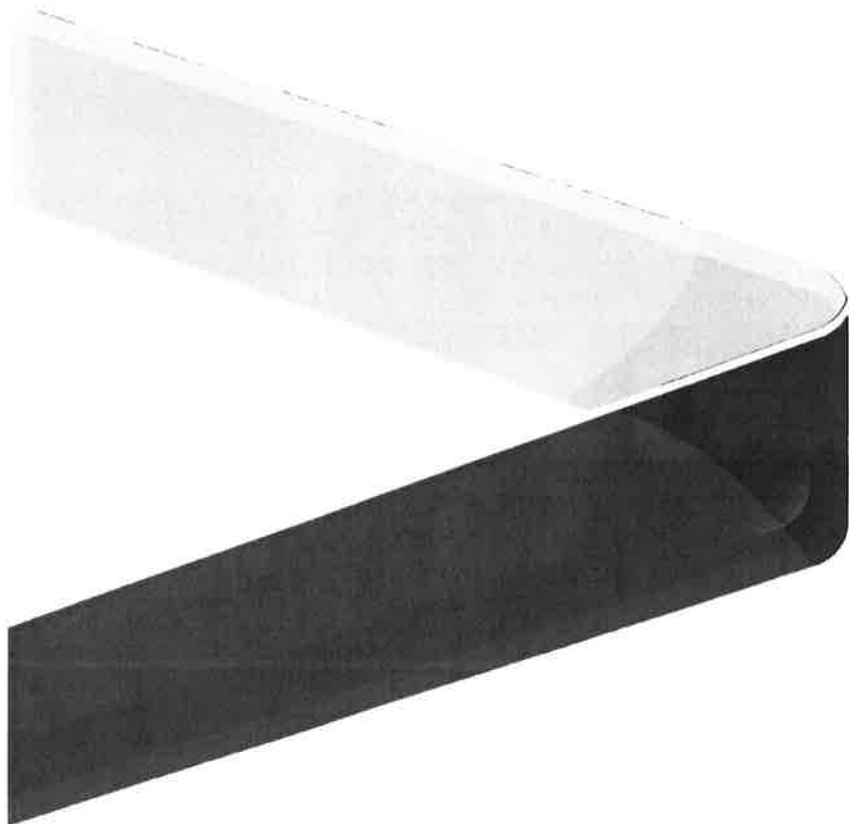

DM HALL
CHARTERED SURVEYORS

Energy Performance Certificate (EPC)

Scotland

Dwellings

3G DUNDONALD ROAD, TROON, KA10 6NP

Dwelling type: Top-floor flat
Date of assessment: 24 October 2023
Date of certificate: 25 October 2023
Total floor area: 40 m²
Primary Energy Indicator: 244 kWh/m²/year


Reference number: 2541-1905-0200-0087-3200
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,922	See your recommendations report for more information
Over 3 years you could save*	£624	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

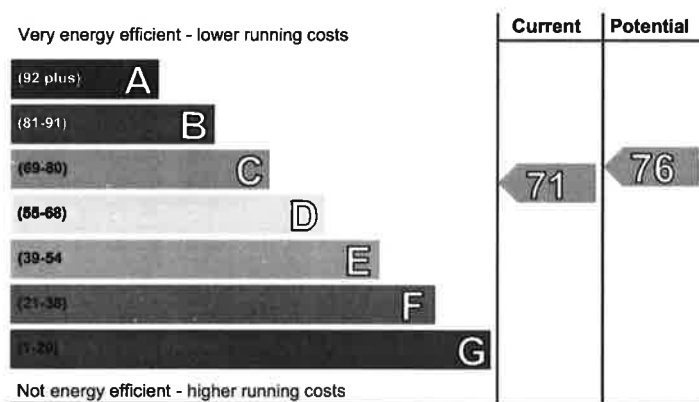


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (71)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

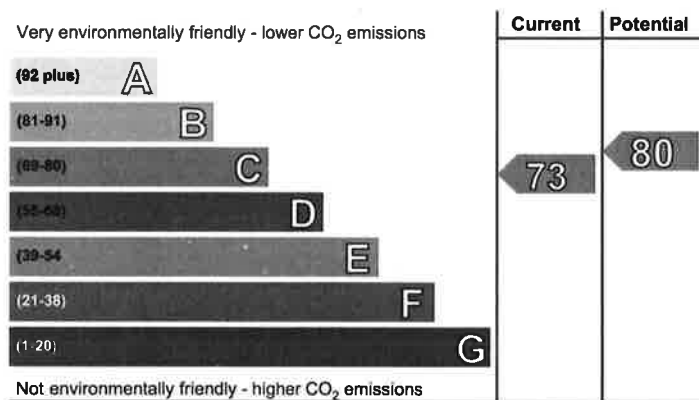

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (73)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal or external wall insulation	£4,000 - £14,000	£627.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit [greenerscotland.org](https://www.greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
	Solid brick, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, 200 mm loft insulation	★★★★★	★★★★★
Floor	(another dwelling below)	—	—
Windows	Mostly double glazing	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★★	★★★★★
Main heating controls	Programmer, TRVs and bypass	★★★★★	★★★★★
Secondary heating	None	—	—
Hot water	From main system	★★★★★	★★★★★
Lighting	Low energy lighting in 80% of fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 43 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.7 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.4 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,127 over 3 years	£1,500 over 3 years	
Hot water	£540 over 3 years	£543 over 3 years	
Lighting	£255 over 3 years	£255 over 3 years	
Totals	£2,922	£2,298	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal or external wall insulation	£4,000 - £14,000	£209	 C 76	 C 80

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

energy[®]
saving
trust

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	4,420	N/A	N/A	(1,741)
Water heating (kWh per year)	1,559			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Mark Rutherford
Assessor membership number:	EES/009464
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	15 Miller Road Ayr KA7 2AX
Phone number:	01292 286974
Email address:	mark.rutherford@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property


There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greener-scotland.org](https://www.greener-scotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY

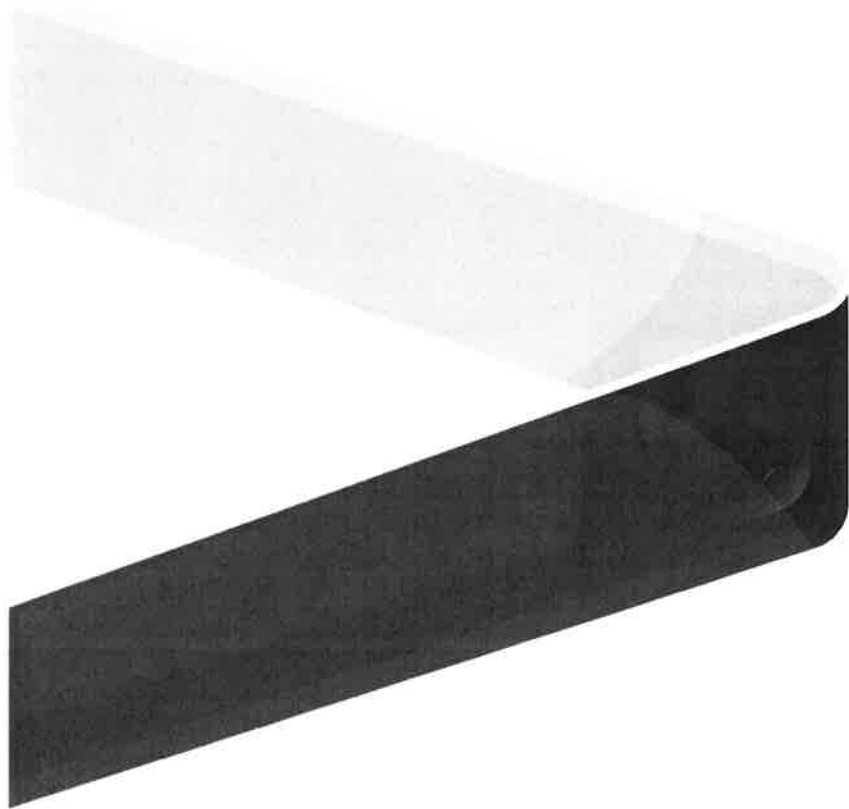

DM HALL
CHARTERED SURVEYORS

Schedule 1

Survey Report

3g

Dundonald Road

Troon

Ayrshire

KA10 6NP

Customer

Catherine Livingston

Date of Inspection

25/10/2023

Prepared by

Mark Rutherford MA (Hons) MRICS

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description

The subjects comprise a purpose built first floor flat situated within a two storey mid-terraced building which contains eight flats.

Accommodation

There is a shared entrance leading to six of the flats in the building.

FIRST FLOOR:- Entrance Hallway, Lounge, Kitchen, Bedroom, Bathroom.

Gross internal floor area (m^2)

40 square metres.

Neighbourhood and location

The property is situated within an established residential location where surrounding properties are of a similar age and a variety of type.

Age

Local amenities are readily available.
Approximately 125 years.

Weather

Overcast and dry following a recent period of settled weather conditions.

Chimney stacks

Visually inspected with the aid of binoculars where appropriate.

Brick construction with a pointed finish. The adjacent flashings are formed in lead and felt/cement.

Roofing including roof space

Sloping roofs were visually inspected with the aid of binoculars where appropriate.

Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.

Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.

If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

The roof is pitched and overlaid with slates.

I was able to partially inspect the common roof space and gained access from a hatch within the common landing.

The roof is built of timber trusses and boarded over with timber sarking. Insulation material is laid between and over the ceiling joists.

Rainwater fittings

Visually inspected with the aid of binoculars where appropriate.

Rainwater units are of cast iron and PVC materials consisting of half round and wallhead gutters discharging into round downpipes.

Main walls

Visually inspected with the aid of binoculars where appropriate.

Foundations and concealed parts were not exposed or inspected.

The outer walls are of solid stone and solid brick construction, having a pointed external finish.

A damp-proof course is not visible and it is unclear whether a building of this would have a damp-proof membrane incorporated within the external walls.

There are sub-floor ventilators to lower walls.

Windows, external doors and joinery

Internal and external doors were opened and closed where keys were available.

Random windows were opened and closed where possible.

Doors and windows were not forced open.

Windows are of aluminium double glazed type, although the window unit within the kitchen is of timber single glazed design.

The external door is timber design.

External decorations	There are timber fascia and soffit boards. Visually inspected.
	External decoration has a painted finish.
Conservatories/Porches	None.
Communal areas	Circulation areas visually inspected.
	Access to six of the flats in the building is via a shared entrance.
Garages and permanent outbuildings	Visually inspected
	I am advised by the seller that the timber garage to the rear of the common gardens pertains to the subject property and this should be confirmed. The roof covering is overlaid in felt.
Outside areas and boundaries	Visually inspected.
	There are garden grounds to the rear of the property, which I have assumed to be communal. These being laid out in grass and concrete paving.
	Boundary divisions are marked by brick walls, stone walls and timber fencing.
Ceilings	Visually inspected from floor level.
	Ceilings are of lath and plaster materials.
	There are PVC lined ceilings to the bathroom and kitchen.
Internal walls	Visually inspected from floor level.
	Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
	Internal walls are partly of masonry construction finished in plaster and partly of timber stud construction finished in plasterboard.
	There are PVC wall finishes to the bathroom.

Floors including sub floors

Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.

Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.

Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.

Flooring is of suspended timber construction consisting of what I assume to be tongue and groove boards laid over timber joists.

Internal joinery and kitchen fittings

Built-in cupboards were looked into but no stored items were moved.

Kitchen units were visually inspected excluding appliances.

Internal joinery is of timber and there are timber internal doors.

The kitchen contains floor and wall mounted storage units.

Chimney breasts and fireplaces

Visually inspected.

No testing of the flues or fittings was carried out.

Any original fireplaces have been removed.

Internal decorations

Visually inspected.

Internal decorative finishes are generally papered or painted.

Cellars

None.

Electricity

Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

Mains supply.

The electrical consumer unit is located within the hallway cupboard.

Gas

Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.

Mains supply.

The gas meter is located within the hallway cupboard.

Water, plumbing and bathroom fittings

Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.

No tests whatsoever were carried out to the system or appliances.

Mains water supply.

Visible sections of pipework are of copper and PVC materials.

Sanitary fittings in the bathroom comprise a white suite with low level WC, wash hand basin and bath.

There is a stainless steel sink unit within the kitchen.

Heating and hot water

Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.

No tests whatsoever were carried out to the system or appliances.

There is a "Vokera" wall mounted gas heating boiler situated within the kitchen.

This serves water filled steel panelled radiators throughout the house and it also provides domestic hot water.

Drainage

Drainage covers etc. were not lifted.

Neither drains nor drainage systems were tested.

Drainage is to the mains sewerage system.

Fire, smoke and burglar alarms

Visually inspected.

No tests whatsoever were carried out to the system or appliances.

There are smoke alarms installed.

Legislation by the Scottish Government, which took effect from February 2022, requires all residential properties to have a system of inter-linked smoke alarms and heat detectors. Carbon monoxide detectors are also required where appropriate. Purchasers should appraise themselves of the requirements of this legislation, and engage with appropriately accredited contractors to ensure compliance.

Any additional limits to inspection

For flats / maisonettes

Only the subject flat and internal communal areas giving access to the flat were inspected.

If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.

The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and unless otherwise stated, for the purposes of the valuation I have assumed that there is no Japanese Knotweed or other invasive plants within the boundaries of the property or in neighbouring properties.

The report does not include an asbestos inspection. However asbestos was widely used in the building industry until around 2000, when it became a banned substance. If the possibility of asbestos based products has been reported within the limitations of the inspection and you have concerns you should engage a qualified asbestos surveyor.

Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate.

The property was unoccupied, unfurnished and all floors were covered. Floor coverings restricted my inspection of flooring.

I was not able to inspect the sub floor area.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.

My physical inspection of the common roof void area was restricted due to insulation material, stored items and lack of suitable crawl boards. As a result the roof void area was only viewed from the access hatch.


Concealed areas beneath and around bath/shower trays were not visible. Water spillage in these areas can often be discovered unexpectedly with resultant damage to concealed parts of the fabric.

The inspection is not a fire or life safety risk assessment

and should not be relied on as a risk assessment inspection. Further advice should be sought if a specific risk assessment of the property and building that it forms part of is required.

Where repairs are required at height compliance with Health and Safety legislation often requires the use of scaffolding which can significantly impact on the cost of repair. Pricing repairs is out with the remit of this report but it would be prudent to consider costs and budgeting before offering. The various trades can advise further.

▷ Sectional diagram showing elements of a typical house:

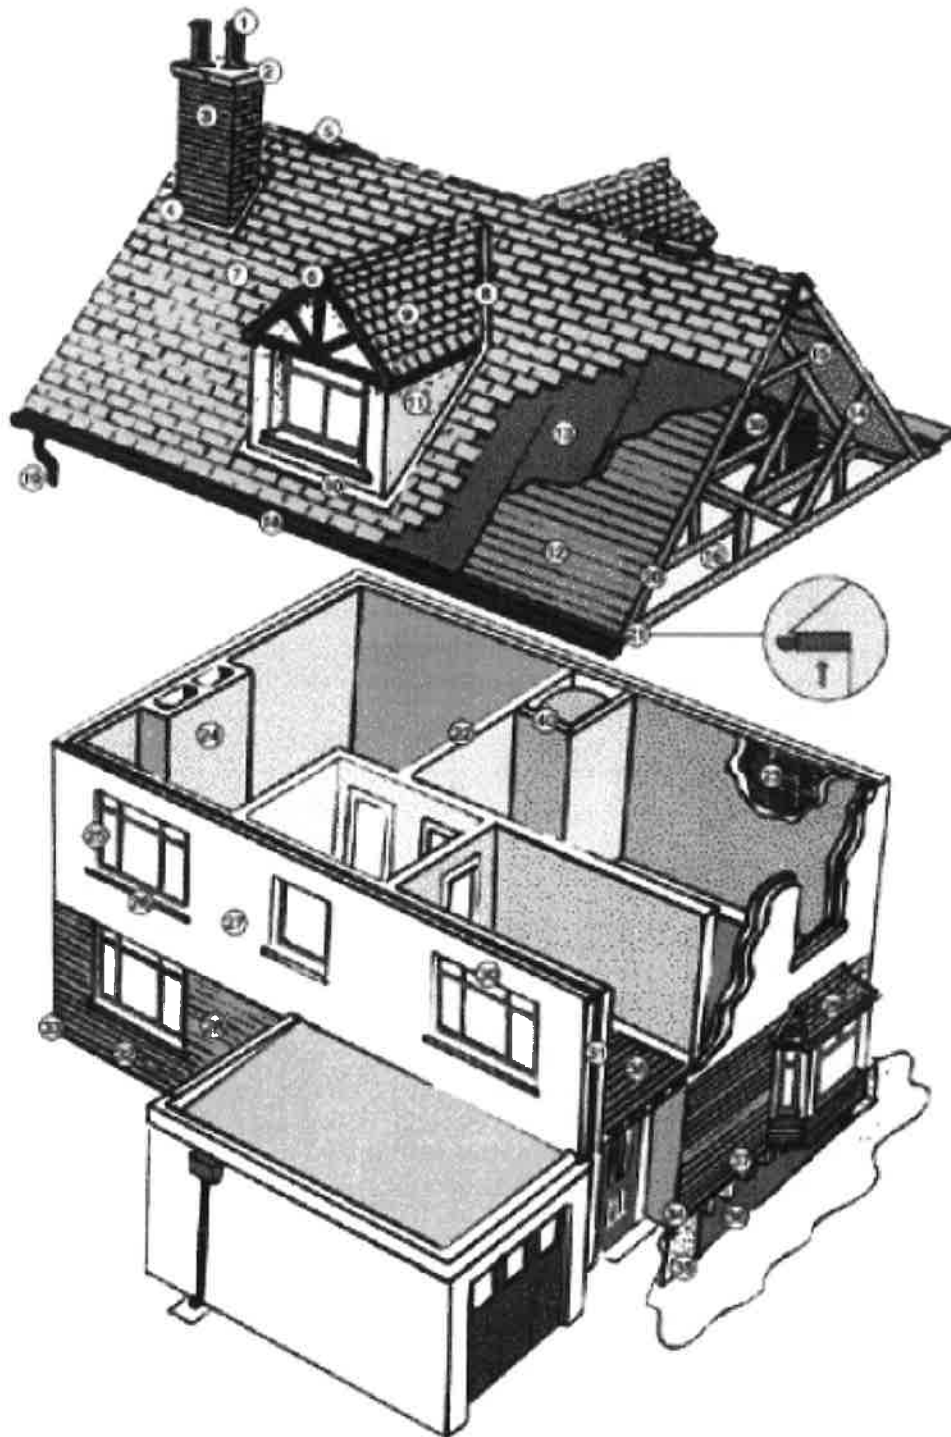

- ① Chimney pots
- ② Coping stone
- ③ Chimney head
- ④ Flashing
- ⑤ Ridge ventilation
- ⑥ Ridge board
- ⑦ Slates / tiles
- ⑧ Valley guttering
- ⑨ Dormer projection
- ⑩ Dormer flashing
- ⑪ Dormer cheeks
- ⑫ Sarking
- ⑬ Roof felt
- ⑭ Trusses
- ⑮ Collar
- ⑯ Insulation
- ⑰ Parapet gutter
- ⑱ Eaves guttering
- ⑲ Rainwater downpipe
- ⑳ Verge boards /skews
- ㉑ Soffit boards
- ㉒ Partiton wall
- ㉓ Lath / plaster
- ㉔ Chimney breast
- ㉕ Window pointing
- ㉖ Window sills
- ㉗ Rendering
- ㉘ Brickwork / pointing
- ㉙ Bay window projection
- ㉚ Lintels
- ㉛ Cavity walls / wall ties
- ㉜ Subfloor ventilator
- ㉝ Damp proof course
- ㉞ Base course
- ㉟ Foundations
- ㊱ Solum
- ㊲ Floor joists
- ㊳ Floorboards
- ㊴ Water tank
- ㊵ Hot water tank

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these terms.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories.

Category 3	Category 2	Category 1
Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement

Repair category:

1

Notes

The property has been affected by previous movement but within the limitations of the inspection there was no evidence to suggest that this is ongoing.

Dampness, rot and infestation

Repair category:

2

Notes

There is evidence of penetrating dampness to a wall internally within the bedroom and concealed timbers may be defective. Further investigation can be carried out by a firm of timber/damp specialists with a view to having all necessary remedial repairs implemented.

Chimney stacks

Repair category:

2

Notes

Weathering is apparent to the brickwork, pointing and flashings of the chimney stacks.

Chimneys, particularly of older properties, can be a source of water penetration and defects to rendering, mortar and flashings can be difficult to detect from a ground level inspection. These will require to be maintained in good repair to discourage water penetration. It is good practice to engage a reputable roofing or building contractor prior to purchase to advise on life expectancy and repair/replacement costs.

Roofing including roof space

Repair category:

2

Notes

There are a number of broken and loose slates together with staining to roof timbers. A reputable roofing contractor can be asked to inspect the roof structure to advise on all necessary repairs to ensure wind and water tightness. Inspection at close quarters may reveal further deterioration/damage to roofing materials, especially where these are original. Regular maintenance is anticipated until replacement.

Rainwater fittings

Repair category:

2

Notes

Metal rainwater fittings are corroded in places. These should be treated and redecorated. Metal rainwater fittings require regular maintenance.

There are wall head gutters. These can be problematic, especially within

older buildings, and maintenance should be undertaken regularly.

Main walls



Repair category: 2
Notes Erosion is evident to the brickwork and stonework of external walls.

Windows, external doors and joinery



Repair category: 2
Notes The window units are of an older design and wear and tear is noted. Repair/replacement in the short to medium term should be anticipated. The seals to older double glazed units often fail resulting in condensation between the panes of glass. Failed sealed units can go undetected in certain weather/daylighting conditions and such failings are not considered to be significant because the window remains functional albeit not as double glazing. This can occur without warning and may only be seen in certain weather conditions.

External joinery is affected by decay to varying degrees. A reputable joiner can advise on all necessary repairs.

External decorations



Repair category: 2
Notes Outside paintwork has deteriorated and redecoration is now required. Regular re-painting of external joinery will prolong its life span.

Conservatories/porches



Repair category: -
Notes None.

Communal areas



Repair category: 2
Notes Elevated moisture readings were recorded and damage noted to the plasterwork and decoration within the common close and stairwell areas.

Garages and permanent outbuildings



Repair category: 2
Notes The garage requires repair/replacement.

Outside areas and boundaries



Repair category: 2
Notes Garden walls have deteriorated and require general repair.

Ceilings



Repair category: 1
Notes The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above.

Internal walls



Repair category: 1
Notes The textured finishes may contain asbestos based material. See information on Asbestos in the Limitations of Inspection section above.

Floors including sub-floors



Repair category: 1

Notes It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work.

Internal joinery and kitchen fittings



Repair category: 1

Notes Wear and tear is noted to the kitchen units and work surfaces.

Chimney breasts and fireplaces



Repair category: 1

Notes Where fireplaces have been removed there is limited provision for ventilation. Unventilated chimney breasts can result in condensation. Disused chimneys should be capped and vented.

Internal decorations



Repair category: 1

Notes No significant defects evident.

Cellars



Repair category: -

Notes None.

Electricity



Repair category: 1

Notes It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC/ SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IET regulations.

Gas



Repair category: 1

Notes Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Water, plumbing and bathroom fittings



Repair category: 1

Notes Seals around bath and shower areas are vulnerable to leakage. Failure to seals can result in dampness/decay within hidden areas of the property.

Heating and hot water



Repair category: 1

Notes It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations.

Boilers and central heating systems should be tested and serviced by a Gas Safe registered contractor on an annual basis to ensure their safe and efficient operation.

Drainage

Repair category:

1

Notes

No significant defects evident.



Summary:

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Category 3	Structural Movement	1
Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Dampness, rot and infestation	2
	Chimney stacks	2
	Roofing including roof space	2
	Rainwater fittings	2
	Main walls	2
Category 2	Windows, external doors and joinery	2
Repairs or replacement requiring future attention, but estimates are still advised.	External decorations	2
	Conservatories/porches	-
	Communal areas	2
Category 1	Garages and permanent outbuildings	2
No immediate action or repair is needed.	Outside areas and boundaries	2
	Ceilings	1
	Internal walls	1
	Floors including sub floors	1
	Internal joinery and kitchen fittings	1
	Chimney breasts and fireplaces	1
	Internal decorations	1
	Cellars	-
	Electricity	1
	Gas	1
	Water, plumbing and bathroom fittings	1
	Heating and hot water	1
	Drainage	1

Remember:

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance notes on Accessibility Information:

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes; parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

- | | |
|--|-------|
| 1 Which floor(s) is the living accommodation on? | First |
| 2 Are there three steps or fewer to a main entrance door of the property? | No |
| 3 Is there a lift to the main entrance door of the property? | No |
| 4 Are all door openings greater than 750mm? | No |
| 5 Is there a toilet on the same level as the living room and kitchen? | Yes |
| 6 Is there a toilet on the same level as a bedroom? | Yes |
| 7 Are all rooms on the same level with no-internal steps or stairs? | Yes |
| 8 Is there unrestricted parking within 25 metres of an entrance door to the building? | Yes |

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes

Matters for a solicitor or licensed conveyancer:

The Building factor should be asked to confirm that there are no planned or outstanding repair schemes for the building containing the flat. The flat may have a common building reinstatement policy.

The subjects form part of a tenement/block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

The property has been reconfigured in the past including the formation of an internal bathroom. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

There is a lane providing vehicular access to the garage. Rights of access and any liabilities should be legally confirmed.

Estimated re-instatement cost for insurance purposes:

£125,000 (ONE HUNDRED AND TWENTY FIVE THOUSAND POUNDS).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments:

£67,000 (SIXTY SEVEN THOUSAND POUNDS).

Following buoyant market conditions over a prolonged period through the Covid 19 pandemic, there are now indications of a return to a more balanced level of supply and demand.

Signed:	Electronically by Mark Rutherford MA (Hons) MRICS
Report author:	Mark Rutherford MA (Hons) MRICS
Company name	DM Hall (Ayr)
Address:	15 , Miller Road, Ayr, KA7 2AX
Date of report:	25/10/2023

Mortgage Valuation Report

3g

Dundonald Road

Troon

Ayrshire

KA10 6NP

Seller's Name:

Catherine Livingston

Date of Inspection:

25/10/2023

Prepared by:

Mark Rutherford MA (Hons) MRICS

1. Property Details

Property type:	Tenement flat
Floor(s) on which located (<i>Flat or maisonettes only</i>):	1
Number of floors in block (<i>Flat or maisonettes only</i>):	2
Number of units in block (<i>Flat or maisonettes only</i>):	8
Is there a lift provided? (<i>Flat or maisonettes only</i>):	No
Property style:	Low rise block
Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?	No
Approximate year of construction:	1900

2. Tenure

Tenure:	Absolute Ownership
Ground rent:	
Unexpired years:	

3. Accommodation

Number of living rooms:	1
Number of bedrooms:	1
Number of kitchens:	1
Number of Bathrooms	1
Number of water closets:	1
Other Rooms:	0
Internal gross floor area (excluding garages and outbuildings):	40m ²
External gross floor area (excluding garages and outbuildings):	46m ²
Does the property have a residential element greater than 40%?	Yes

4. Garage / Parking / Outbuildings

Parking type:	Single garage
Available on site?	Yes
Permanent Outbuildings:	None.

5. Construction

Main wall type:	Stone
Other (please specify):	
Roof type:	Slate
Other (please specify):	

6. Special Risks

Has the property suffered structural movement?	Yes
Is this recent or progressive?	No
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the	No

immediate vicinity?

If yes, please specify any of the above:

7. Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in the 'brief description of central heating' section below

Drainage: Mains
Electricity: Mains
Central Heating: Yes
Water: Mains
Gas: Mains
Brief description of central heating: Gas fired boiler to radiators.

8. Site

Apparent legal issues to be verified by the conveyancer

Legal Issue	Verification	Description
Rights of way:		
Shared drives / access:		
Garage or other amenities on separate site:		
Shared service connections:		
Ill-defined boundaries:		
Agricultural land included with property:		
Other:	Yes	

9. Location

Location type: Residential within town/city
Other (if not specified):

10. Planning Issues

Has the property been extended / converted / altered? Yes
Details (if extended, converted, or altered): The property has been reconfigured in the past including the formation of an internal bathroom. It is assumed all necessary Local Authority and other consents have been obtained for alterations and the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it is assumed they meet the standards required by the Building Regulations or are exempt.

11. Roads

Roads that relate to the property: Made up road

12. General Remarks

General remarks on the property:

When inspected, the property was unoccupied, unfurnished and floors were covered.

Generally, the subjects are found to be in fair condition having regard to age and style of construction. No obvious significant defects which would affect value or security were in evidence.

There is a lane providing vehicular access to the garage. Rights of access and any liabilities should be legally confirmed.

13. Essential Repairs

Information relating to essential repairs for the property:

Estimated cost of essential repairs:

Retention recommendation?

Amount:

14. Comment on Mortgageability

Information relating to mortgageability of the property:

The subjects form suitable mortgage security at the valuation figure stated in this report.

15. Valuations

Market value in present condition:

£67,000.00

Market value on completion of essential repairs:

Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)


£125,000.00

Is re-inspection necessary?

No

Signed:	Electronically by Mark Rutherford MA (Hons) MRICS
Report author:	Mark Rutherford MA (Hons) MRICS
Company name:	DM Hall (Ayr)
Address:	15 , Miller Road, Ayr, KA7 2AX
Date of report:	25/10/2023

PROPERTY QUESTIONNAIRE

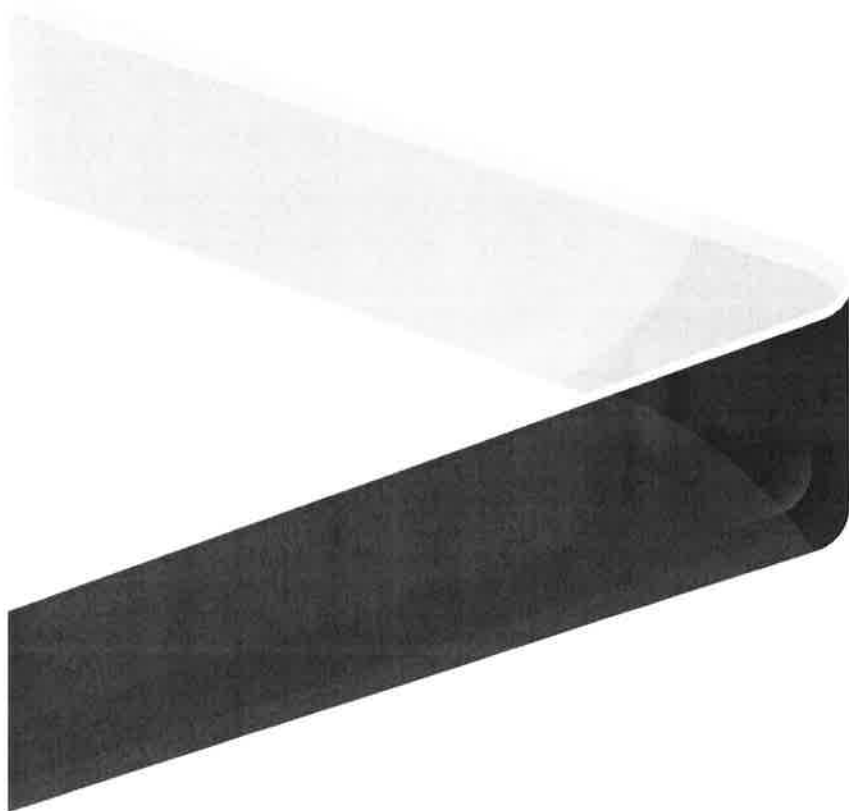

DM HALL
CHARTERED SURVEYORS

Property Questionnaire

3g

Dundonald Road

Troon

Ayrshire

KA10 6NP

Property Address:

3g
Dundonald Road
Troon
Ayrshire
KA10 6NP

Seller(s):

Catherine Livingston

Completion date of Property Questionnaire:

24/10/2023

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1. Length of ownership

How long have you owned the property?

15 years and 4 months

2. Council Tax

Which Council Tax band is your property in?

B

3. Parking

What are the arrangements for parking at your property?

Garage

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?

No

5. Listed Buildings

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?

No

6. Alterations/additions/extensions

a.

No

(i). During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?

If you have answered yes, please describe the changes which you have made:

(ii). Did you obtain planning permission, building warrant, completion certificate and other consents for this work?

If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.

b.

No

Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:

(i). Were the replacements the same shape and type as the ones you replaced?

(ii). Did this work involve any changes to the window or door openings?

(iii). Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed?

Please give any guarantees which you received for this work to your solicitor or estate agent.

7. Central Heating

a.

Yes

Is there a central heating system in your property?

Note: A partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom).

If you answered yes/partial:

GAS CENTRAL HEATING

What kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas, warm air).

If you answered yes, please answer the following three questions:

(i). When was your central heating system or partial central heating system installed?

3YEARS

(ii). Do you have a maintenance contract for the central heating system?

No

If you have answered yes, please give details of the company with which you have a maintenance agreement:

(iii). When was your maintenance agreement last renewed? (Please provide the month and year).

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old? No

Note: The surveyor will provide this within their inspection.

9. Issues that may have affected your property

a. No

Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b. No

Are you aware of the existence of asbestos in your property?

If you have answered yes, please give details:

10. Services

a.

Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas		
Water mains/private water supply		
Electricity	Yes	SCOTTISH POWER
Mains drainage		
Telephone		
Cable TV/Satellite		
Broadband		

b. No

Is there a septic tank system in the property?

If you have answered yes, please answer the two questions below:

(i). Do you have appropriate consents for the discharge from your septic tank?

(ii). Do you have maintenance contract for your septic tank?

If you have answered yes, please give details of the company with which you have a maintenance contract:

11. Responsibilities for Shared or Common Areas

a.

Don't Know

Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

If you have answered yes, please give details:

b.

Not Applicable

Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

If you have answered yes, please give details:

c.

No

Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

d.

Yes

Do you have the right to walk over any of your neighbours' property - for example, to put out your rubbish bin or to maintain your boundaries?

If you have answered yes, please give details:

N/A

e.

Yes

As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

If you have answered yes, please give details:

N/A

f.

No

As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned).

If you have answered yes, please give details:

12. Charges associated with your property

a. No
Is there a factor or property manager for your property?

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

b. Don't Know
Is there a common buildings Insurance policy?

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

c. N/A
Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Resident's Association, or maintenance or stair fund.

13. Specialist Works

a. No
As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

If you have answered yes, please say what the repairs were for, whether they carried out the repairs (and when), or if they were done before you bought the property:

b. No
As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

If you have answered yes, please give details:

c.
If you have answered yes to 13 (a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be

shown in the original estimate.

Guarantees are held by:

14. Guarantees

a.

Are there any guarantees or warranties for any of the following?

(i). Electrical work No

(ii). Roofing No

(iii). Central Heating No

(iv). NHBC No

(v). Damp course No

(vi). Any other work or installations? (For example, cavity wall insulation, underpinning, indemnity policy) No

b.

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

c.

Are there any outstanding claims under any of the guarantees listed above?

No

If you have answered yes, please give details

15. Boundaries

a.

No

So far as you are aware, has any boundary of your property been moved in the last 10 years?

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years, have you ever received a notice;

a.

No

advising that the owner of a neighbouring property has made a planning application?

b.

No

that affects your property in some other way?

c.

No

that requires you to do any maintenance, repairs or improvements to your property?

Notice:

If you have answered yes to any of a.-c. above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.



The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report² for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid.
Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from*

ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant

2.5 ACCESSIBILITY

2.6 ENERGY REPORT

2.7 VALUATION AND CONVEYANCER ISSUES

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- Any additional assumption, or any found not to apply, is reported.

Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

DM Hall Offices

Aberdeen

01224 594172

Galashiels

01896 752009

Livingston

01506 490404

Ayr

01292 286974

Glasgow (North)

0141 332 8615

Musselburgh

0131 665 6782

Cumbernauld

01236 618900

Glasgow (South)

0141 636 4141

Oban

01631 564225

Cupar

01334 844826

Hamilton

01698 284939

Paisley

0141 887 7700

Dumfries

01387 254318

Inverness

01463 241077

Perth

01738 562100

Dundee

01382 873100

Inverurie

01467 624393

Peterhead

01779 470220

Dunfermline

01383 621262

Irvine

01294 311070

Stirling

01786 475785

Edinburgh

0131 477 6000

Kirkcaldy

01592 598200

Elgin

01343 548501

Falkirk

01324 628321

DMHALL.CO.UK



