



ALLIED
SURVEYORS
SCOTLAND

Home Report

48 Craigton Road
Aberdeen
AB15 7UR

Offices throughout Scotland
alliedsurveyorsscotland.com

Single Survey

survey report on:

Property address	48 Craigton Road, Aberdeen, AB15 7UR
-------------------------	--

Customer	Mr C Brazendale
-----------------	-----------------

Customer address	48 Craigton Road, Aberdeen, AB15 7UR
-------------------------	--

Prepared by	Allied Surveyors Scotland Ltd
--------------------	-------------------------------

Date of inspection	30th September 2026
---------------------------	---------------------



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;
- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;

Terms and Conditions

- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein

Terms and Conditions

the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form* unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a semi-detached house with accommodation over two floors.
Accommodation	Ground Floor: Entrance porch, hallway, lounge, dining room with kitchen off and cloakroom with WC and wash hand basin. First Floor: Landing, three bedrooms and bathroom.
Gross internal floor area (m²)	Approximately 94 square metres.
Neighbourhood and location	The subjects are located within a popular, established residential area of Aberdeen, approximately 2 miles west of the city centre. In our opinion, a satisfactory range of facilities and amenities is available nearby.
Age	Built circa 1938.
Weather	At the time of inspection, it was bright following spells of light rainfall. The report should be read in the context of these weather conditions.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. The front chimney stack serving the lounge is of pointed solid stone construction. The rear stack serving the dining room is of pointed blockwork construction. The junctions between the stacks and the roof are sealed with a combination of cement and lead flashings.

Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The main roof is of traditional pitched timber framed construction, clad with slates. A small dormer projection to the side has a mono-pitched roof which appears to be lead-covered. The flat roof over the front lounge bay window is also lead-covered. There are two dormer projections to the rear, one with a pitched roof and the other with a mono-pitched roof, both clad with slates. A limited head and shoulders inspection of the roof space was undertaken through a hatch in the first-floor landing ceiling. Insulation and stored items restricted visibility.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate. The rainwater fittings are predominantly formed in PVC, with some cast-iron fittings also noted.
Main walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main external walls appear to be of solid stone construction, pointed externally. The front gable apex is rendered and incorporates decorative timber framing. The rear elevation is predominantly finished in roughcast.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows are of mixed ages and comprise PVC and aluminium-framed double-glazed units, apart from the front porch, which has timber-framed single glazing. The front entrance door is of timber construction with single-glazed inserts. PVC-framed double-glazed patio doors provide access from the dining room to the rear garden.

Single Survey

External decorations	Visually inspected. Painted finishes.
Conservatories / porches	Visually inspected. A small entrance porch has been formed within the existing structure and is enclosed by timber-framed single glazing and a timber entrance door with single-glazed inserts.
Communal areas	Circulation areas visually inspected. None.
Garages and permanent outbuildings	Visually inspected. There is a detached single garage of blockwork construction beneath a pitched roof clad with profiled metal sheeting. A timber garden shed is also present.
Outside areas and boundaries	Visually inspected. There are garden areas to the front, side and rear. The front and side areas are predominantly paved to provide off-street parking. Boundaries are principally formed by stone walls, with sections of timber fencing and mature hedging.
Ceilings	Visually inspected from floor level. The ceilings are believed to be formed in a mixture of lath and plaster and plasterboard.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal wall linings are believed to comprise a mixture of lath and plaster and plasterboard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. The floors are of suspended timber construction. A limited inverted head and shoulders inspection of the sub-floor area was undertaken through a hatch in the ground floor cloakroom. Wool-type insulation was visible beneath the floor.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. The internal doors are of timber construction. Door frames and skirtings are of painted timber. The kitchen is fitted with an adequate range of base and wall-mounted cabinets and worktop surfaces.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out. A modern wood-burning stove is fitted within the lounge fireplace and is connected to the existing chimney flue. There is an open solid-fuel fireplace within the dining room.
Internal decorations	Visually inspected.
Cellars	None.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. The property is connected to mains electricity with the electrical apparatus located within the hallway cupboard.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. The property is supplied with mains gas, with the gas meter located within a low level under stair cupboard.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Water is supplied from the public mains. Visible internal pipework comprises copper supply pipes and PVC wastepipes. The bathroom contains a bath, shower enclosure, WC and wash hand basin. The ground floor cloakroom contains a further WC and


Single Survey

Water, plumbing, bathroom fittings	wash hand basin.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. Space heating and domestic hot water are provided by a gas-fired 'Baxi 400' condensing combination boiler located within a cupboard in the ground floor cloakroom. Heating is distributed through panel radiators fitted with thermostatic valves.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. Drainage is to the public sewer.
Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. There is now a requirement in place for compliant interlinked fire, smoke and heat detectors in residential properties. The new fire smoke and alarm standard came into force in Scotland in February 2022, requiring a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also requires to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon fuelled appliance such as a boiler, open fire or wood burner etc. a carbon monoxide detector is also required. The surveyor will only comment on the presence of a smoke detector etc. but will not test them, ascertain if they are in working order, interlinked and / or fully compliant with the fire and smoke alarm standard that was introduced in 2022. We have for the purposes of the report, assumed the system is fully compliant, if not then the appropriate compliant system will required to be installed prior to sale. This of course should be confirmed by your legal advisor. The property is fitted with smoke, heat and carbon monoxide detectors. A burglar alarm is also fitted.
Any additional limits to inspection	The property was fully furnished and had fitted floor coverings; therefore, no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. Internal cupboards were generally filled with storage items. No access was available beneath sanitary or kitchen fittings. The windows were not all tested. An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered invasive, and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no

Single Survey

Any additional limits to inspection	Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive. Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way. Inspection of the roof space was limited to a head and shoulders inspection from the landing hatch, with visibility restricted by insulation and stored items. Inspection of the sub-floor area was limited to the view available from the cloakroom hatch. Insulation restricted visibility of the covered timbers.
--	---

Sectional Diagram showing elements of a typical house

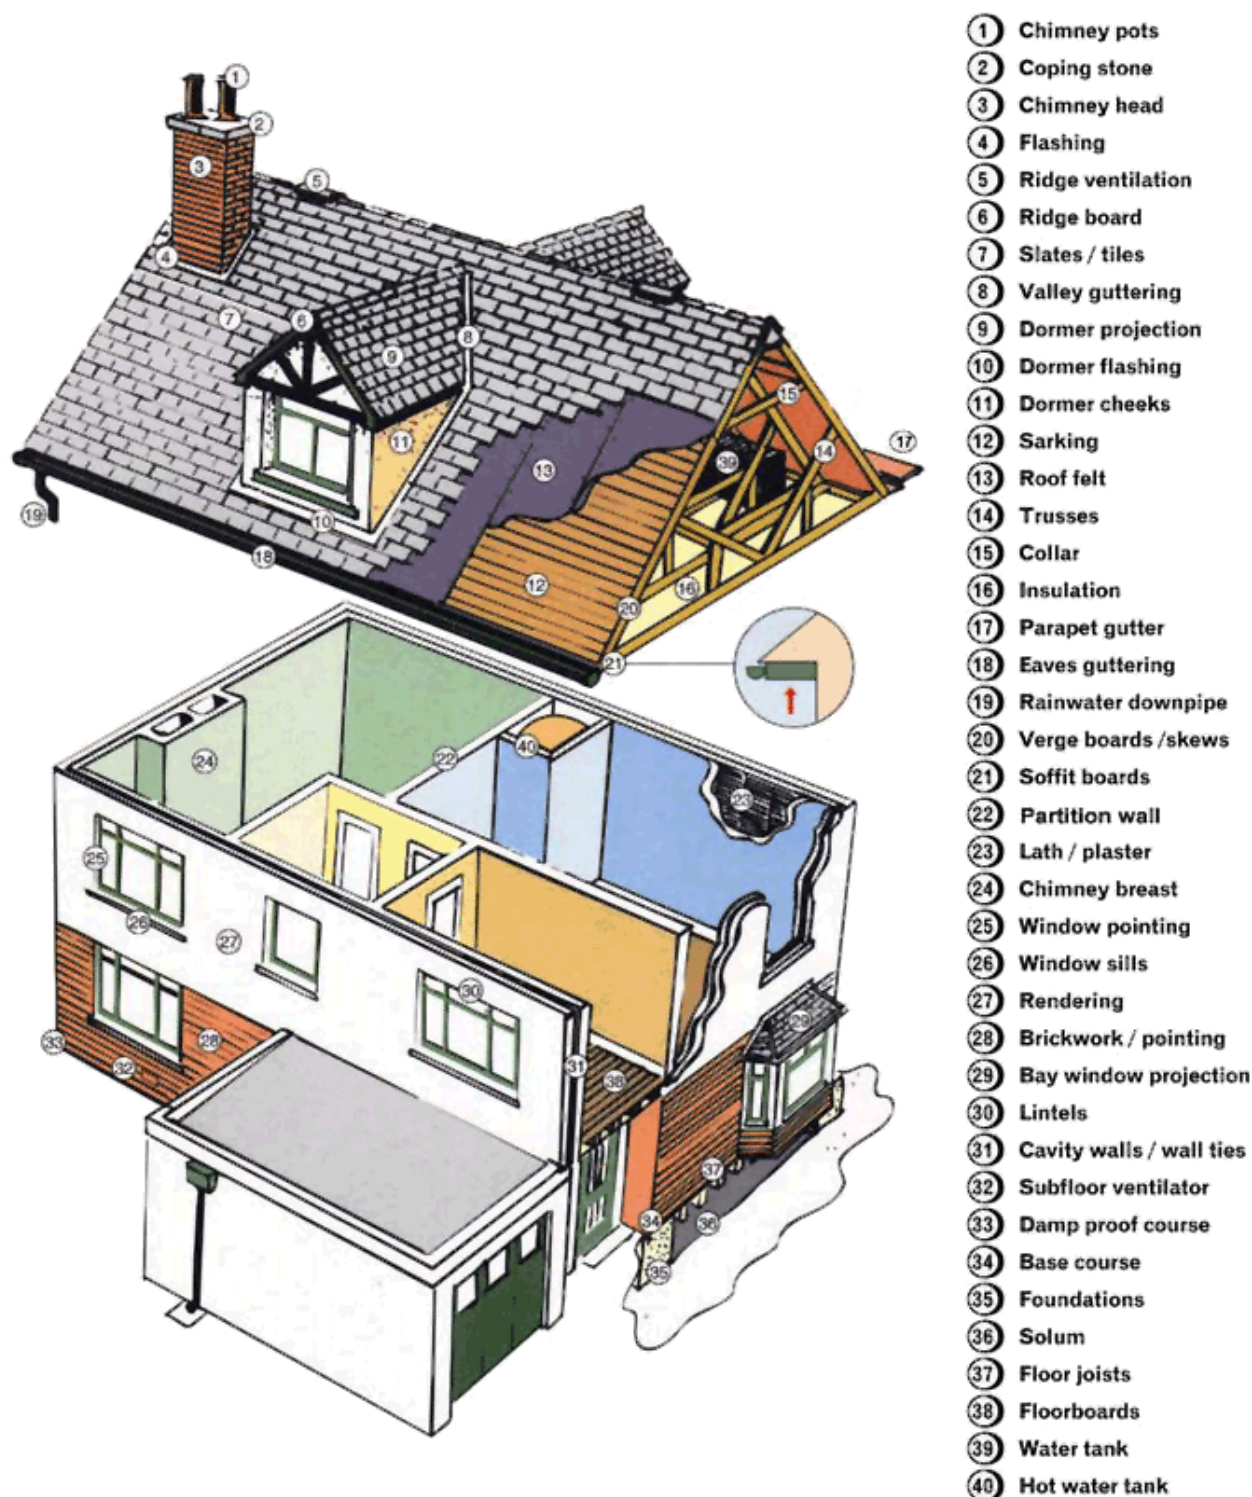

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

Single Survey

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.



Structural movement

Repair category	1
Notes	No evidence of significant structural movement was noted within the limitations of the inspection.



Dampness, rot and infestation

Repair category	1
Notes	We are advised that McKay Preservation inspected the property on 29 April 2024 and identified evidence of historic woodworm infestation within the roof space and understair cupboard, which they considered inactive. Wet rot was also reportedly identified in two load-bearing beams adjacent to the left-hand gable. We understand that remedial works were subsequently undertaken and are covered by a 30-year guarantee commencing on 20 May 2024. Any documentation in this regard should be made available.



Chimney stacks

Repair category	1
Notes	No significant defects were noted within the limitations of the inspection.



Roofing including roof space

Repair category	2
Notes	We are advised that roof repairs have recently been carried out, including replacement of ridge tiles and defective slates. Notwithstanding these works, a broken slate was noted, together with some chipped and loose slates. Natural slates have a lifespan which is dependent upon the type and quality of the slate. Over the long-term slates may deteriorate, their nail fixings may corrode, and the timber sarking boards may deteriorate particularly where exposed to penetrating moisture or condensation. Ongoing roof maintenance will be required, including keeping valley gutters clear of debris and monitoring the



Roofing including roof space

Repair category	2
Notes	condition of the roof slates, metal flashings/valleys, and roof cement work. Roofs are prone to water penetration during adverse weather, but it is not always possible for surveyors to identify this likelihood in good or dry weather. All roofs should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms. Flat roofs have a limited lifespan and should be regularly checked and maintained.



Rainwater fittings

Repair category	1
Notes	No adverse comments. The adequacy of the rainwater goods are best checked during periods of heavy rainfall.



Main walls

Repair category	1
Notes	Localised cracking was noted to a section of the mortar pointing.



Windows, external doors and joinery

Repair category	1
Notes	Windows were not all fully opened or tested, and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted.



External decorations

Repair category	1
Notes	No significant defects were noted. External timbers should be regularly maintained to prolong their lifespan.



Conservatories/porches

Repair category	1
Notes	Cracked floor tiles were noted at the porch entrance. No other significant defects were noted within the limitations of the inspection.



Communal areas

Repair category	-
Notes	Not applicable.



Garages and permanent outbuildings

Repair category	1
Notes	No significant defects were noted within the limitations of the inspection.



Outside areas and boundaries

Repair category	1
Notes	The outside areas appear adequately maintained. Localised weathering of mortar pointing was noted to sections of the stone boundary walls.



Ceilings

Repair category	1
Notes	Minor hairline cracking was noted to ceiling finishes.



Internal walls

Repair category	1
Notes	No significant defects were noted within the limitations of the inspection.



Floors including sub-floors

Repair category	1
Notes	Please refer to Dampness, Rot and Infestation regarding the reported wet rot repairs to load-bearing timbers. Documentation relating to the remedial works and installation of sub-floor insulation should be obtained. The insulation and restricted access limited inspection of the concealed timbers.



Internal joinery and kitchen fittings

Repair category	1
Notes	No significant defects were noted within the limitations of the inspection.



Chimney breasts and fireplaces

Repair category	-
Notes	We are advised that the flues serving both fireplaces have been swept and inspected and that the installations are in working order. Copies of any inspection and sweeping records should be obtained. The wood-burning stove is understood to have been installed recently. Installation and commissioning documentation, together with any necessary statutory approvals, should be obtained.



Internal decorations

Repair category	1
Notes	The standard of decoration is satisfactory.



Cellars

Repair category	-
Notes	Not applicable.



Electricity

Repair category	1
Notes	No significant defects were noted to the accessible parts of the installation. We are advised that electrical works have recently been carried out, including replacement of the former fuse box with a modern consumer unit. The relevant electrical installation certification should be obtained. It is recommended good practice that all electrical installations are periodically checked approximately every ten years or when a property changes hands. This should be regarded as a routine safety check and to ensure that the system complies with current regulatory requirements.



Gas

Repair category	1
Notes	No adverse comments. In the interests of safety and in light of recent regulations, it is recommended to have all gas appliances checked on an annual basis by a Gas Safe registered engineer. We are advised that all gas appliances have been checked as at the same time as the central heating boiler service, referred to in section 'Heating and hot water'. Any documentation in this regard should be made available.



Water, plumbing and bathroom fittings

Repair category	1
Notes	No adverse comments. Concealed areas around baths and shower trays cannot be inspected, however, water spillage over a period of time can result in unexpected defects to hidden parts of the building fabric. It is important the sealants are well maintained in order to prevent leakage.



Heating and hot water

Repair category	1
Notes	No significant defects were noted to the accessible parts of the installation. We are advised that the boiler is serviced annually, most recently in March 2026. The service record should be made available. It is assumed that the central heating system has been properly installed, maintained and updated in accordance with current regulations and standards, particularly with regard to flueing and ventilation requirements. Service records should be obtained and reviewed.



Drainage

Repair category	1
Notes	No indications of drainage defects were noted during the visual inspection.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	2
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	1
Communal areas	-
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground & First Floors	
2. Are there three steps or fewer to a main entrance door of the property?	Yes ☒	No ☐
3. Is there a lift to the main entrance door of the property?	Yes ☐	No ☒
4. Are all door openings greater than 750mm?	Yes ☐	No ☒
5. Is there a toilet on the same level as the living room and kitchen?	Yes ☒	No ☐
6. Is there a toilet on the same level as a bedroom?	Yes ☐	No ☒
7. Are all rooms on the same level with no internal steps or stairs?	Yes ☐	No ☒
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes ☒	No ☐

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Where items of maintenance or repair have been identified, the purchaser/s should satisfy themselves as to the costs and implications of these issues prior to making an offer to purchase.

Documentation relating to previous sub-floor treatment and insulation works should be made available.

The former understair cupboard has been converted into a cloakroom containing a WC and wash hand basin. French doors have also been formed in the rear dining room wall. We have assumed that all necessary planning permissions, building warrants and other statutory consents were obtained, together with completion certificates where required.

Estimated reinstatement cost for insurance purposes

£465,000 (Four Hundred and Sixty-Five Thousand Pounds)

Building costs are currently increasing significantly above inflation. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.

Valuation and market comments

£295,000 (Two Hundred and Ninety-Five Thousand Pounds)

The valuation fully reflects recent sales transactions and current market trends.

Signed

Security Print Code [435374 = 4597]
Electronically signed

Report author

Scott Melvin

Company name

Allied Surveyors Scotland Ltd

Address

Marywell House, 29-31 Marywell Street, Aberdeen, AB11 6JE

Date of report

6th October 2026

Mortgage Valuation Report



Property Address

Address 48 Craigton Road, Aberdeen, AB15 7UR
Seller's Name Mr C Brazendale
Date of Inspection 30th September 2026

Property Details

Property Type ☒ House ☐ Bungalow ☐ Chalet ☐ Purpose built maisonette
☐ Coach ☐ Studio ☐ Converted maisonette ☐ Purpose built flat
☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use ☐ Other (specify in General Remarks)

Property Style ☐ Detached ☒ Semi detached ☐ Mid terrace ☐ End terrace
☐ Back to back ☐ High rise block ☐ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?

☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? ☐ Yes ☐ No
No. of units in block

Approximate Year of Construction

Tenure

☒ Absolute Ownership ☐ Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) ☒ Yes ☐ No

Garage / Parking / Outbuildings

☒ Single garage ☐ Double garage ☒ Parking space ☐ No garage / garage space / parking space
Available on site? ☒ Yes ☐ No

Permanent outbuildings:

Single detached garage and garden shed.

Mortgage Valuation Report

Construction

Walls ☐ Brick ☒ Stone ☐ Concrete ☐ Timber frame
☐ Solid ☐ Cavity ☐ Steel frame ☐ Concrete block ☐ Other (specify in General Remarks)

Roof ☐ Tile ☒ Slate ☐ Asphalt ☐ Felt
☐ Lead ☐ Zinc ☐ Artificial slate ☐ Flat glass fibre ☐ Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? ☐ Yes ☒ No
If Yes, is this recent or progressive? ☐ Yes ☐ No
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No
If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage ☒ Mains ☐ Private ☐ None Water ☒ Mains ☐ Private ☐ None
Electricity ☒ Mains ☐ Private ☐ None Gas ☒ Mains ☐ Private ☐ None
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating:

Gas-fired radiator system.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☐ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections
☐ Agricultural land included with property ☐ Ill-defined boundaries ☐ Other (specify in General Remarks)

Location

☐ Residential suburb ☒ Residential within town / city ☐ Mixed residential / commercial ☐ Mainly commercial
☐ Commuter village ☐ Remote village ☐ Isolated rural property ☐ Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? ☒ Yes ☐ No

If Yes provide details in General Remarks.

Roads

☒ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☐ Adopted ☐ Unadopted

Mortgage Valuation Report

General Remarks

The subjects are located within a popular, established residential area of Aberdeen, approximately 2 miles west of the city centre. In our opinion, a satisfactory range of facilities and amenities is available nearby.

At the time of inspection, the property was found to be in a generally reasonable condition. Some routine maintenance/repair works are required.

Documentation relating to previous sub-floor treatment and insulation works should be made available.

The former understair cupboard has been converted into a cloakroom containing a WC and wash hand basin. French doors have also been formed in the rear dining room wall. We have assumed that all necessary planning permissions, building warrants and other statutory consents were obtained, together with completion certificates where required.

Essential Repairs

None.

Estimated cost of essential repairs £

Retention recommended? ☐ Yes ☒ No

Amount £

Mortgage Valuation Report

Comment on Mortgageability

In our opinion the subjects form suitable security for mortgage purposes, subject to any specific lending requirements of the chosen mortgage provider.

Valuations

Market value in present condition £ 295,000

Market value on completion of essential repairs £

Insurance reinstatement value £ 465,000
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? ☐ Yes ☒ No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? ☐ Yes ☐ No

Declaration

Signed Security Print Code [435374 = 4597]
Electronically signed by:-

Surveyor's name Scott Melvin

Professional qualifications AssocRICS

Company name Allied Surveyors Scotland Ltd

Address Marywell House, 29-31 Marywell Street, Aberdeen, AB11 6JE

Telephone 01224 571163

Fax

Report date 6th October 2026

Energy Performance Certificate (EPC)

Scotland

Dwellings

48 CRAIGTON ROAD, ABERDEEN, AB15 7UR

Dwelling type: Semi-detached house
Date of assessment: 30 September 2026
Date of certificate: 01 October 2026
Total floor area: 94 m²
Primary Energy Indicator: 212 kWh/m²/year

Reference number: 7502-1001-1201-5856-7204
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£3,903	See your recommendations report for more information
Over 3 years you could save*	£732	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

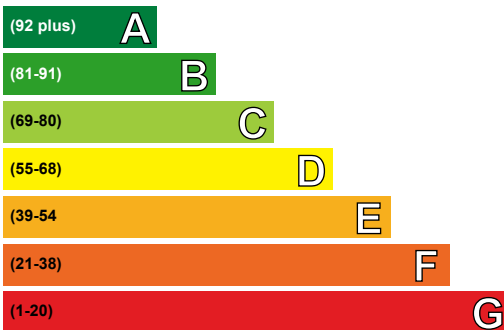

Not energy efficient - higher running costs

Current	Potential
71	81


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band C (71)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

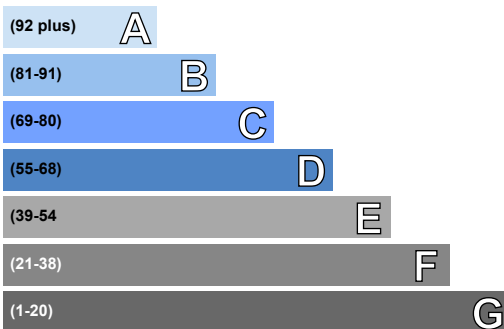

Not environmentally friendly - higher CO₂ emissions

Current	Potential
73	80

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (73)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Internal wall insulation	£7,500 - £11,000	£732.00
2 Solar photovoltaic (PV) panels	£8,000 - £10,000	£576.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction. See the addendum section on the last page of this report for further information relating to items in the table.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whin, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
Roof	Pitched, insulated (assumed) Roof room(s), ceiling insulated	★★★★☆ ★★★★☆	★★★★☆ ★★★★☆
Floor	Suspended, insulated	—	—
Windows	Fully double glazed	★★☆☆☆	★★☆☆☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	Room heaters, wood logs	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Good lighting efficiency	★★★★☆	★★★★☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 35 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.3 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£3,159 over 3 years	£2,427 over 3 years	
Hot water	£576 over 3 years	£576 over 3 years	
Lighting	£168 over 3 years	£168 over 3 years	
Totals	£3,903	£3,171	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Internal wall insulation	£7,500 - £11,000	£244		
2 Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£192		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Internal wall insulation

Internal wall insulation involves adding a layer of insulation to the inside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present:

- Biomass secondary heating

Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit <https://energysavingtrust.org.uk/energy-at-home> for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	12,111.32	N/A	N/A	N/A
Water heating (kWh per year)	2,562.18			

Addendum

When considering the PV installation consider installing PV battery and a PV diverter for water heating

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Scott Melvin
Assessor membership number:	EES/026998
Company name/trading name:	Allied Surveyors Scotland Ltd
Address:	Marywell House 29-31 Marywell Street Aberdeen AB11 6JE
Phone number:	01224 571163
Email address:	aberdeen@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit [greenerscotland.org](https://www.greenerscotland.org) or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



Property Questionnaire

PROPERTY ADDRESS:	48 CRAIGTON ROAD ABERDEEN AB15 7UR.
SELLER(S):	COLIN BRAZENDALE
COMPLETION DATE OF PROPERTY QUESTIONNAIRE:	30 SEPT 26

PROPERTY QUESTIONNAIRE

NOTE FOR SELLERS

- **Please complete this form carefully. It is important that your answers are correct.**
- **The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.**
- **If anything changes after you fill in this questionnaire but before the Date of Entry for the sale of your house, tell your solicitor or estate agent immediately.**

PROPERTY QUESTIONNAIRE

Information to be given to prospective buyer(s)

1. Length of ownership

How long have you owned the property? *SINCE MAY 2024.*

2. Council Tax

Which Council Tax band is your property in?

A

B

C

D

E

F

G

H

3. Parking

What are the arrangements for parking at your property?

(Please indicate all that apply)

- Garage ✓
- Allocated parking space
- Driveway ✓
- Shared parking
- On street ✓
- Resident permit
- Metered parking
- Other (please specify):

Also car access at rear of property

4. Conservation Area	
Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	Yes/No/ Don't know
5. Listed Buildings	
Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	Yes/No
6. Alterations / additions / extensions	
a. (i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)? <u>If you have answered yes, please describe the changes which you have made:</u> DOWNSTAIRS TOILET & HANDBASIN	Yes/No
(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes/No

If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.

If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent can arrange to obtain them.

b. Have you had replacement windows, doors, patio doors or double glazing installed in your property?

Yes/No

If you have answered yes, please answer the three questions below:

(i) Were the replacements the same shape and type as the ones you replaced?

Yes/No

(ii) Did this work involve any changes to the window or door openings?

Yes/No

(iii) Please describe the changes made to the windows doors, or patio doors (with approximate dates when the work was completed):

Replacement rear bedroom windows & frames

Please give any guarantees which you received for this work to your solicitor or estate agent.



7. Central heating		
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom). <u>If you have answered yes/partial – what kind of central heating is there?</u> (Examples: <u>gas-fired</u>, solid fuel, electric storage heating, gas warm air.) <u>If you have answered yes, please answer the 3 questions below:</u>	Yes/No/ Partial
b.	When was your central heating system or partial central heating system installed? 03/02/22	
c.	Do you have a maintenance contract for the central heating system? <u>If you have answered yes, please give details of the company with which you have a maintenance agreement:</u> <u>No</u> Maintenance Contract but yearly Services completed & Certificate available Last completed: 27/05/26	Yes/No
d.	When was your maintenance agreement last renewed? (Please provide the month and year). As above – <u>No</u> Agreement	

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Yes/No

9. Issues that may have affected your property

a. Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

Yes/No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

Yes/No

b. Are you aware of the existence of asbestos in your property?

Yes/No

If you have answered yes, please give details:

10. Services

a. Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas / liquid petroleum gas	✓	OCTOPUS
Water mains / private water supply	✓	COUNCIL
Electricity	✓	OCTOPUS
Mains drainage	✓	COUNCIL
Telephone	✓	NO LAND LINE PHONE CONNECTED.
Cable TV / satellite	X	

Broadband	✓	4 th UTILITY
-----------	---	-------------------------

b.	Is there a septic tank system at your property? <u>If you have answered yes</u>, please answer the two questions below:	Yes/No
c.	Do you have appropriate consents for the discharge from your septic tank?	Yes/No/Don't Know
d.	Do you have a maintenance contract for your septic tank? <u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:	Yes/No

11. Responsibilities for Shared or Common Areas

a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? <u>If you have answered yes</u>, please give details:	Yes/No/Don't Know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? <u>If you have answered yes</u>, please give details:	Yes/No/Not applicable

c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property? NOT "MAJOR" but several repairs & replacement tiles completed.	Yes/No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries? <u>If you have answered yes, please give details:</u>	Yes/No
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? <u>If you have answered yes, please give details:</u>	Yes/No
f.	As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned.) <u>If you have answered yes, please give details:</u>	Yes/No
12. Charges associated with your property		
a.	Is there a factor or property manager for your property? <u>If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:</u>	Yes/No

b.	Is there a common buildings insurance policy?	Yes/No/Don't know
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes/No/Don't know
c.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Residents' Association, or maintenance or stair fund. n/a.	
13. Specialist Works		
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property? If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property UNDERFLOOR BEAMS REPAIRED & PROTECTED by specialist Contractor - Certificate & guarantee available May 2024.	Yes/No
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? By previous owner	Yes/No

	<u>If you have answered yes, please give details</u> See answers previously	
c.	<u>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</u> <u>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</u> Guarantees are held by: SELF : GWIN BRAZENDALE	Yes/No

14. Guarantees

a.	Are there any guarantees or warranties for any of the following:					
(i)	Electrical work	☒ No	☐ Yes	☐ Don't Know	With title deeds	Lost
(ii)	Roofing	☒ No	☐ Yes	☐ Don't Know	With title deeds	Lost
(iii)	Central heating	☐ No	☒ Yes	☐ Don't know	☒ With title deeds	Lost
(iv)	NHBC	☒ No	☐ Yes	☐ Don't know	With title deeds	Lost
(v)	Damp course	☒ No	☐ Yes	☐ Don't know	With title deeds	Lost

(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	☒ No	☐ Yes	☐ Don't know	☐ With title deeds	☐ Lost
b.	<u>If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</u> ① Underfloor beams repaired . ② Rear bedroom windows replaced .					
c.	Are there any outstanding claims under any of the guarantees listed above? <u>If you have answered yes, please give details:</u>					☒ Yes/No
15. Boundaries						
So far as you are aware, has any boundary of your property been moved in the last 10 years? <u>If you have answered yes, please give details:</u>						☒ Yes/No/ Don't Know

16. Notices that affect your property

In the past 3 years have you ever received a notice:

a.	advising that the owner of a neighbouring property has made a planning application?	Yes/No/ Don't know
b.	that affects your property in some other way?	Yes/No/ Don't know
c.	that requires you to do any maintenance, repairs or improvements to your property?	Yes/No/ Don't know

If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

Declaration by the seller(s)/or other authorised body or person(s):

I / We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s) :



.....

.....

Date: 30 Sept 26