

Single Survey

survey report on:

Property address	3F Herald Way, Renfrew, PA4 0LR
-------------------------	---------------------------------------

Customer	Mr J Calton
-----------------	-------------

Customer address	3F Herald Way, Renfrew, PA4 0LR
-------------------------	---------------------------------------

Prepared by	Harvey Donaldson And Gibson
--------------------	-----------------------------

Date of inspection	2nd July 2020
---------------------------	---------------



HARVEY
DONALDSON
& GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Seller's Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The ultimate holding company of Harvey Donaldson & Gibson is Countrywide plc. In Scotland, Countrywide plc also own Slater Hogg & Howison and Countrywide North. A full list of estate agents owned or under franchise to Countrywide plc is available on request. Harvey Donaldson & Gibson trades as an entirely separate company and has no financial interest whatsoever in the disposal of the property being inspected.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Codes of Conduct.

Terms and Conditions

Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information

Terms and Conditions

contained in the Report and the generic Mortgage Valuation Report.²

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the Surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.1 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

Terms and Conditions

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.*

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be

researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the Report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

Terms and Conditions

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion.* In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" *is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated.* This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise an ex local authority, purpose built top floor flat in a three storey block containing six flats in total.
Accommodation	2nd floor – three bedrooms, kitchen, bathroom and living room.
Gross internal floor area (m²)	69m ² or thereby.
Neighbourhood and location	The property is located within an area of similar quality properties within reasonable distance of the usual local amenities.
Age	54 years or thereby.
Weather	Wet preceded by a period of mixed weather.
Chimney stacks	N/A.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is pitched, timber supported and clad externally in concrete interlocking tiles. The roof sections over the bin store and stair are flat and clad in mineral felt.

Rainwater fittings	Visually inspected with the aid of binoculars where appropriate. Rainwater discharge is via uPVC gutters and downpipes.
Main walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls of the property are assumed to be of traditional cavity brick construction.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows and front door are Upvc double glazed plastic. The fascias are timber and the soffits are asbestos cement.
External decorations	Visually inspected. uPVC materials are self coloured. External surfaces are painted where applicable.
Conservatories / porches	N/A.
Communal areas	Circulation areas visually inspected. There is a shared entrance and staircase giving access to all floors. There are shared grounds and a shared bin store area.
Garages and permanent outbuildings	N/A.
Outside areas and boundaries	Visually inspected. There are communal grounds to the rear. It should be verified if the property has one of the external store areas on the ground floor, these were locked at the time of inspection and could not be accessed.
Ceilings	Visually inspected from floor level. The ceilings are plasterboard.

Single Survey


Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. The internal walls are a mix of solid plastered masonry construction and timber framed, lined with plasterboard.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. Flooring throughout the property is of suspended timber design with fully fitted floor coverings.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. Internal joinery comprises timber skirtings, doors and door surrounds. Kitchen fittings comprise a range of wall and base units and work surfaces.
Chimney breasts and fireplaces	N/A.
Internal decorations	Visually inspected. Papered and painted walls and ceilings, and painted woodwork.
Cellars	N/A.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. A mains supply of electricity is connected to the property, the electric meter and circuit breaker consumer unit are located in the hall cupboard. Wiring, where visible, is sheathed in uPVC. There is a pay as you go type meter.

Single Survey

Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. A mains supply of gas is connected, the gas meter is located under the kitchen sink.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Cold water is from the mains supply and via the cold water storage tank located in the loft. Visible plumbing comprises copper and uPVC supply pipework. The bathroom contains a bath with shower overhead, wash hand basin and WC.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. The property is centrally heated by means of a gas fired system, comprising a combination boiler located in the kitchen. Heating to the rooms is provided by water filled radiators. The system is of a type designed to provide instantaneous hot water upon demand.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested. Mains drainage is understood to be connected.
Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. Smoke detection has been installed (not tested).

Any additional limits to inspection	For flats / maisonettes Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. The property was inspected within the limits imposed by occupation which included, throughout, closely nailed and fixed fitted carpeting, floor coverings, stored items, furnishings etc. Personal belongings were not removed from cupboards. It will be appreciated that parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect. Leakage, etc within roof spaces and associated areas are sometimes only visible during, or immediately after, adverse weather conditions. The roof space inspection was restricted due to the presence of stored items and insulation material laid between and over the ceiling joists. The roof slopes could not be fully inspected from ground level due to the elevation and site restrictions. Floor coverings restricted the inspection of flooring. Not all windows were tested. Concealed areas below sanitary fittings are not inspected. Where timbers are built into walls or otherwise concealed they cannot be inspected.
--	--

Sectional Diagram showing elements of a typical house

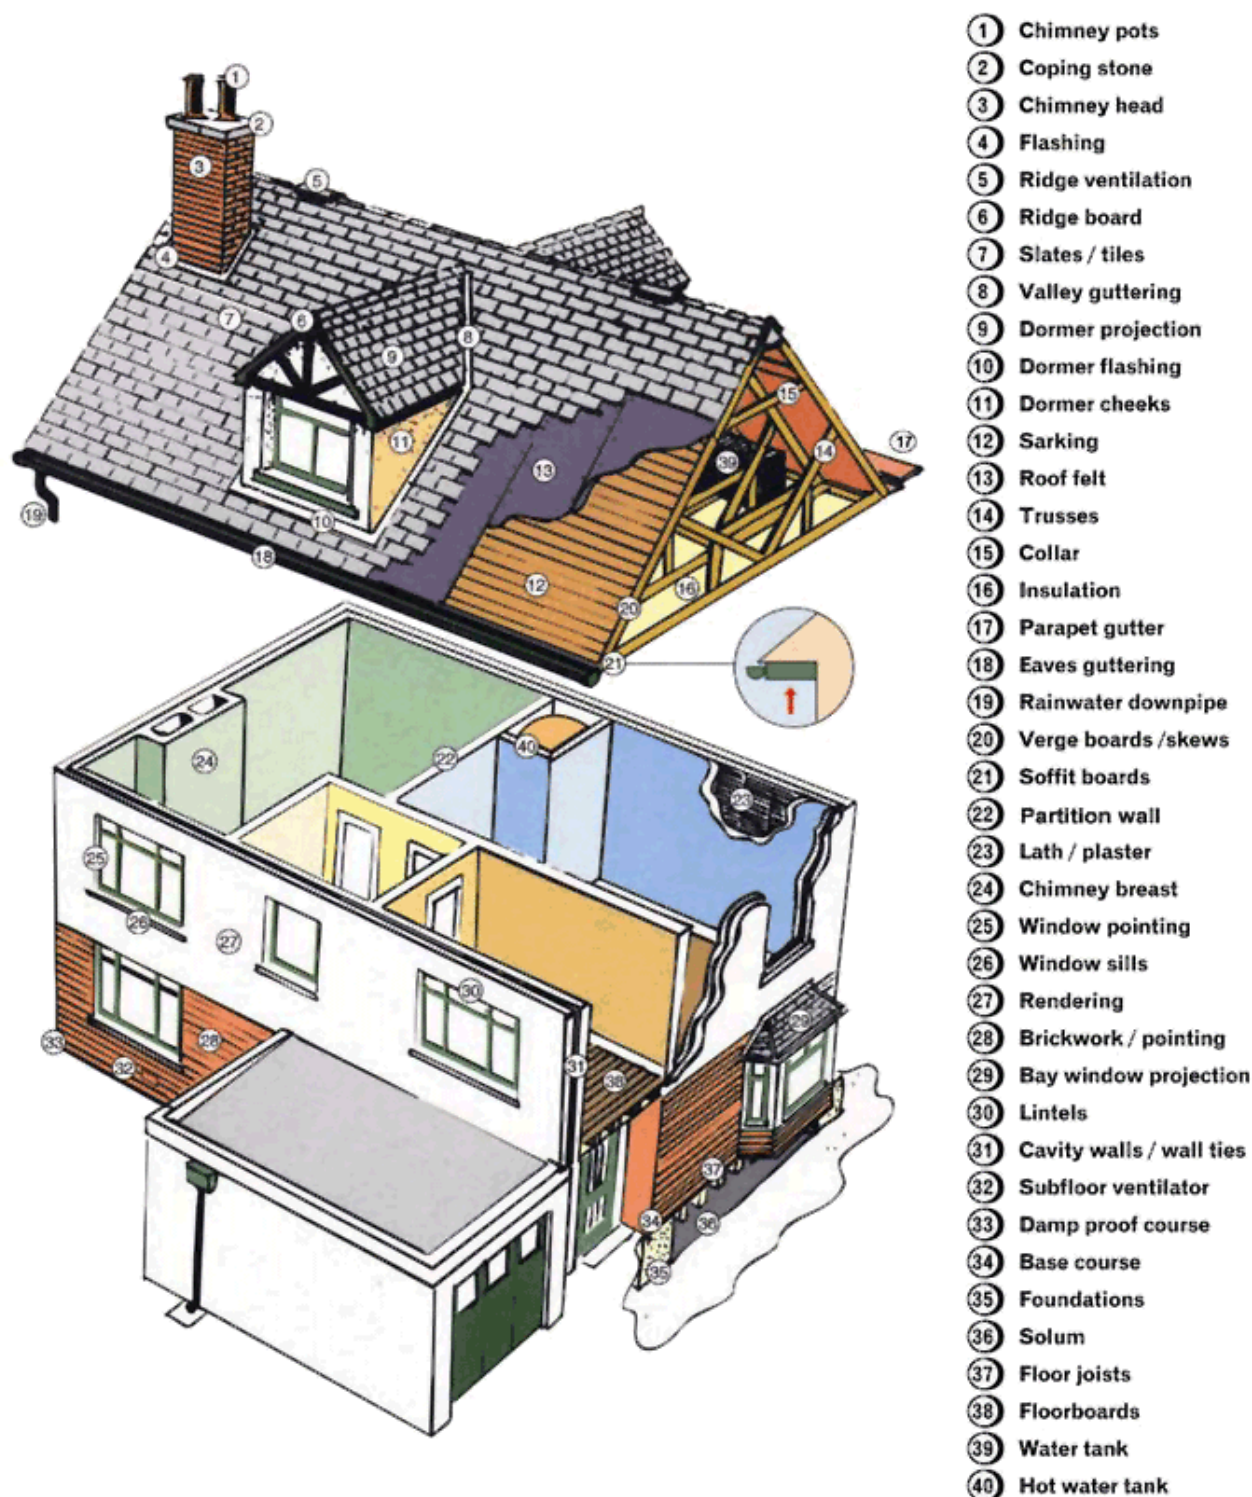

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

Single Survey

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.



Structural movement

Repair category	1
Notes	No obvious significant structural movement noted, on the basis of a single inspection.



Dampness, rot and infestation

Repair category	1
Notes	At the time of the original inspection a damp smell was noted in the bathroom and an area of damp staining was noted to the ceiling in the hall. When tested with an electronic moisture meter higher than normal levels of dampness were recorded. This should be further investigated by a suitably qualified person as prolonged dampness increases the risk of timber defects within concealed areas of the building fabric. UPDATED 20/09/2019: it is understood that the vendor has had a number of roof tiles replaced to address the above.



Chimney stacks

Repair category	-
Notes	N/A.



Roofing including roof space

Repair category	2
Notes	The roof coverings are ageing. The manufacturers of modern roof tiles expect that a roof tile will normally last for approximately 50 years. This should be taken into consideration having regard to the age of this property. Cracking and deterioration was noted to verge pointing. The roof slopes could not be fully inspected from ground level due to the elevation and site restrictions. Flat roofed sections could not be seen from ground level, these are ageing and will require careful ongoing maintenance. UPDATED 20/09/2019: it is understood that the vendor has had a number of roof tiles replaced.



Rainwater fittings

Repair category	2
Notes	Gutters are choked with vegetation growth which will restrict free drainage. A missing end piece was noted to one of the gutters. A leaking section was noted at the rear.



Main walls

Repair category	1
Notes	No obvious significant defects were noted to accessible wall surfaces.



Windows, external doors and joinery

Repair category	1
Notes	No obvious significant defects were noted to windows or doors, however the windows are ageing and will not be as efficient as modern equivalents. The soffits are asbestos cement, this is not considered a health hazard provided it is not disturbed. Appropriate advice and precautions should be taken if removal is planned.



External decorations

Repair category	2
Notes	Weathering/peeling paintwork was noted to external finishes.



Conservatories/porches

Repair category	-
Notes	N/A.



Communal areas

Repair category	3
Notes	Extensively decayed timbers were noted to the close windows. This will need to be addressed in the short term. The flat roof sections are ageing. Where visible some water ponding was noted and signs of damp and water ingress are evident. Cracked glass was noted to some of the glazed panels. Boundary fencing is damaged.



Garages and permanent outbuildings

Repair category	-
Notes	N/A.



Outside areas and boundaries

Repair category	1
Notes	See comments under 'Communal areas' section. There is a tree growing within potential influencing distance of the property. The growth of such should be controlled to prevent future root/storm damage.



Ceilings

Repair category	1
Notes	No obvious significant defects noted, however see comments under 'Dampness' section.



Internal walls

Repair category	1
Notes	No obvious significant defects were noted to internal walls and partitions, within the limitations imposed on the inspection.



Floors including sub-floors

Repair category	1
Notes	The floors are creaky in places.



Internal joinery and kitchen fittings

Repair category	1
Notes	No obvious significant defects were noted to internal joinery or kitchen fittings.



Chimney breasts and fireplaces

Repair category	-
Notes	N/A.



Internal decorations

Repair category	1
Notes	No obvious significant defects were noted to the internal decorations.



Cellars

Repair category	-
Notes	N/A.



Electricity

Repair category	1
Notes	No obvious significant defects were noted to the electrical installation. It is recommended good practice that all electrical installations should be checked periodically, approximately every five years or when a property changes hands. This should be regarded as a routine safety and maintenance check. It should be appreciated that only the most recently re-wired or constructed properties will comply with current regulations.



Gas

Repair category	1
Notes	No obvious significant defects noted. The gas meter and supply should be checked on an annual basis.



Water, plumbing and bathroom fittings

Repair category	1
Notes	No obvious significant defects noted to accessible plumbing or sanitary fittings. There is a galvanised cold water tank in the loft. This appears to still be in use and its remaining life span will be limited. Galvanised cold water tanks can be prone to sudden failure.



Heating and hot water

Repair category	1
Notes	No obvious significant defects were noted to the heating system or hot water system, although these have not been tested. It is recommended good practice that gas boilers are serviced on an annual basis by an appropriately qualified person. The boiler's service history should be checked by referring to the service records. If there is no record of a recent service, the boiler should be checked by an appropriately qualified person.



Drainage

Repair category	1
Notes	No obvious significant defects were noted to the drainage system, within the limitations of the inspection.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	2
Rainwater fittings	2
Main walls	1
Windows, external doors and joinery	1
External decorations	2
Conservatories/porches	-
Communal areas	3
Garages and permanent outbuildings	-
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Second Floor	
2. Are there three steps or fewer to a main entrance door of the property?	Yes ☐	No ☒
3. Is there a lift to the main entrance door of the property?	Yes ☐	No ☒
4. Are all door openings greater than 750mm?	Yes ☐	No ☒
5. Is there a toilet on the same level as the living room and kitchen?	Yes ☒	No ☐
6. Is there a toilet on the same level as a bedroom?	Yes ☒	No ☐
7. Are all rooms on the same level with no internal steps or stairs?	Yes ☒	No ☐
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes ☒	No ☐

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

The tenure is understood to be Outright Ownership.

In line with our normal practice, it is specifically assumed that the property and its value are unaffected by any matters which would or should be revealed to a competent Completing Solicitor by a local search and replies to the usual enquiries, or by any statutory notice and planning proposal.

The property is situated in an area of past mining activity. The conveyancer should obtain a mining report from The Coal Authority to provide information as to historical and future mining activity and whether the property has been the subject of any compensation claims, ensuring that the property is not adversely affected. The valuation assumes the content will reveal nothing adverse.

Estimated reinstatement cost for insurance purposes

£112,000 (one hundred and twelve thousand pounds sterling).

The re-building cost for insurance purposes is for the subject property only and is given solely as a guide, as it is assumed the building as a whole is insured under a single policy.

Valuation and market comments

In its present condition the opinion of valuation for the Outright Ownership interest with vacant possession on 02nd July, 2020 is £80,000 (eighty thousand pounds sterling).

This is a replacement single survey and valuation. The original was undertaken on 03rd September, 2019.

Property market activity has been impacted due to the current response to Covid-19. This has resulted in an unprecedented set of circumstances on which to make a valuation judgement. The advice is therefore reported on the basis of "material valuation uncertainty" as per the RICS Red Book Global definition. Consequently, less certainty can be attached to the valuation than would otherwise be the case. It is recommended that the valuation of this property is kept under frequent review as more market evidence becomes available.

Signed

Security Print Code [501064 = 4135]
Electronically signed

Report author

J R ANNAN

Company name

Harvey Donaldson And Gibson

Address

Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH

Single Survey

Date of report	6th July 2020
-----------------------	---------------

Mortgage Valuation Report



HARVEY
DONALDSON
& GIBSON

CHARTERED SURVEYORS

Parent to HomeReportScotland.scot

Property Address

Address 3F Herald Way, Renfrew, PA4 0LR
Seller's Name Mr J Calton
Date of Inspection 2nd July 2020

Property Details

Property Type ☐ House ☐ Bungalow ☐ Purpose built maisonette ☐ Converted maisonette
☒ Purpose built flat ☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use
☐ Other (specify in General Remarks)

Property Style ☐ Detached ☐ Semi detached ☐ Mid terrace ☐ End terrace
☐ Back to back ☐ High rise block ☒ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?

☒ Yes ☐ No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? ☐ Yes ☒ No
No. of units in block

Approximate Year of Construction

Tenure

☒ Absolute Ownership ☐ Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) ☒ Yes ☐ No

Garage / Parking / Outbuildings

☐ Single garage ☐ Double garage ☐ Parking space ☒ No garage / garage space / parking space
Available on site? ☐ Yes ☐ No

Permanent outbuildings:

None.

Mortgage Valuation Report

Construction

Walls ☒ Brick ☐ Stone ☐ Concrete ☐ Timber frame ☐ Other (specify in General Remarks)
Roof ☒ Tile ☐ Slate ☐ Asphalt ☐ Felt ☐ Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? ☐ Yes ☒ No

If Yes, is this recent or progressive? ☐ Yes ☐ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

Service Connection

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage ☒ Mains ☐ Private ☐ None Water ☒ Mains ☐ Private ☐ None
Electricity ☒ Mains ☐ Private ☐ None Gas ☒ Mains ☐ Private ☐ None
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating:

Full gas with radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☐ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections
☐ Ill-defined boundaries ☐ Agricultural land included with property ☐ Other (specify in General Remarks)

Location

☐ Residential suburb ☒ Residential within town / city ☐ Mixed residential / commercial ☐ Mainly commercial
☐ Commuter village ☐ Remote village ☐ Isolated rural property ☐ Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? ☐ Yes ☒ No

If Yes provide details in General Remarks.

Roads

☒ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☐ Adopted ☐ Unadopted

Mortgage Valuation Report

General Remarks

The subjects comprise an ex local authority, purpose built top floor flat in a three storey block containing six flats in total.

The property is located within an area of similar quality properties within reasonable distance of the usual local amenities.

The general condition of the property appears consistent with its age and type of construction, however some works of repair, maintenance and upgrading are required.

The property is situated in an area of past mining activity. The conveyancer should obtain a mining report from The Coal Authority to provide information as to historical and future mining activity and whether the property has been the subject of any compensation claims, ensuring that the property is not adversely affected. The valuation assumes the content will reveal nothing adverse.

Property market activity has been impacted due to the current response to Covid-19. This has resulted in an unprecedented set of circumstances on which to make a valuation judgement. The advice is therefore reported on the basis of "material valuation uncertainty" as per the RICS Red Book Global definition. Consequently, less certainty can be attached to the valuation than would otherwise be the case. It is recommended that the valuation of this property is kept under frequent review as more market evidence becomes available.

Essential Repairs

None.

Estimated cost of essential repairs £

Retention recommended? ☐ Yes ☒ No

Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property affords adequate security for loan purposes based on the valuation figure.

Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? ☐ Yes ☒ No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? ☐ Yes ☐ No

Declaration

Signed Security Print Code [501064 = 4135]
Electronically signed by:-

Surveyor's name J R ANNAN

Professional qualifications MRICS

Company name Harvey Donaldson And Gibson

Address Suite 3/7 Standard Buildings, 94 Hope Street, Glasgow, G2 6PH

Telephone 0141 204 0808

Fax 0203 880 9193

Report date 6th July 2020