

HOME REPORT



DM HALL
CHARTERED SURVEYORS

Home Report

Property: **42
Kirk Street
Alloa
Clackmannanshire
FK10 4PT**

Prepared for: **Mhari Thomson**

Prepared by: **Gordon McCulloch**

Report reference: **839254-1-2**

Date of Report: **09/02/2021**

ENERGY PERFORMANCE CERTIFICATE



DM HALL
CHARTERED SURVEYORS

Energy Performance Certificate (EPC)

Scotland

Dwellings

42 KIRK STREET, KINCARDINE, ALLOA, FK10 4PT

Dwelling type: Top-floor flat
Date of assessment: 18 October 2019
Date of certificate: 21 October 2019
Total floor area: 87 m²
Primary Energy Indicator: 265 kWh/m²/year

Reference number: 9150-2848-2100-9591-7925
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas


You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO₂ emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,709	See your recommendations report for more information
Over 3 years you could save*	£1,107	

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

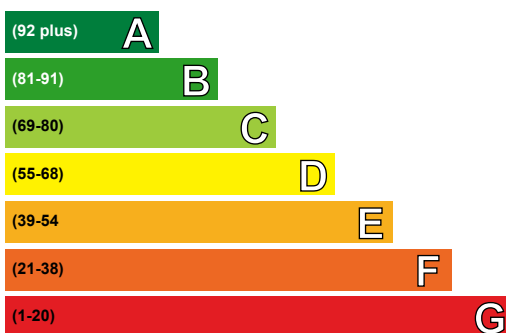

Not energy efficient - higher running costs

Current	Potential
65	78

Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (65)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions



Not environmentally friendly - higher CO₂ emissions

Current	Potential
60	79

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band D (60)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Increase loft insulation to 270 mm	£100 - £350	£117.00
2 Flat roof or sloping ceiling insulation	£850 - £1,500	£117.00
3 Internal or external wall insulation	£4,000 - £14,000	£696.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Sandstone or limestone, as built, no insulation (assumed)	★★☆☆☆	★★☆☆☆
	Solid brick, as built, no insulation (assumed)	★☆☆☆☆	★☆☆☆☆
Roof	Pitched, 100 mm loft insulation	★★★★☆☆	★★★★☆☆
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★★★☆☆	★★★★☆☆
Main heating	Boiler and radiators, mains gas	★★★★★☆☆	★★★★★☆☆
Main heating controls	Programmer, TRVs and bypass	★★★★☆☆☆	★★★★☆☆☆
Secondary heating	None	—	—
Hot water	From main system	★★★★★☆☆	★★★★★☆☆
Lighting	No low energy lighting	★☆☆☆☆	★☆☆☆☆

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 47 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.0 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,001 over 3 years	£1,095 over 3 years	
Hot water	£297 over 3 years	£300 over 3 years	
Lighting	£411 over 3 years	£207 over 3 years	
Totals	£2,709	£1,602	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement	
			Energy	Environment
1 Increase loft insulation to 270 mm	£100 - £350	£39		
2 Flat roof or sloping ceiling insulation	£850 - £1,500	£39		
3 Internal or external wall insulation	£4,000 - £14,000	£232		
4 Low energy lighting for all fixed outlets	£30	£60		

Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.

About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

1 Loft insulation

Loft insulation laid in the loft space or between roof rafters to a depth of at least 270 mm will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation should not be placed below any cold water storage tank, any such tank should also be insulated on its sides and top, and there should be boarding on battens over the insulation to provide safe access between the loft hatch and the cold water tank. The insulation can be installed by professional contractors but also by a capable DIY enthusiast. Loose granules may be used instead of insulation quilt; this form of loft insulation can be blown into place and can be useful where access is difficult. The loft space must have adequate ventilation to prevent dampness; seek advice about this if unsure. Further information about loft insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk).

2 Flat roof or sloping ceiling insulation

Insulating a flat roof or sloping ceiling will significantly reduce heat loss through the roof; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulation can be placed on top of the roof under the waterproof membrane and should particularly be considered when the waterproofing needs to be replaced. Further information about roof insulation and details of local contractors can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). Building regulations generally apply to this work so it is best to check with your local authority building standards department.

3 Internal or external wall insulation

Internal or external wall insulation involves adding a layer of insulation to either the inside or the outside surface of the external walls, which reduces heat loss and lowers fuel bills. As it is more expensive than cavity wall insulation it is only recommended for walls without a cavity, or where for technical reasons a cavity cannot be filled. Internal insulation, known as dry-lining, is where a layer of insulation is fixed to the inside surface of external walls; this type of insulation is best applied when rooms require redecorating. External solid wall insulation is the application of an insulant and a weather-protective finish to the outside of the wall. This may improve the look of the home, particularly where existing brickwork or rendering is poor, and will provide long-lasting weather protection. Further information can be obtained from the National Insulation Association (www.nationalinsulationassociation.org.uk). It should be noted that a building warrant is required for the installation of external wall insulation. Planning permission may also be required and that building regulations apply to external insulation so it is best to check with your local authority on both issues.

4 Low energy lighting

Replacement of traditional light bulbs with energy saving bulbs will reduce lighting costs over the lifetime of the bulb, and they last many times longer than ordinary light bulbs. Low energy lamps and fittings are now commonplace and readily available. Information on energy efficiency lighting can be found from a wide range of organisations, including the Energy Saving Trust (<http://www.energysavingtrust.org.uk/home-energy-efficiency/lighting>).

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	11,797	(851)	N/A	(4,899)
Water heating (kWh per year)	2,164			

Addendum

This dwelling has stone walls and so requires further investigation to establish whether these walls are of cavity construction and to determine which type of wall insulation is best suited.

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Duncan Grant
Assessor membership number:	EES/019355
Company name/trading name:	D M Hall Chartered Surveyors LLP
Address:	Unit 6A The Courtyard Callendar Business Park Falkirk FK1 1XR
Phone number:	01324 628321
Email address:	enquiries@dmhall.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerScotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT



SINGLE SURVEY



DM HALL
CHARTERED SURVEYORS

Schedule 1

Survey Report

42

Kirk Street

Alloa

Clackmannanshire

FK10 4PT

Customer

Mhari Thomson

Date of Inspection

09/02/2021

Prepared by

Gordon McCulloch

1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subjects comprise a first floor flat within a two storey end terraced converted building.
Accommodation	On ground floor: Entrance hall and stairs. On first floor: Upper hall, Lounge, Three bedrooms, Kitchen and bathroom.
Gross internal floor area (m^2)	87m ² or thereby.
Neighbourhood and location	The property is contained within an established residential area of mixed style properties, and situated within reasonable distance of local amenities.
Age	120 years approximately.
Weather	The weather was dry and clear following heavy snowfall in the preceding days and fairly mixed weather conditions over the past fortnight.
Chimney stacks	Visually inspected with the aid of binoculars where appropriate. The chimneystacks are of traditional pointed sandstone construction.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof is of traditional pitched design in the main and clad externally in slate whilst there is a flat section at the rear which appears to be covered with lead or zinc.

	Roof space: The main roof space was inspected from the hatchway to the hallway ceiling. Insulation material has been laid between ceiling joists and some stored goods were present around the hatch itself.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate. Gutters and downpipes are principally of traditional cast iron materials although some pvc sections are present.
Main walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main external walls are of traditional solid stone construction, externally pointed with a rendered brick built projection to the rear.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Windows are of uPVC framed and double glazed design. There is a uPVC/composite entrance door at ground floor level and a further timber flush panelled external door from the entrance hall to the rear garden. There are elements of timber fascias on the rear projection.
External decorations	Visually inspected. Painted finish has been applied to cast rainwater fittings and external joinery in the past.
Conservatories/Porches	None
Communal areas	Circulation areas visually inspected. The main external building fabric is presumed to be a communal responsibility and will include items such as roof claddings, rainwater fittings, external masonry and external joinery. There are areas of garden ground to the rear which are assumed to be communal.

	The exact extent of liability for upkeep of the building fabric and extent of grounds can be further verified by reference to Title Deed documentation.
Garages and permanent outbuildings	Visually inspected. There is a brick and slate outbuilding to the rear although no internal access was taken to this.
Outside areas and boundaries	Visually inspected. There are areas of ground to the rear of the property which are believed to be communal in nature. Boundaries are formed in a mixture of timber fencing and stone walls, whilst some elements are obscured by ivy and vegetation.
Ceilings	Visually inspected from floor level. The ceilings within the property are a mixture of lath and plaster materials, timber panelling and elements of plasterboard. There are areas of artex/textured finish also applied.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Internal walls are a combination of lath and plaster and plaster on the hard. Whilst again some plasterboard materials may well have been utilised.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch. Flooring is of solid composition within the entrance hall at ground floor level and suspended timber to the upper floor. No access gained to subfloor areas as there is another property beneath.

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. Internal skirtings, facings etc are of timber materials whilst internal doors are generally of timber panelled design. The kitchen has a range of fitted floor and wall mounted units.
Chimney breasts and fireplaces	None - removed.
Internal decorations	Visually inspected. Papered/painted finish has been applied in the main.
Cellars	None
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply. The fusebox and electric meter are contained within a wall press in the lounge.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. Mains supply. The gas meter is also located in the wall press in the lounge.
Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Mains supply. Plumbers piping is in copper and pvc materials. Internal sanitary ware comprises a w.c wash hand basin and bath with shower fitted over. There are some discarded/redundant elements of plumbing

	within the roof space.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. There is a gas fired boiler within a bedroom cupboard which serves a range of radiators throughout the accommodation and also provides domestic hot water.
Drainage	Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested. Drainage is connected to the main public sewer.
Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. Smoke alarms are present in the property.
Any additional limits to inspection	For flats / maisonettes Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. At the time of inspection the property was fully furnished, occupied and flooring was covered throughout. No access gained to subfloor areas as there is another flat beneath. My inspection of the roof space was extremely restricted to a view from the hatchway area only. Stored goods and items were present in the loft which further restricted my

inspection.

Personal effects in cupboards and fitted wardrobes were not moved and restricted my inspection.

The report does not include an asbestos inspection.
However

asbestos was widely used in the building industry until around

2000, when it became a banned substance. If the possibility of

asbestos based products has been reported within the limitations of

the inspection and you have concerns you should engage a qualified asbestos surveyor.

Parts of the property, which are covered, unexposed or inaccessible, cannot be guaranteed to be free from defect.

I have not carried out an inspection for Japanese Knotweed and

unless otherwise stated, for the purposes of the valuation I have

assumed that there is no Japanese Knotweed or other invasive

plants within the boundaries of the property or in neighbouring

properties.

Random testing for dampness was undertaken internally with the

use of a moisture meter where accessible and considered appropriate.

--	--

▷ Sectional diagram showing elements of a typical house:



Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these terms.

2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories.

Category 3	Category 2	Category 1
Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement

Repair category:	1
Notes	Evidence of previous movement was apparent in the building, however, within the limitations of our inspection I found no evidence to suggest that movement appeared serious or that there were obvious signs of recent movement.

Dampness, rot and infestation

Repair category:	3
Notes	Damp meter readings were obtained around the entrance door. Repairs will be required in order to prevent further damage and deterioration within this area. There are a number of damp stained ceiling surfaces within the staircase area and also at the upper landing. These were dry when tested but will require to be carefully monitored in the future. There is evidence of past woodworm infestation to roofing timbers within the main loft. If untreated to date then estimates can be obtained from a timber specialist contractor for any required eradication works.

Chimney stacks

Repair category:	1
Notes	Ongoing pointing and masonry attention will be required to chimneyheads. Usual erosion apparent.

Roofing including roof space

Repair category:	1
Notes	The roof surfaces were obscured by snow during my inspection, although it does appear that elements of slaterwork have been renewed in the past. I would comment on the flat roof section at the rear. Flat roofs are generally perceived to be an inferior form of roof construction having limited life span and requiring above average and vigilant maintenance attention. This type of roof covering can fail without warning at which time you will need to repair or replace. Roof space: As stated above there is evidence of woodworm infestation to roofing timbers and if untreated to date then estimates can be obtained from a timber treatment specialist for any required eradication measures.

Rainwater fittings



Repair category:	2
Notes	Some corrosion noted to gutter joints which will require maintenance attention.

Main walls



Repair category:	2
Notes	Elements of cracked render noted to the rear projection. A building contractor will be able to repair as required. External stonework will require an ongoing programme of pointing and masonry attention.

Windows, external doors and joinery



Repair category:	2
Notes	Replacement windows of this age typically require ongoing maintenance attention to ironmongery, hinge mechanisms etc, whilst sealed double glazed units can fail without warning. Ongoing maintenance attention will be required to mastic sealants etc. Some weathered fascia timbers noted at the rear projection which will require repair/attention. in due course.

External decorations



Repair category:	2
Notes	Repainting works will be required following joinery and maintenance attention.

Conservatories/porches



Repair category:	-
Notes	None

Communal areas



Repair category:	2
Notes	An ongoing programme of repair and maintenance work will be required to the common building fabric as is typical in a building of this type and age. Elements of damaged boundary fencing noted at the rear and pointing repairs and masonry attention will also be required to the stone boundary walls. The outbuilding at the rear is also in need of repair and appears in a somewhat dilapidated condition.



Garages and permanent outbuildings



Repair category:	2
Notes	As stated above, the outbuilding is in poor condition.

Outside areas and boundaries



Repair category:	2
Notes	Repair and maintenance works are required to boundary fencing, stone boundary walls etc. Some elements were however, obscured by vegetation.

Ceilings



Repair category:	2
Notes	Some areas of damp stained ceiling surfaces noted in the stairwell. These were dry when tested but will require to be carefully monitored in the future. There are some areas of artex/textured finishes to ceilings, and some elements have been removed from the main bedroom ceiling. Artex typically contains asbestos and as such specialist advice should be sought prior to the material being disturbed in any way. Some ceiling surfaces have been recently boarded over with plasterboard although some finishing works remain outstanding.

Internal walls



Repair category:	2
Notes	A section of wall within the kitchen has been boarded over with an element of chipboard material and again plaster/ finishing works are required in this area. Some timber panellings also remain within the kitchen window recess. Areas of plaster cracking also evident indicative of past settlement of the building.

Floors including sub-floors



Repair category:	1
Notes	No significant defects evident. It is not unusual to discover areas of past water spillage when floor coverings are removed in kitchen and bathroom compartments, revealing the need for further repair and maintenance work. Some elements of flooring were noted to run off level indicative of past settlement of the building.

Internal joinery and kitchen fittings



Repair category:	2
Notes	Some timber linings remain within the kitchen which may present a fire hazard. Usual wear and tear apparent.

Chimney breasts and fireplaces



Repair category:	-
Notes	None

Internal decorations



Repair category:	1
Notes	Internal decor is always a matter for personal taste.

Cellars



Repair category:	-
Notes	None

Electricity



Repair category:

2

Notes

The electrical installation is of a fairly dated design in part with older sockets and switches present in the property, some of which are mounted on skirting boards, and the fusebox is of particularly dated design. Upgrading/modernisation work will be required to the installation. Further advice and estimates can be obtained from an NICEIC/SELECT registered contractor.

Gas



Repair category:

1

Notes

Trade bodies governing gas installations currently advise that gas appliances should be tested prior to change in occupancy and thereafter at least once a year by a Gas Safe registered contractor. It is assumed that gas appliances comply with relevant regulations.

Water, plumbing and bathroom fittings



Repair category:

1

Notes

No significant defects evident.

Heating and hot water



Repair category:

1

Notes

It is assumed that the heating and hot water systems have been properly serviced and maintained on a regular basis and installed in accordance with the relevant regulations. Your own contractor will be able to ensure serviceability.

Drainage



Repair category:

1

Notes

No significant defects evident.

Summary:

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Category 3 Urgent Repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Structural Movement	1
	Dampness, rot and infestation	3
	Chimney stacks	1
	Roofing including roof space	1
	Rainwater fittings	2
	Main walls	2
	Windows, external doors and joinery	2
	External decorations	2
	Conservatories/porches	-
	Communal areas	2
	Garages and permanent outbuildings	2
	Outside areas and boundaries	2
	Ceilings	2
	Internal walls	2
	Floors including sub floors	1
	Internal joinery and kitchen fittings	2
	Chimney breasts and fireplaces	-
	Internal decorations	1
	Cellars	-
	Electricity	2
	Gas	1
	Water, plumbing and bathroom fittings	1
	Heating and hot water	1
	Drainage	1

Remember:

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

3. ACCESSIBILITY INFORMATION

Guidance notes on Accessibility Information:

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes; parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin operated machines.

1	Which floor(s) is the living accommodation on?	First
2	Are there three steps or fewer to a main entrance door of the property?	Yes
3	Is there a lift to the main entrance door of the property?	No
4	Are all door openings greater than 750mm?	No
5	Is there a toilet on the same level as the living room and kitchen?	No
6	Is there a toilet on the same level as a bedroom?	No
7	Are all rooms on the same level with no-internal steps or stairs?	No
8	Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes

Matters for a solicitor or licensed conveyancer:

Past alteration work has been carried out to create the existing layout and accommodation. It is assumed that all necessary Local Authority and other consents have been obtained for alterations and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it has been assumed that they meet the standards required by the Building Regulations or are exempt.

The exact extent of liability for upkeep of the common fabric can be verified by reference to title deed documentation together with any allocation of garden grounds etc.

Estimated re-instatement cost for insurance purposes:

£270,000 (Two Hundred and Seventy Thousand Pounds).

It should be noted this sum is an estimate calculated by using a rate per square metre based on information provided by Building Cost Information Service (BCIS).

Valuation and market comments:

£90,000 (Ninety Thousand Pounds).

Prevailing market conditions have been reflected in the reported opinion of value.

This is a replacement single survey, the original inspection having been undertaken on October 2019 and a further replacement single survey undertaken on 27 January 2020

Signed:	Electronically by Gordon McCulloch
Report author:	Gordon McCulloch
Company name	DM Hall (Falkirk)
Address:	Unit 6a The Courtyard, Callendar Business Park, Falkirk, FK1 1XR
Date of report:	25/02/2021

Mortgage Valuation Report

42

Kirk Street

Alloa

Clackmannanshire

FK10 4PT

Seller's Name:

Mhari Thomson

Date of Inspection:

09/02/2021

Prepared by:

Gordon McCulloch

1. Property Details

Property type:	Converted flat
Floor(s) on which located (<i>Flat or maisonettes only</i>):	1
Number of floors in block (<i>Flat or maisonettes only</i>):	2
Number of units in block (<i>Flat or maisonettes only</i>):	2
Is there a lift provided? (<i>Flat or maisonettes only</i>):	No
Property style:	Low rise block
Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?	No
Approximate year of construction:	1900

2. Tenure

Tenure:	Absolute Ownership
Ground rent:	
Unexpired years:	

3. Accommodation

Number of living rooms:	1
Number of bedrooms:	3
Number of kitchens:	1
Number of Bathrooms	1
Number of water closets:	0
Other Rooms:	0
Internal gross floor area (excluding garages and outbuildings):	87m ²
External gross floor area (excluding garages and outbuildings):	m ²
Does the property have a residential element greater than 40%?	Yes

4. Garage / Parking / Outbuildings

Parking type:	No garage / garage space / parking space
Available on site?	No
Permanent Outbuildings:	None of any significant value.

5. Construction

Main wall type:	Stone
Other (please specify):	
Roof type:	Slate
Other (please specify):	

6. Special Risks

Has the property suffered structural movement?	Yes
Is this recent or progressive?	No
Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the	No

immediate vicinity?	
---------------------	--

If yes, please specify any of the above:	
--	--

7. Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in the 'brief description of central heating' section below

Drainage:	Mains
Electricity:	Mains
Central Heating:	Yes
Water:	Mains
Gas:	Mains
Brief description of central heating:	Gas fired boiler serving radiators.

8. Site

Apparent legal issues to be verified by the conveyancer

Legal Issue		Verification	Description
Rights of way:	No		
Shared drives / access:			
Garage or other amenities on separate site:			
Shared service connections:			
Ill-defined boundaries:			
Agricultural land included with property:			
Other:			

9. Location

Location type:	Commuter village
Other (if not specified):	

10. Planning Issues

Has the property been extended / converted / altered?	Yes
Details (if extended, converted, or altered):	Past alteration work has been carried out to create the existing layout and accommodation. It is assumed that all necessary Local Authority and other consents have been obtained for alterations and that the appropriate documentation, including Building Warrants and Completion Certificates issued. If any works did not require consent then it has been assumed that they meet the standards required by the Building Regulations or are exempt. The exact extent of liability for upkeep of the common fabric can be verified by reference to title deed documentation together with any allocation of garden grounds etc.

11. Roads

Roads that relate to the property:	Made up road
------------------------------------	--------------

12. General Remarks

General remarks on the property:	The property is contained within an established residential area of mixed style properties, and situated within reasonable distance of local amenities. At the time of inspection the subjects were found to have been maintained in an order consistent with age and type but will require regular and going maintenance particularly to the external building fabric. Evidence of previous movement apparent within the building, however, within the limitations of our inspection we found no evidence to suggest that movement appeared serious or there were obvious signs of recent movement.
----------------------------------	---

13. Essential Repairs

Information relating to essential repairs for the property:	
---	--

Estimated cost of essential repairs:	
--------------------------------------	--

Retention recommendation?	
---------------------------	--

Amount:	
---------	--

14. Comment on Mortgageability

Information relating to mortgageability of the property:	The subjects form suitable security for mortgage purposes.
--	--

15. Valuations

Market value in present condition:	£90,000.00
------------------------------------	------------

Market value on completion of essential repairs:	
--	--

Insurance reinstatement value (to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)	£270,000.00
--	-------------

Is re-inspection necessary?	No
-----------------------------	----

Signed:	Electronically by Gordon McCulloch
Report author:	Gordon McCulloch
Company name:	DM Hall (Falkirk)
Address:	Unit 6a The Courtyard, Callendar Business Park, Falkirk, FK1 1XR
Date of report:	25/02/2021

PROPERTY QUESTIONNAIRE



DM HALL
CHARTERED SURVEYORS

Property Questionnaire

42

Kirk Street

Alloa

Clackmannanshire

FK10 4PT

Property Address:

42
Kirk Street
Alloa
Clackmannanshire
FK10 4PT

Seller(s):

Mhari Thomson

Completion date of Property Questionnaire:

25/02/2021

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1. Length of ownership

How long have you owned the property?	3 years and 11 months
---------------------------------------	-----------------------

2. Council Tax

Which Council Tax band is your property in?	B
---	---

3. Parking

What are the arrangements for parking at your property?	On street
---	-----------

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	No
---	----

5. Listed Buildings

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	No
---	----

6. Alterations/additions/extensions

a. (i). During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	No
---	----

<i>If you have answered yes, please describe the changes which you have made:</i>	
---	--

(ii). Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	
--	--

<i>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</i> <i>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.</i>	
b. Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	No
(i). Were the replacements the same shape and type as the ones you replaced?	
(ii). Did this work involve any changes to the window or door openings?	
(iii). Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed?) Please give any guarantees which you received for this work to your solicitor or estate agent.	
7. Central Heating	
a. Is there a central heating system in your property? Note: A partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom). <i>If you answered yes/partial:</i> What kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas, warm air). <i>If you answered yes, please answer the following three questions:</i>	Yes
(i). When was your central heating system or partial central heating system installed?	Gas
(ii). Do you have a maintenance contract for the central heating system? <i>If you have answered yes, please give details of the company with which you have a maintenance agreement:</i>	Unsure
(iii). When was your maintenance agreement last renewed? (Please provide the month and year).	No

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

No

Note: The surveyor will provide this within their inspection.

9. Issues that may have affected your property

a.

Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b.

Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10. Services

a.

Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas		
Water mains/private water supply		
Electricity		
Mains drainage		
Telephone		
Cable TV/Satellite		
Broadband	No	

b.

Is there a septic tank system in the property?

No

If you have answered yes, please answer the two questions below:

(i). Do you have appropriate consents for the discharge from your septic tank?

(ii). Do you have maintenance contract for your septic tank?

If you have answered yes, please give details of the company with which you have a maintenance contract:

11. Responsibilities for Shared or Common Areas

a.

Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

No

If you have answered yes, please give details:

b.

Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

No

If you have answered yes, please give details:

c.

Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

No

d.

Do you have the right to walk over any of your neighbours' property - for example, to put out your rubbish bin or to maintain your boundaries?

Yes

If you have answered yes, please give details:

We have a shared garden with neighbours below

e.

As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

Yes

If you have answered yes, please give details:

We have a shared garden

f.

As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned).

No

If you have answered yes, please give details:

12. Charges associated with your property

a.

Is there a factor or property manager for your property?

No

If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:

b.

Is there a common buildings insurance policy?

No

If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?

c.

Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Resident's Association, or maintenance or stair fund.

13. Specialist Works

a.

As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?

No

If you have answered yes, please say what the repairs were for, whether they carried out the repairs (and when), or if they were done before you bought the property:

b.

As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?

No

If you have answered yes, please give details:

c.

If you have answered yes to 13 (a) or (b), do you have any guarantees relating to this work?

If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be

shown in the original estimate.

Guarantees are held by:

14. Guarantees

a.

Are there any guarantees or warranties for any of the following?

(i). Electrical work

No

(ii). Roofing

No

(iii). Central Heating

No

(iv). NHBC

No

(v). Damp course

No

(vi). Any other work or installations? (For example, cavity wall insulation, underpinning, indemnity policy)

No

b.

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

c.

Are there any outstanding claims under any of the guarantees listed above?

If you have answered yes, please give details

No

15. Boundaries

a.

So far as you are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years, have you ever received a notice;

a.

advising that the owner of a neighbouring property has made a planning application?

No

b.

that affects your property in some other way?

No

c.

that requires you to do any maintenance, repairs or improvements to your property?

No

Notice:

If you have answered yes to any of **a.-c.** above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

SINGLE SURVEY TERMS AND CONDITIONS (WITH MVR)

PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. ¹

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

¹ Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

Prior to 1st December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report² for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid.

Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;

² Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is *The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion*
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from*

ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant

defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

DM Hall Offices

Aberdeen

01224 594172

Galashiels

01896 752009

Livingston

01506 490404

Ayr

01292 286974

Glasgow (North)

0141 332 8615

Musselburgh

0131 665 6782

Cumbernauld

01236 618900

Glasgow (South)

0141 636 4141

Oban

01631 564225

Cupar

01334 844826

Hamilton

01698 284939

Paisley

0141 887 7700

Dumfries

01387 254318

Inverness

01463 241077

Perth

01738 562100

Dundee

01382 873100

Inverurie

01467 624393

Peterhead

01779 470220

Dunfermline

01383 621262

Irvine

01294 311070

Stirling

01786 475785

Edinburgh

0131 477 6000

Kirkcaldy

01592 598200

Elgin

01343 548501

Falkirk

01324 628321

DMHALL.CO.UK

