

"THE NATIONAL PROPERTY SERVICE"



Home Report

Property: **2/2**
356 Pollokshaws Road
Glasgow
Lanarkshire
G41 1QS

Prepared for: **Emma Downie**

Prepared by: **Antony Burns**

Report reference: **840486-1-2**

Date of Report: **11/10/2019**



Energy performance certificate

Energy Performance Certificate (EPC)

Scotland

Dwellings

FLAT 2/2 , 356 POLLOKSHAWS ROAD, GLASGOW, G41 1QS

Dwelling type: Mid-floor flat
Date of assessment: 11 October 2019
Date of certificate: 17 October 2019
Total floor area: 62 m²
Primary Energy Indicator: 104 kWh/m²/year

Reference number: 9491-1911-5200-1151-8904
Type of assessment: RdSAP, existing dwelling
Approved Organisation: Elmhurst
Main heating and fuel: Boiler and radiators, mains gas

You can use this document to:


- Compare current ratings of properties to see which are more energy efficient and environmentally friendly

Estimated energy costs for your home for 3 years*

£993

* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

Very energy efficient - lower running costs

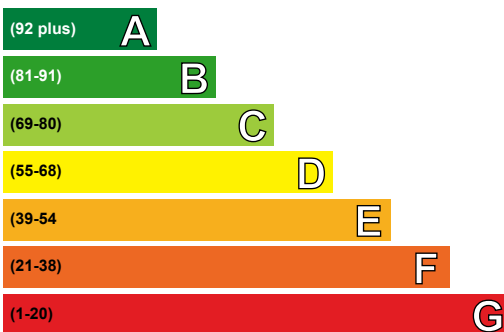

Not energy efficient - higher running costs

Current	Potential
82	82


Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band B (82)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Very environmentally friendly - lower CO₂ emissions

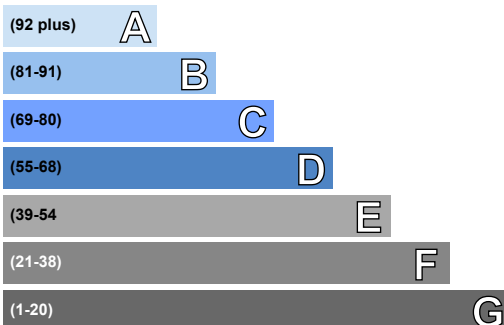

Not environmentally friendly - higher CO₂ emissions

Current	Potential
86	86

Environmental Impact (CO₂) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO₂) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band B (86)**. The average rating for EPCs in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

Top actions you can take to save money and make your home more efficient

There are currently no improvement measures recommended for your home.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	System built, as built, insulated (assumed) Solid brick, as built, insulated (assumed)	★★★★★ ★★★★★	★★★★★ ★★★★★
Roof	(another dwelling above)	—	—
Floor	(another dwelling below)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	Low energy lighting in all fixed outlets	★★★★★	★★★★★

The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO₂ emissions, running costs and the savings possible from making improvements.

The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 18 kg CO₂/m²/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 1.1 tonnes of carbon dioxide every year. You could reduce emissions by switching to renewable energy sources.

Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£531 over 3 years	£531 over 3 years	Not applicable
Hot water	£300 over 3 years	£300 over 3 years	
Lighting	£162 over 3 years	£162 over 3 years	
Totals	£993	£993	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

Recommendations for improvement

None

Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to www.energysavingtrust.org.uk/scotland/rhi.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	1,241	N/A	N/A	N/A
Water heating (kWh per year)	1,889			

About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. Antony Burns
Assessor membership number:	EES/023012
Company name/trading name:	J & E Shepherd
Address:	13 Albert Square Dundee DD1 1XA
Phone number:	01382 200454
Email address:	dundee@shepherd.co.uk
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.



Scottish Single Survey

Single Survey

survey report on:

Property address	Flat 2/2 356 Pollokshaws Road Glasgow G41 1QS
Customer	Ms. Emma Downie
Customer address	
Prepared by	J & E Shepherd
Date of inspection	11th October 2019



PART 1 - GENERAL

1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property¹.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box. ☒

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

¹ Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report² will be from information contained in the Report and the generic Mortgage Valuation Report.

² Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;

- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

PART 2 - DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

WARNING:

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

Description	The subject property comprises a purpose built modern flat. The subjects are located on the second floor of a six storey end terraced block containing twenty three flats in total along with a parking area at ground level.
Accommodation	SECOND FLOOR:- Entrance Hallway, Open Plan Living/Kitchen/Dining Area, Master Bedroom (with en-suite bathroom), Second Bedroom & Shower Room (with Wc).
Gross internal floor area (m²)	62 sq metres or thereby.
Neighbourhood and location	The subjects are located within a central southern district of Glasgow where surrounding properties vary in age and character. Adequate local shopping, educational and public transport facilities are available close by. The subjects front Pollokshaws Road which is a busy thoroughfare with commercial premises at ground floor of neighbouring blocks.
Age	Believed to be constructed circa 2009.
Weather	Dry but overcast.
Chimney stacks	Not applicable.
Roofing including roof space	Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.

	If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so. The roof was unseen but is believed to be of shallow mono pitched design and overlaid with profile metal sheeting and/or similar. No access to any roof void area was possible. Sloping roofs were visually inspected with the aid of binoculars where appropriate. Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.
Rainwater fittings	Visually inspected with the aid of binoculars where appropriate. The rainwater goods serving the subjects were predominantly seen to be formed in PVC materials.
Main walls	Visually inspected with the aid of binoculars where appropriate. Foundations and concealed parts were not exposed or inspected. The main walls appear to be of steel frame construction with brick/block infill. The main walls are finished in a combination of brick/block, synthetic stone, render and cladding.
Windows, external doors and joinery	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open. The windows in the property were seen to be of uPVC construction containing double glazing. The common stairwell was accessed by glazed timber doors to the front and rear. The flat is accessed by a timber door.

Single Survey

External decorations	Visually inspected. External decorations incorporate paint finishes.
Conservatories / porches	Not Applicable.
Communal areas	Circulation areas visually inspected. The subjects are accessed by way of a typical stairwell for a property of this age providing access to all levels. The block benefits from lift provision. There is also a communal bin area located within the development.
Garages and permanent outbuildings	Visually inspected. There are no garaging facilities although there is underground private parking at ground level of the development. Confirmation as to any parking space should be obtained by inspection of the Title Deeds.
Outside areas and boundaries	Visually inspected. There is a communal courtyard located on the first floor level of the development which forms the roof structure to the parking facility below.
Ceilings	Visually inspected from floor level. The ceilings in the property were seen to be formed in plasterboard materials.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate. Internal walls in the property are overlaid in plasterboard finishes.
Floors including sub floors	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted. Flooring within the property appeared to be of floating timber construction over a solid concrete design. Fitted floorcoverings were noted throughout which restricted the scope of our inspection.

Single Survey

Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances. Internal joinery incorporates timber skirtings and door facings. The kitchen facility incorporates fitted units.
Chimney breasts and fireplaces	Not applicable.
Internal decorations	Visually inspected. Internal decorations incorporate paint and tiled finishes.
Cellars	Not applicable.
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. The electrical switchgear is located in the hall cupboard.
Gas	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on. The gas meter is located in the hall cupboard.
Water, plumbing, bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances. Water is assumed to be connected to the mains. Water piping, where visible, was run in copper and PVC. The en-suite fittings incorporate a bath, Wc & wash hand basin. The shower room fittings incorporate a shower cubicle, Wc & wash hand basin.


Single Survey

Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances. Domestic heating is provided by way of a gas fired boiler wall mounted within the master bedroom cupboard which vents by way of a flue to the front wall of the property.
Drainage	Drainage covers etc. were not lifted. Neither drains nor drainage systems were tested. Drainage is assumed to be connected to the main public sewer.
Fire, smoke and burglar alarms	Visually inspected. No tests whatsoever were carried out to the system or appliances. There were smoke alarms present in the property. These were not tested.
Any additional limits to inspection	For flats / maisonettes Only the subject flat and internal communal areas giving access to the flat were inspected. If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation. The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance. No view of the roof covering was possible and as such we cannot comment upon its condition. No access to any roof void area was possible and as such we cannot comment upon its condition. An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. The property was fully furnished and had fitted floor coverings, therefore no detailed inspection was possible of the floors and accordingly, no comment can be made on their condition. Internal cupboards were generally filled with storage items. No access was available beneath sanitary or kitchen fittings.

Single Survey

	Windows and external doors were not all fully opened or tested. No access was available to any sub-floor areas. Due to the decorative finishes found over the surfaces in the property we could not inspect areas below and cannot fully comment upon condition.
--	---

Sectional Diagram showing elements of a typical house

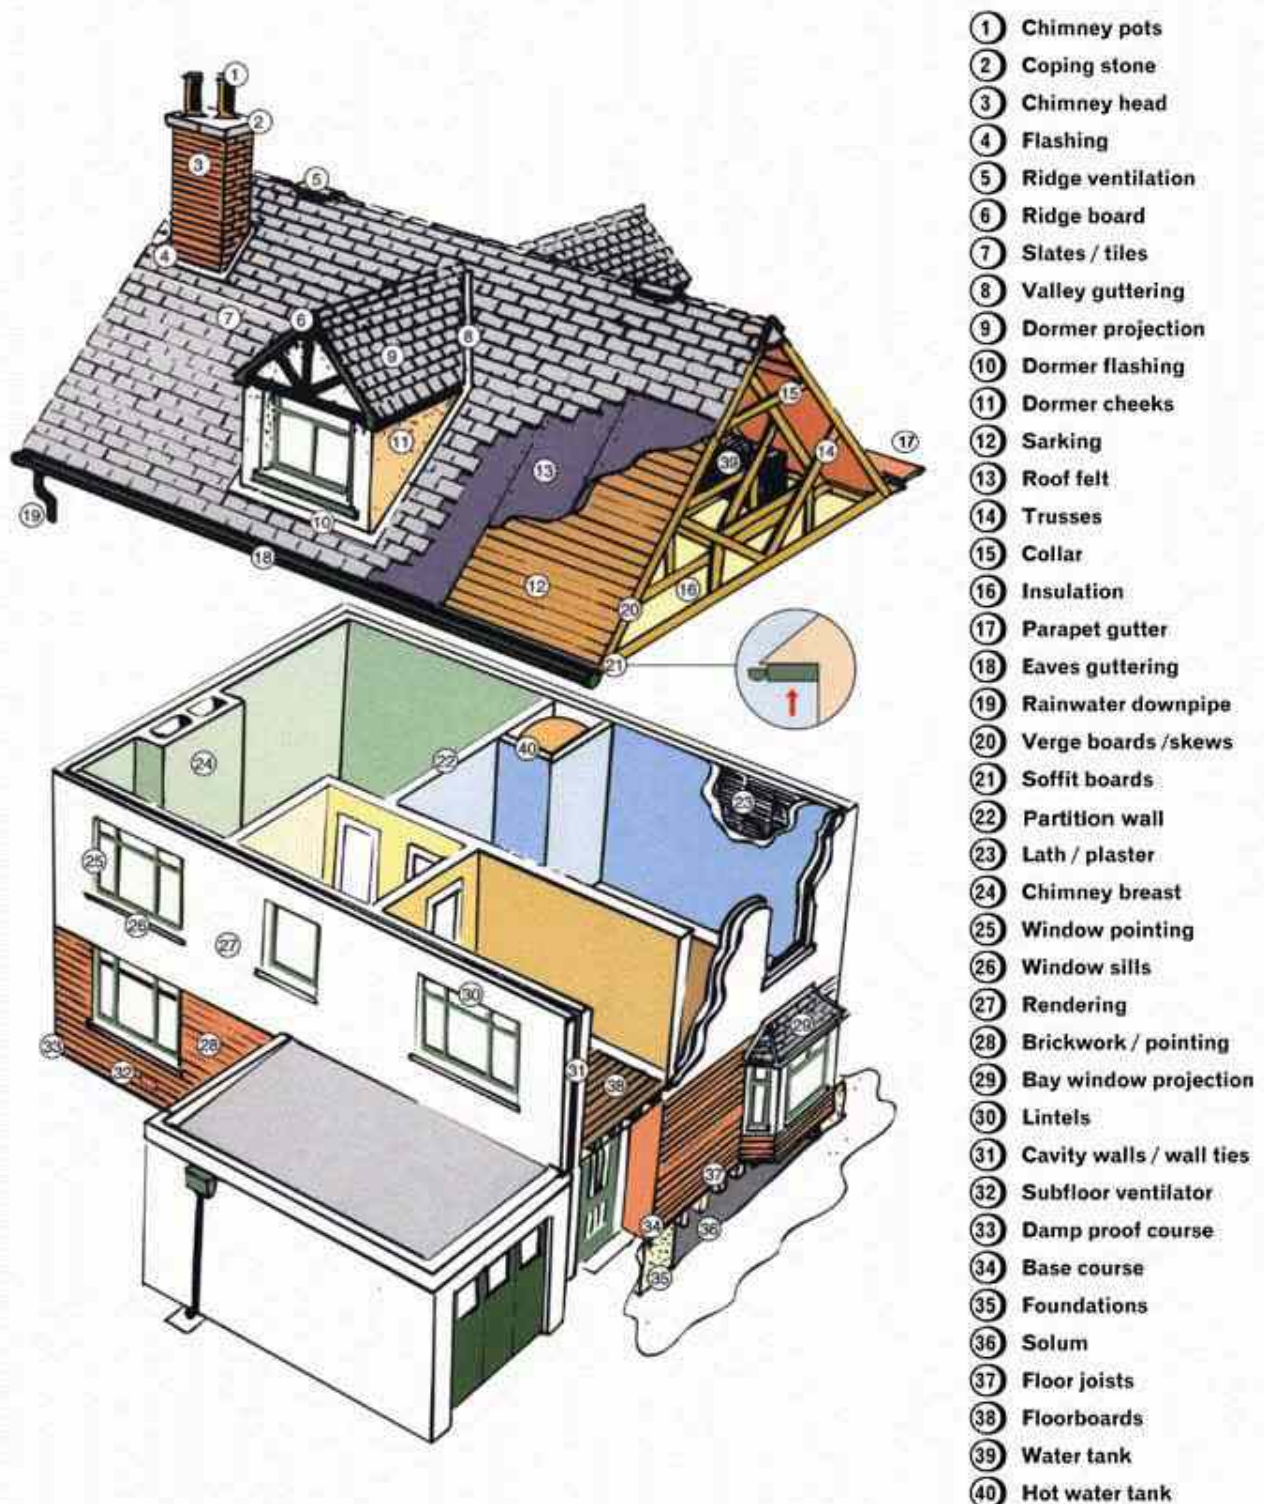

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

Single Survey

2. Condition

This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	There was no evidence of significant structural movement within the limitations of our inspection.

 Dampness, rot and infestation	
Repair category	1
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range.

 Chimney stacks	
Repair category	-
Notes	Not applicable.

 Roofing including roof space	
Repair category	1
Notes	As previously mentioned no view of the roof covering was possible and as such we cannot comment upon its condition. It should be anticipated that due to the nature of construction ongoing maintenance and repairs will be required.

Single Survey



Rainwater fittings

Repair category	1
Notes	Within the limitations of our inspection rainwater goods were seen to be free from significant defect. We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.



Main walls

Repair category	3
Notes	Please see comments in 'Matters for solicitor or licensed conveyancer' regarding the external cladding and fire safety. Stained and weathered masonry/cladding was noted requiring an element of repair/ongoing maintenance.



Windows, external doors and joinery

Repair category	1
Notes	Windows were not all fully opened or tested and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted. It is assumed that replacement windows comply with relevant building and fire regulations.



External decorations

Repair category	1
Notes	The standard of external decoration is fair.



Conservatories/porches

Repair category	-
Notes	Not applicable.



Communal areas

Repair category	1
Notes	Ongoing maintenance should be anticipated.

Single Survey



Garages and permanent outbuildings

Repair category	1
Notes	Ongoing maintenance should be anticipated.



Outside areas and boundaries

Repair category	1
Notes	Ongoing maintenance should be anticipated.



Ceilings

Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.



Internal walls

Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.



Floors including sub-floors

Repair category	1
Notes	Due to fitted carpets and floor coverings no detailed inspection of floors was possible and accordingly no comment can be made on their condition.



Internal joinery and kitchen fittings

Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.



Chimney breasts and fireplaces

Repair category	-
Notes	Not applicable,

Single Survey



Internal decorations

Repair category	1
Notes	Within the limitations of our inspection no significant defects were noted.



Cellars

Repair category	-
Notes	Not applicable.



Electricity

Repair category	1
Notes	The Institute of Engineering and Technology recommends that inspections and testings are undertaken at least every ten years and on a change of occupancy. It should be appreciated that only the most recently constructed or re-wired properties will have installations which fully comply with present IET regulations.



Gas

Repair category	1
Notes	In the interests of safety and in light of recent regulations it would be prudent to have all gas appliances checked by a Gas Safe registered contractor.



Water, plumbing and bathroom fittings

Repair category	1
Notes	No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted.



Heating and hot water

Repair category	1
Notes	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements.



Drainage

Repair category	1
Notes	All foul and surface water drainage is assumed to be to the main public sewer. The system was not tested.

Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	3
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	1
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	-
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

Category 1

No immediate action or repair is needed.

Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

Single Survey

3. Accessibility information

Guidance notes on accessibility information

Three steps or fewer to a main entrance door of the property:

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

Unrestricted parking within 25 metres:

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Second
2. Are there three steps or fewer to a main entrance door of the property?	Yes ☐ No ☒
3. Is there a lift to the main entrance door of the property?	Yes ☒ No ☐
4. Are all door openings greater than 750mm?	Yes ☐ No ☒
5. Is there a toilet on the same level as the living room and kitchen?	Yes ☒ No ☐
6. Is there a toilet on the same level as a bedroom?	Yes ☒ No ☐
7. Are all rooms on the same level with no internal steps or stairs?	Yes ☒ No ☐
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes ☒ No ☐

4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

Matters for a solicitor or licensed conveyancer

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialist's or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The subjects form part of a tenement/block of flats and it has been assumed that maintenance/repair costs of the common parts of the building will be shared on an equitable basis with adjoining proprietors. It is therefore assumed that the cost of common repairs detailed within the report will be apportioned accordingly although exact liability should be confirmed.

It is assumed that there are no statutory, town planning, road proposals or environmental matters which are likely to have an adverse effect on the property.

The road and footpath adjoining the site are made up and are assumed to be adopted by the Local Authority.

It is our understanding that the property was constructed in 2009 and all documentation for this including any valid NHBC should be obtained and held with the Title Deeds.

For properties over 18 meters where the valuer identifies that the external wall system of the subject property may contain potentially combustible materials, we require the building owner, or its agent, the person having duties under Section 53 or 54 of The Fire (Scotland) Act 2005, to produce a written report, prepared by a suitably qualified independent professional adviser, who is a member of one of the professional bodies approved by the Ministry of Housing Communities and Local Government (MHCLG), and information Note 1, (or any subsequent approved list), to confirm that the subject property meets the requirements of the current guidance notes from MHCLG.

In the event that the Report identifies the presence of any aluminium composite material, we would require the building owner and/or its agent to produce written evidence that the external walls system complies with the testing routine described in CF8414 and within the CR135 Classification.

Estimated reinstatement cost for insurance purposes

For Reinstatement Cost Assessment purposes, it is recommended that the subjects be insured for a sum of not less than £145,000 (ONE HUNDRED AND FORTY FIVE THOUSAND POUNDS STERLING).

This figure is the estimate of the cost of rebuilding the premises and bears no direct relationship to current market value.

Single Survey

Valuation and market comments

Having considered matters, taking account of our general observations on site, we are of the opinion that the Market Value of the subjects in their present condition and with the benefit of vacant possession may be fairly stated in the sum of £120,000 (ONE HUNDRED AND TWENTY THOUSAND POUNDS STERLING) (Subject to clarification and confirmation as to the safety of the external cladding with regards to fire safety).

Signed

Security Print Code [578678 = 8024]
Electronically signed

Report author

A Burns

Company name

J & E Shepherd

Address

269 Kilmarnock Road, Glasgow, G43 1TX

Date of report

25th October 2019

Mortgage Valuation Report



Property Address

Address Flat 2/2, 356 Pollokshaws Road, Glasgow, G41 1QS
Seller's Name Ms. Emma Downie
Date of Inspection 11th October 2019

Property Details

Property Type ☐ House ☐ Bungalow ☒ Purpose built maisonette ☐ Converted maisonette
☐ Purpose built flat ☐ Converted flat ☐ Tenement flat ☐ Flat over non-residential use
☐ Other (specify in General Remarks)

Property Style ☐ Detached ☐ Semi detached ☐ Mid terrace ☐ End terrace
☐ Back to back ☒ High rise block ☐ Low rise block ☐ Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police? ☐ Yes ☒ No

Flats/Maisonettes only Floor(s) on which located No. of floors in block Lift provided? ☒ Yes ☐ No
No. of units in block

Approximate Year of Construction

Tenure

☒ Absolute Ownership ☐ Leasehold Ground rent £ Unexpired years

Accommodation

Number of Rooms Living room(s) Bedroom(s) Kitchen(s)
 Bathroom(s) WC(s) Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings) m² (Internal) m² (External)

Residential Element (greater than 40%) ☒ Yes ☐ No

Garage / Parking / Outbuildings

☐ Single garage ☐ Double garage ☒ Parking space ☐ No garage / garage space / parking space
Available on site? ☒ Yes ☐ No

Permanent outbuildings:

None.

Mortgage Valuation Report

Construction

Walls ☐ Brick ☐ Stone ☐ Concrete ☐ Timber frame ☒ Other (specify in General Remarks)
Roof ☐ Tile ☐ Slate ☐ Asphalt ☐ Felt ☒ Other (specify in General Remarks)

Special Risks

Has the property suffered structural movement? ☐ Yes ☒ No

If Yes, is this recent or progressive? ☐ Yes ☐ No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity? ☐ Yes ☒ No

If Yes to any of the above, provide details in General Remarks.

Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage ☒ Mains ☐ Private ☐ None Water ☒ Mains ☐ Private ☐ None
Electricity ☒ Mains ☐ Private ☐ None Gas ☒ Mains ☐ Private ☐ None
Central Heating ☒ Yes ☐ Partial ☐ None

Brief description of Central Heating:

Gas fired boiler to radiators.

Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

☐ Rights of way ☒ Shared drives / access ☐ Garage or other amenities on separate site ☐ Shared service connections
☐ Ill-defined boundaries ☐ Agricultural land included with property ☐ Other (specify in General Remarks)

Location

☒ Residential suburb ☐ Residential within town / city ☐ Mixed residential / commercial ☐ Mainly commercial
☐ Commuter village ☐ Remote village ☐ Isolated rural property ☐ Other (specify in General Remarks)

Planning Issues

Has the property been extended / converted / altered? ☐ Yes ☒ No

If Yes provide details in General Remarks.

Roads

☒ Made up road ☐ Unmade road ☐ Partly completed new road ☐ Pedestrian access only ☐ Adopted ☐ Unadopted

Mortgage Valuation Report

General Remarks

The subject property comprises a purpose built modern flat located on the second floor of a six storey end terraced block containing twenty three flats in total along with a parking area at ground level.

The subjects are located within a central southern district of Glasgow where surrounding properties vary in age and character.

Adequate local shopping, educational and public transport facilities are available close by.

The subjects front Pollokshaws Road which is a busy thoroughfare with commercial premises at ground floor of neighbouring blocks.

At the time of inspection the property was found to be well maintained having regard to its age and character. A small number of items were noted as requiring attention and an element of repair/ongoing maintenance should be anticipated to ensure no further defects occur.

Main Walls:- The main walls appear to be of steel frame construction with brick/block infill.

Roof:- The roof appeared to be of shallow mono pitched design overlaid with profile metal sheeting.

For properties over 18 meters where the valuer identifies that the external wall system of the subject property may contain potentially combustible materials, we require the building owner, or its agent, the person having duties under Section 53 or 54 of The Fire (Scotland) Act 2005, to produce a written report, prepared by a suitably qualified independent professional adviser, who is a member of one of the professional bodies approved by the Ministry of Housing Communities and Local Government (MHCLG), and information Note 1, (or any subsequent approved list), to confirm that the subject property meets the requirements of the current guidance notes from MHCLG.

In the event that the Report identifies the presence of any aluminium composite material, we would require the building owner and/or its agent to produce written evidence that the external walls system complies with the testing routine described in CF8414 and within the CR135 Classification.

We/I am aware that currently lending institutions are issuing guidance to valuers which may differ from the advice given in this GMVR and it is therefore imperative that purchasers check with their funder of choice that mortgage finance will be provided on the property.

Mortgage Valuation Report

Essential Repairs

For properties over 18 meters where the valuer identifies that the external wall system of the subject property may contain potentially combustible materials, we require the building owner, or its agent, the person having duties under Section 53 or 54 of The Fire (Scotland) Act 2005, to produce a written report, prepared by a suitably qualified independent professional adviser, who is a member of one of the professional bodies approved by the Ministry of Housing Communities and Local Government (MHCLG), and information Note 1, (or any subsequent approved list), to confirm that the subject property meets the requirements of the current guidance notes from MHCLG.

In the event that the Report identifies the presence of any aluminium composite material, we would require the building owner and/or its agent to produce written evidence that the external walls system complies with the testing routine described in CF8414 and within the CR135 Classification.

Estimated cost of essential repairs £ Retention recommended? ☒ Yes ☐ No Amount £

Mortgage Valuation Report

Comment on Mortgageability

The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider and subject to the aforementioned reports and repairs.

We/I am aware that currently lending institutions are issuing guidance to valuers which may differ from the advice given in this GMVR and it is therefore imperative that purchasers check with their funder of choice that mortgage finance will be provided on the property.

Valuations

Market value in present condition £

Market value on completion of essential repairs £

Insurance reinstatement value £
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)

Is a reinspection necessary? ☐ Yes ☒ No

Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £

Is the property in an area where there is a steady demand for rented accommodation of this type? ☐ Yes ☐ No

Declaration

Signed Security Print Code [578678 = 8024]
Electronically signed by:-

Surveyor's name A Burns

Professional qualifications BA (Hons) MRICS

Company name J & E Shepherd

Address 269 Kilmarnock Road, Glasgow, G43 1TX

Telephone 0141 649 8020

Fax

Report date 25th October 2019



Property Questionnaire

Property Questionnaire

2/2

356 Pollokshaws Road

Glasgow

Lanarkshire

G41 1QS

Property Address:

2/2
356 Pollokshaws Road
Glasgow
Lanarkshire
G41 1QS

Seller(s):

Emma Downie

Completion date of Property Questionnaire:

12/10/2019

Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

Information to be given to prospective buyer(s)

1. Length of ownership

How long have you owned the property?	2 years and 4 months
---------------------------------------	----------------------

2. Council Tax

Which Council Tax band is your property in?	E
---	---

3. Parking

What are the arrangements for parking at your property?	Allocated parking space
---	-------------------------

4. Conservation Area

Is your property in a designated Conservation Area (i.e. an area of special architectural or historic interest, the character or appearance of which it is desirable to preserve or enhance)?	No
---	----

5. Listed Buildings

Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	No
---	----

6. Alterations/additions/extensions

a. (i). During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	No
---	----

<i>If you have answered yes, please describe the changes which you have made:</i>	
---	--

(ii). Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	
--	--

<i>If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</i>	
<i>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them.</i>	
b. Have you had replacement windows, doors, patio doors or double glazing installed in your property? If you have answered yes, please answer the three questions below:	No
(i). Were the replacements the same shape and type as the ones you replaced?	
(ii). Did this work involve any changes to the window or door openings?	
(iii). Please describe the changes made to the windows, doors, or patio doors (with approximate dates when the work was completed?) Please give any guarantees which you received for this work to your solicitor or estate agent.	
7. Central Heating	
a. Is there a central heating system in your property? Note: A partial central heating system is one which does not heat all the main rooms of the property – the main living room, the bedroom(s), the hall and the bathroom). <i>If you answered yes/partial:</i> What kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas, warm air). <i>If you answered yes, please answer the following three questions:</i>	Yes
(i). When was your central heating system or partial central heating system installed?	Gas
(ii). Do you have a maintenance contract for the central heating system? <i>If you have answered yes, please give details of the company with which you have a maintenance agreement:</i>	When property was built - approximately 10 years ago.
(iii). When was your maintenance agreement last renewed? (Please provide the month and year).	No

8. Energy Performance Certificate

Does your property have an Energy Performance Certificate which is less than 10 years old?

Yes

Note: The surveyor will provide this within his inspection.

9. Issues that may have affected your property

a.

Has there been any storm, flood, fire or other structural damage to your property while you have owned it?

No

If you have answered yes, is the damage the subject of any outstanding insurance claim?

b.

Are you aware of the existence of asbestos in your property?

No

If you have answered yes, please give details:

10. Services

a.

Please tick which services are connected to your property and give details of the supplier:

Services	Connected	Supplier
Gas/liquid petroleum gas	Yes	Octopus
Water mains/private water supply	Yes	Scottish Water
Electricity	Yes	Octopus
Mains drainage	Yes	Scottish Water
Telephone		
Cable TV/Satellite		
Broadband		

b.

Is there a septic tank system in the property?

No

If you have answered yes, please answer the two questions below:

(i). Do you have appropriate consents for the discharge from your septic tank?

(ii). Do you have maintenance contract for your septic tank?

If you have answered yes, please give details of the company with which you have a maintenance contract:

11. Responsibilities for Shared or Common Areas

a.

Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?

Yes

If you have answered yes, please give details:

Factor fees paid to Redpath Bruce.

b.

Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?

Yes

If you have answered yes, please give details:

Factor fees paid to Redpath Bruce.

c.

Has there been any major repair or replacement of any part of the roof during the time you have owned the property?

No

d.

Do you have the right to walk over any of your neighbours' property - for example, to put out your rubbish bin or to maintain your boundaries?

No

If you have answered yes, please give details:

e.

As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?

No

If you have answered yes, please give details:

f.

As far as you are aware, is there a Public Right of Way across any part of your property? (A Public Right of Way is a way over which the public has a right to pass, whether or not the land is privately-owned).

No

<i>If you have answered yes, please give details:</i>	
12. Charges associated with your property	
a. Is there a factor or property manager for your property?	Yes
<i>If you have answered yes, please provide the name and address and give details of any deposit held and approximate charges:</i>	Redpath Bruce, 103 West Regent Street, Glasgow, G2 2DQ. Deposit of £250 and monthly payments of £96.
b. Is there a common buildings insurance policy?	Yes
<i>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</i>	Yes
c. Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, e.g. to a Resident's Association, or maintenance or stair fund.	Monthly charges include buildings insurance, split over factor payments by direct debit to make easier payments rather than up-front. Occasionally notified if any additional work required, and cost is factored into future payments by all tenants.
13. Specialist Works	
a. As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	No
<i>If you have answered yes, please say what the repairs were for, whether they carried out the repairs (and when), or if they were done before you bought the property:</i>	
b. As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	No
<i>If you have answered yes, please give details:</i>	
c. If you have answered yes to 13 (a) or (b), do you have any guarantees relating to this work?	

*If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself, **please write below who has these documents** and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.*

Guarantees are held by:

14. Guarantees

a.

Are there any guarantees or warranties for any of the following?

(i). Electrical work

No

(ii). Roofing

No

(iii). Central Heating

No

(iv). NHBC

No

(v). Damp course

No

(vi). Any other work or installations? (For example, cavity wall insulation, underpinning, indemnity policy)

No

b.

If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):

c.

Are there any outstanding claims under any of the guarantees listed above?

If you have answered yes, please give details

No

15. Boundaries

a.

So far as you are aware, has any boundary of your property been moved in the last 10 years?

No

If you have answered yes, please give details:

16. Notices that affect your property

In the past 3 years, have you ever received a notice;

a.

advising that the owner of a neighbouring property has made a planning application?

No

b.

that affects your property in some other way?

No

c.

that requires you to do any maintenance, repairs or improvements to your property?

No

Notice:

If you have answered yes to any of **a.-c.** above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchase of your property.

RESIDENTIAL SINGLE SURVEY TERMS AND CONDITIONS OF ENGAGEMENT



SINGLE SURVEY TERMS AND CONDITIONS

PART 1 – GENERAL

1.1 THE SURVEYORS

The seller has engaged J & E Shepherd to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The seller has also engaged J & E Shepherd to provide an Energy Report in the format prescribed by the accredited Energy Company.

J & E Shepherd are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific forms where requested. For this service a fee may be charged to the prospective purchaser. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey.

J & E Shepherd will decline any transcript request which requires the provision of information additional to the information in the report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase, made in writing.

Once the Seller has conditionally accepted an offer to purchase, made in writing, the Purchaser's lender or conveyancer may request that J & E Shepherd provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to J & E Shepherd, an additional fee may be incurred by the Purchaser.

If information is provided to J & E Shepherd during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, J & E Shepherd reserves the right to reconsider the valuation. Where J & E Shepherd requires to amend the valuation in consequence of such information, we will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. The attending Surveyor will be a member of the RICS Valuer's Registration Scheme and will have the required experience and competency including the skills, understanding and market knowledge to undertake this valuation.

A replacement Home Report (RHR) may also be required, (see S1.10 attached), and these Terms and Conditions, when accepted and returned to J & E Shepherd also relate and are applicable to any RHR where instructed.

If the Surveyor has had previous involvement in the subject property or if a potential conflict of interest exists, this will be notified in writing as an Appendix to these Terms & Conditions.

J & E Shepherd have a written Complaints Handling Procedure (CHP). This CHP document is available from the offices of J & E Shepherd.

1.2 THE REPORT

The Report provided will be a Scottish Single Survey which is a prescribed document as provided by legislation passed by the Scottish Government including the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008.

J & E Shepherd will not provide an amended Report on the Property, except to correct factual inaccuracies.

The report will identify the nature and source of information relied upon in its preparation.

J & E Shepherd shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

A Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyor rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the report may be published in any way, reproduced or distributed by any party other than the seller, prospective purchasers the Purchaser and their respective professional advisers without the prior written consent of J & E Shepherd.

Information relied upon in the research and preparation of our Report, will be obtained from various sources including information from the Seller including but not restricted to that contained in the Property Questionnaire provided by the Seller, secure and publicly available sales registers, online property information and sales websites and our own records.

1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report shall be prepared in accordance with the RICS Valuation Professional Standards (The Red Book) current version, being the latest published version as at the date of Report. It is confirmed that the valuation will be undertaken in accordance with the International Valuation Standards (IVS). The Firms compliance with these standards may be subject to monitoring under the RICS conduct and disciplinary regulations.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

J & E Shepherd acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. J & E Shepherd accept no responsibility or liability whatsoever in relation to the Report to persons other than the seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, J & E Shepherd accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the report entirely at their own risk.

1.4 GENERIC MORTGAGE VALUATION REPORT

J & E Shepherd undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

The Seller has the option to exclude the generic Mortgage Valuation Report from being produced.

1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

J & E Shepherd undertake that on being asked to do so by a prospective purchaser, and at an optional minimum charge of £50+vat, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between J & E Shepherd and the Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report, which shall be in accordance with the current RICS Valuation Professional Standards (the Red Book) and the RICS International Valuation Standards (IVS).

1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of J & E Shepherd and shall remain their exclusive property unless they assign the same to any other party in writing.

1.7 PAYMENT

J & E Shepherd are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the relevant J & E Shepherd office at any time before the day of the inspection.

J & E Shepherd will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. J & E Shepherd will also be entitled not to proceed if after arriving at the property, the inspecting surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the surveyor's discretion.

In the case of cancellation or the inspection not proceeding, J & E Shepherd will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, J & E Shepherd will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

1.10 DEFINITIONS

- The "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- The "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- The "Generic Mortgage Valuation Report" means a separate report, prepared by J & E Shepherd from information in the Report but in the Surveyor's own format;
- "Replacement Home Report" (RHR) relates to a reinspection of the property to prepare a new full Single Survey in order to replace the previous out of date Home Report, normally required after the original Home Report dates 91 days or older;
- The "Market Value" is the estimated amount for which an asset or liability should exchange on the valuation date between a willing Buyer and a willing Seller in an arm's length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- The "Property" is the property which forms the subject of the Report;
- The "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- A "prospective Purchaser" is anyone considering buying the property;

- The "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in Part 1 of Schedule 1 of The Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- The "Seller" is/are the proprietor(s) of the Property;
- The "Surveyor" is the author of the report on the Property. The inspection and valuation will be carried out by a Surveyor from J & E Shepherd who will also be a member of the RICS and accredited by the Valuer's Registration Scheme (VRS). Any previous involvement by this Surveyor in the property or potential conflicts of interest will be disclosed as per Section 1.1 above;
- The "Surveyors/J & E Shepherd" are the firm or company of whom the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the report;
- The "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format;

PART 2 – DESCRIPTION OF THE REPORT

2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, J & E Shepherd has agreed to supply a generic Mortgage Valuation Report.

2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

Sloping roofs are visually inspected with the aid of binoculars where appropriate. Roof spaces are visually inspected and entered where there is safe and reasonable access, normally defined as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the surveyor deems it safe and reasonable to do so.

Surfaces of exposed floors are visually inspected. No carpets or floor coverings are lifted. Sub-floor areas are inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point. Physical access to the sub floor area may be taken if the surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The surveyor will not carry out an asbestos inspection and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations.

In the case of flats, it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

It is assumed that the subject property site and neighbouring areas are free from Japanese Knotweed. Japanese knotweed is an invasive plant that can damage footpaths, driveways, patios and in the worst cases, it can get into the home itself. It is very difficult to get rid of this plant, and removal of this plant can take a number of years, be costly and may affect future saleability and mortgagability of an affected home. Japanese Knotweed is a seasonal growth plant and is almost invisible during the winter months and during its non-growth phase.

2.3 THE REPORT

The Report will be prepared by the surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.

2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

Where defects or repairs have been identified within the report it is essential that, prior to entering into any legally binding sale or purchase contract, further specialists or contractor's advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

2.4 SERVICES

Our surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. J & E Shepherd cannot of course accept liability for any advice given by the Energy Company.

2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains J & E Shepherd's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which an asset or liability should exchange on the valuation date between a willing buyer and a willing seller in an arm's-length transaction, after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a re-inspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

Unless stated otherwise within this report and in the absence of any information to the contrary, we have assumed that:

- All buildings have been erected either prior to planning control, or in accordance with planning permissions, and have the benefit of permanent planning consents or existing use rights for their current use;
- The property is not adversely affected by town planning or road proposals;
- All alterations, additions or extensions to the property have received all necessary Town Planning Consents, Building Authority Approvals (Building Warrants) and Completion Certificates;
- The property complies with all relevant statutory and local authority requirements, including but not limited to Fire Regulations, The Equality Act, The Control of Asbestos Act, Health and Safety Regulations, Environmental Health Regulations, Regulations governing Residential Tenancies and similar.



North

Inverness	01463 712 239
Elgin	01343 553 939
Fraserburgh	01346 517 456
Peterhead	01779 470 766
Aberdeen	01224 202 800

Tayside

Montrose	01674 676 768
Dundee	01382 200 454
Perth	01738 638 188

Fife

St Andrews	01334 477 773
Kirkcaldy	01592 205 442
Dunfermline	01382 722 337

Lothians/Borders

Edinburgh	01312 251 234
Musselburgh	01316 533 456
Livingston	01506 416 777
Galashiels	01896 750 150
Dalkeith	0131 663 2780

Central

Stirling	01786 450 438
Falkirk	01324 635 999
Cumbernauld	01236 780 000

Lanarkshire

Coatbridge	01236 436 561
Hamilton	01698 897 548
Motherwell	01698 252 229
East Kilbride	01355 248 535

Glasgow/West

Glasgow	0141 353 2080
Glasgow South	0141 649 8020
Greenock	01475 730 717
Paisley	0141 889 8334
Dumbarton	01389 731 682
Hillington	0141 5856373

Ayr/Dumfries

Ayr	01292 267 987
Kilmarnock	01563 520 318
Saltcoats	01294 464 228
Dumfries	01387 264 333

